

PRIMARY CORNER DESCRIPTION Sec Cor for 2 & 3; 34 & 35 of T31-5

Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____

Original - Geo. W. Hyde, under Contract #54 dated Feb. 19, 1855 (DCSO records Vol. 19 Page(s) 7882)

 Set post cor. to secs. 2, 3, 34 and 35, on W. slope, from which


- A Fir 14" dia., bears S.13°W., 47 lks. dist.
- A Fir 4" dia., bears S.81°45'E., 15 lks. dist.
- A Fir 4" dia., bears N.48°E., 30 lks. dist.
- A Maple 10" dia., bears N.31°30'W., 86 lks. dist.

GL0 survey by Oscar F. Thiel, Deputy Surveyor, under Contract #729, dated Dec. 24, 1900 (DCSO records Vol. 20 Page(s) 8627)

 Old post being badly decayed, I reestablish the same by setting a Fir post, 3 ft. long, 4" s., 24" in the ground, for cor. of secs. 2, 3, 34 and 35, marked Tp. 31 S S 35 on NE.; R5W S2 on SE.; Tp. 32 S S3 on SW.; and S34 on NW. sides, with 2 notches on the E. and 4 notches on the W. sides.

BLM resurvey by Hans W. Thielsen under Group #320, Surveyed, Oct/Nov. 1955 (DCSO records Vol. 28 Page(s) 11784-85)

 Point for the cor. of secs. 2, 3, 34 & 35, at proportionate dist; there is no remaining evidence of the original corner. set an iron post 36" long, 2" dia., 30" in the ground, with brass cap marked:

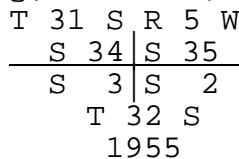

from partially

- A Cedar 57" dia., bears N.20°E., 121 lks. dist., marked T31S R5W S35 BT.
- A Cedar 57" dia., bears S.66°E., 196 lks. dist., marked T32S R5W S2 BT.
- A Cedar 10" dia., bears S.41°W., 113 lks. dist., marked T32S R5W S3 BT.
- A Red Fir 31" dia., bears N.6°W., 112 lks. dist., marked T31S R5W S34 BT.

Mark Heimburger - For: ODOT R/W Sec. - May 2005 - M146-22

 Found - BLM monument marked as described disturbed which I reset from which:

- A 65" Cedar with visible scribes in partially healed blaze bears N.20°E. 79.9' (121 lks)
- A 27" Cedar with healed blaze bears S.41°W., 72.7' (113 lks = 74.6')

continued next page

PRIMARY CORNER DESCRIPTION Sec Cor for 2 & 3; 34 & 35 of T31-5

Alias	Description
Alias	Description
Alias	Description
Alias	Description

<p>New -</p>	<p>A 66" Cedar stump with visible scribes bears S.66°E., 136.2' (196 lks = 129.4')</p> <p>A 11" D.Fir bears S.71°E., 25.6' which I scribed "T32S R5W S2 BT" in single blaze.</p> <p>A 15" D.Fir bears N.8°W., 41.2' which I scribed "T31S R5W S34 BT" in single face.</p>
<p>Fd. Ok by M. Heimburger, May 2005 - M148-24</p>	
<p>BLM dependent resurvey by Kevin G Mulder, Cadastral Surveyor, under Group No. 2925; Surveyed July/Oct. 2018 - (DCSO records Vol. 59 Page(s) 23751-2)</p> <p>-----</p> <p>The cor. of secs. 2, 3, 34, and 35, reported by Thielsen in 1955, perpetuated by Heimburger in 2005; monumented with an iron post, 2" dia., firmly set, flush with the ground, with brass cap (properly) mkd. from which bearing trees reported by Thielsen</p> <p style="padding-left: 40px;">A cedar, 61" dia., bears N.20°E., 79.2 ft., with a healed blaze. (Record, 79.9 ft.)</p> <p style="padding-left: 40px;">A cedar, 29" dia., bears S.41°W., 72.8 ft., with a healed blaze. (Record, 74.6 ft.)</p> <p>and the remains of bearing trees mkd. by Heimburger</p> <p style="padding-left: 40px;">A fir snag, 11" dia., bears S.76°E., 28.7 ft., with illegible scribe marks visible on partially healed blaze.</p> <p style="padding-left: 40px;">A fir, 19" dia., bears N.6½°W., 39.8 ft., with a healed blaze.</p> <p>and a new bearing tree</p> <p style="padding-left: 40px;">A fir, 13" dia., bears S.84¾°E., 26.5 ft., mkd. T32S R5W S2 BT.</p> <p>The geographic position in NAD 1983 (2011) Latitude: 42°49'33.92" N. Longitude: 123°16'03.94" W</p>	
<p>Adam DeGroot - For: Silver Butte Timber Co. - Dec. 2019 - M171-74</p> <p>-----</p> <p>Found - A 2½" USBLM iron post by Thielsen in 1955, and reset by Heimburger in 2005 per M146-22, firmly set flush with the ground, with a 3 1/4" brass cap properly mkd. per the record, with BTs as reported in the 2018 USBLM survey by Mulder,</p> <p>Note - Lat: 42°49'33.91848"N Long: 123°16'03.93456"W</p>	