

PRIMARY CORNER DESCRIPTION Sec Cor for 9, 10, 15 and 16

Alias	Description
Alias	Description
Alias	Description
Alias	Description

GLO survey by Wells Lake and Geo. W. Hyde, Deputy Surveyors, under Contract #54, dated Feb. 19, 1855 (DCSO records Vol. 21 Page(s) 9007)

Set post cor. to secs.9, 10, 15 and 16 on North slope, from which

- A Fir 6" dia., bears S.33°E., 18 lks.
- A Fir 7" dia., bears S.56°W., 16 lks.
- A Fir 6" dia., bears N.53°W., 25 lks.
- A Fir 3" dia., bears N.61°E., 10 lks.

Cor. Fd. and used in GLO survey by W.H. Byars, Contract #431, 1882 (DCSO records, Vol. 21 Pgs.9014-15)

Survey by Donald R. Martin - For: Herbert Lumber Co. - Wit: E.N. White Jr., Milt Hammersley - July 1960 - C.S. File 51/118

-
- Found - Orig. 2 x 2 post.
30" Fir N.15°E., 21 ft. by Kupilles, 1957, I scribed "S-10".
10" Fir S.32°E., 12 ft., orig. BT, scribes legible.
24" Fir S.86°W., 12 ft., Kupilles, 1957.
6" orig. Fir stump, N.53°W., 22 ft.

Set new 1" Iron pipe beside post.
(Note: Search of DCSO records, found no survey by "Kupilles" per Jean Crawford, DCSO. V.L.)

Douglas Co. Surveyors Office - John M. Powell, Frank Jones, Joe Brady, crew - Oct. 1967 - C.S. File 54/53-31

-
- Found - 1" Iron pipe at section corner.
Orig. 10" D.Fir now stump, S.32°E., 12.0 ft., tree broken off, found scribe marks.
Orig. 6" D.Fir now stob, N.53°W., 22.0ft., stob flush with ground.
30" now 31" D.Fir N.15°E., 21.0 ft., face pitched over.
24" now 24" D.Fir West, 12.0 ft. (Rec. S.86°W., 12.0 ft.) No scribe visible.

New BTs -25" D.Fir S.25°E., 8.6 ft. mkd. T33S R6W S15 CS BT.
15" D.Fir N.57°W., 36.5 ft. mkd. T33S R6W S9 CS BT.

Reblazed and rescribed:
34" D.Fir West, 12.0 ft. mkd. T33S R6W S16 CS BT.

continued next page

PRIMARY CORNER DESCRIPTION Cor Secs 9, 10, 15, & 16

Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____

BLM dependent resurvey by Francis J. Simon, Cadastral Surveyor under Group #1736, surveyed June/Sept. 1994 - (DCSO records Vol. 52 Page(s) 19725-6)

 From the cor. of secs. 9, 10, 15, and 16, perpetuated by Martin, in 1960, utilized by Larson, in 1965, further Douglas County Surveyor's Office in 1967, and utilized by Richard L. Templin Jr., in 1977, monumented with an iron pipe, 1 in. diam., firmly set, projecting 9 ins. above the ground. from which the remains of an original bearing tree:

A broken off fir stump, 10 ins. diam., bears S. 33° E., 18 lks. With decayed blaze.

and bearing trees reported by Martin (record indicates trees mkd. by Kupilles in 1957)

A fir, 36" dia., bears N.12½°E., 38 lks., with healed blaze

A fir, 27" diam., bears S.86°W., 19 lks., with healed triple blaze (remarked by DCSO in 1967).


and bearing trees mkd. by Douglas County Surveyor's Office

A fir, 2" dia., bears S.25°E., 12½ lks., with healed double blaze.

A fir, 19" dia., bears N.59¼°W., 54½ lks., with healed double blaze.

At the corner point

Set a stainless steel post, 28" long, 2½" dia., 24" in the ground, directly over iron pipe, with brass cap mkd.

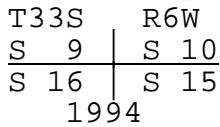

Deposit a white "DEEP-1" magnetic marker at base of stainless steel post.

From this point, Electronic Control Station No. 41160 at Latitude 42° 41' 23.915" N. and Longitude 123° 23' 33.398" W. (NAD 1927), established by the Control Survey Unit, Oregon State Office, Bureau of Land Management, in 1992, utilizing the NAVSTAR Global Positioning System, bears S.24° 20' 18"E., 124.076 chs. dist. (mean bearing and sea level distance); monumented with an aluminum tablet, 2½ ins. diam., firmly set flush with the ground, mkd. EC-41160 1992 and a triangle.

Fd. BLM BC by H. Farber, 6/2017 - M173-44

Fd. BLM BC & accessories by R. Badgley, 8/2020 - M178-8
 NAD83(2011) LAT: 42°42'37.05440"N LONG 123°24'22.82745"W

continued next page

TOWNSHIP 33 RANGE 06 POINT IDENTIFIER # 400500

PRIMARY CORNER DESCRIPTION Sec. Cor. for 9, 10, 15 and 16

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

BLM dependent resurvey by Kevin G Mulder, Cadastral Surveyor, under Group No. 2925; Surveyed July/Oct. 2018 - (DCSO records Vol. 59 Page(s) 23784)

The cor. of secs. 9, 10, 15, & 16, reported by Simon in 1994, monumented with a stainless steel post, 2½" dia., firmly set, projecting 4" above the ground, with brass cap (properly) mkd from which bearing trees reported by Simon

- A fir, 41" dia., bears N.12½°E., 25.1 ft., with a healed blaze.
- A fir, 34" dia., bears S.25°E., 8.3 ft., with a healed double blaze.
- A fir, 32" dia., bears S.86°W., 12.5 ft., with a healed triple blaze.
- A fir, 24" dia., bears N.59¼°W., 36.0 ft., with a healed double blaze.