

Douglas County Surveyor's Record of
Government Corners Renewed

T 23 T. S. R 4 R.W.W.M.

KORE-CHAPMAN CO., EUGENE, ORE. 97101


167

Glen McChesney
Weyerhaeuser Co.
Aug. 8, 1968
(info. rec'd this
office, June 1981)
C.S. 58/8

Center 1/4 Corner for Section 12
Found - Haines "T" iron. Ren. #97
14" now 16" D. Fir, N.69°W., 16.6 ft. (Rec. 17.3 ft.) scribing
visible.
Haines "T" White fir apparently destroyed by sanitation logging to
the south.
Accessories added:
18" D. Fir, bears N.3°E., 22.8 ft.
"W" nails and plates added to bearing trees.

8/8/68

Sec. Cor. for Sec. 31; & S. 6, T.24,R.4 W., S. 36, T.23 S.R.5 W., and
S. 1, T. 24 S. R. 5 W.
Set - 2 1/2 " Brass Cap on a 30" I.P. at proportionate distance
marked as shown:

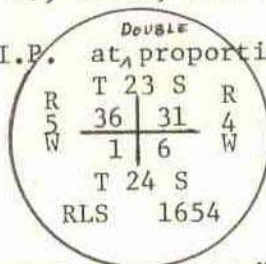

168

*Fd. OK 11/2/90
DCSO
C.S. 64/11*

New Accessories:
26" Alder bears N 30° E, 75.3-ft., scribed "T 23 S R 4 W
S 31 BT"
14" W. Fir bears N 16° W, 68.7-ft., scribed "T 23 S R 5 W
S 36 BT"
B.O. - 5/8" Iron Rod bears S45°E, 20.0-ft.
B.O. - 5/8" Iron Rod bears S45°W, 20.0-ft.
* Note: Sec. Cor. bears 26.0-ft. South & 4.0-ft. West of fenceline.

169

Center corner of Sec. 31.
Set - 5/8" Iron Rod.
New Accessories:
8" Madrona bears N74°W, 37.4-ft., scribed C 1/4 S 31 BT.
6" Fir bears South, 71.3-ft., scribed C 1/4 S 31 BT.

North 1/4 Corner to Sec. 31.
Set - 5/8" Iron Rod at proportionate distance
New Accessories:
8" Madrona bears S 55° E, 4.2-ft., scribed 1/4 S 31 BT.
12" Madrona bears N 38° E, 45.8-ft., scribed 1/4 S 30 BT.
* NOTE: No orig. evidence of corner found.
* NOTE: 1/4 Cor. bears 13-ft. East of creek & 15-ft. North of fence.

170

Sec. Corner common to Secs. 2, & 3, and Secs. 34, & 35 of T.22, R.4
Found - 1" x 1" x 36" "T" iron w/Haines Brass Button, Ren. # 53
firmly set, flush with the ground, from which:
BTs - 5" now 11" W. Oak bears S.73°W., 33.7-ft. Ren. # 53
(Rec. 33.3-ft.), with good scar visible.
12" now 20" Fir w/scribed "T" visible in prev- Ren. # 53
iously opened blaze bears S.40°E., 70.0-ft.
14" now 23" Fir w/large partially healed blaze Ren. # 53
with rotted face bears S.66°E., 69.2-ft.
Note - In my research for this cor., I could not find any information
as to the origin of the two Fir BTs. The only filed survey
prior to Ren. # 53, is M 2-60 which does not mention either tree.
Set - I ref. the location of the found "T" iron & set a 1" x 30" I.P.
w/B.C. attached in its place. B.C. is stamped: "Douglas
Co Surveyor 1981 T22S R4W T23S S34 S35 S3 S2." I place
fd. "T" iron along East edge of B.C.
New Accessories - Power Pole #4-191 bears N.34°W., 154.0-ft. w/DCSO BT
tag attached.
4" Pole fence corner bears S.70°E., 6.3-ft. with DCSO BT tag attache
Note - See sketch in FILE (C.S. 61/30). 12/21/81

*FD. B.C.
10/92
D. Peck
M115-78*

Ron Quimby
For: O.E. Kingzette
May, 1981
M 79 - 77

Gregory E. Quibell
Deputy Doug. County
Surveyors Office
Terrie Plouff, wit.
Dec. 21, 1981
C.S. 61/30