

Douglas County Surveyor's Record of
Government Corners Renewed

24 T. S. 5 R. W. W. M.

ROKE-CHAPMAN CO., EUGENE, ORE. 21881

31

Section Corner to Sections 4, 5, 8 & 9.


Found - 20", now 24" Fir Stump, as recorded by B.B.I., 1929, I open & find good scribing "BT", REN.#12

Orig. 20", now 40" B. Oak S.60°E. 4.0 ft., shows old scar, I do not open.

Orig. 18", now 36" B. Oak N.62°W. 33.7 ft. (I find should be 40.3 ft.) shows good scribing "S" on old face.

Orig. 10", now 20" partly rotted Oak Stump S.40°W. 30 ft., shows reverse scribing "T".

Note - Corner thus:

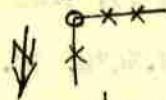

Set Brass Cap at Corner Mkd:

S 5	S 4
S 8	S 9

 T24S R5W County Surveyor's Office, 1959.

New BT's: 8" R. Fir bears S.51.5° W. 14.1 ft. scribed S 8 T24S R5W CS BT.
40" B. O. S.60°E. 6.0 ft. scribed S 9 T24S R5W CS BT.
8" R. Fir bears N.61°W. 8.0 ft. scribed S5 T24S R5W CS BT.
10" Laurel bears N.24°E. 28.5 ft. scribed S4 CS BT.

James W. Byron, Deputy
Milo Godfrey
C. Putnam
August 4, 1959
C.S. File No. 49/124

5781 Find. O.K. R. Quimby

32

$\frac{1}{4}$ Section Corner to Sec. 2, T24S R5W & Sec. 35, T23S R5W. M79-77
Found - 14" W. O. N.16°E. 22.8 ft., scribed by Theil, 1921, shows good scribing " $\frac{1}{4}$ ". I find stump holes only for original BT's.

I, Ralph Cockeram, state that I was with Theil at this corner, 1921. We found both orig. BT's. and soon afterward I set the existing anchor post at $\frac{1}{4}$ corner as established by Theil.

(This signed statement may be seen in the C. S. File No. 49/42)

Set Brass Cap at Corner & alongside Anchor Post Mkd:

County Surveyor's Office, 1959

S 35	T23S R5W
S 2	T24S R5W

New BT's: 7" R. Fir bears S. 2°E. 19.0 ft. scribed $\frac{1}{4}$ S 2 CS BT.
12" W. Oak bears S.76°W. 19.4 ft. (Theil's) shows good scars. I do not open.

James W. Byron, Deputy
Milo Godfrey
Clete Putnam
Ralph Cockeram
Nov. 27, 1959
C. S. File No. 49/42

33

Sec. Cor. to Secs. 34 & 35 T24S R5W. & Secs. 2 & 3, T25S R5W.

Set Stake for Section Corner.

12" Ash S.1°W. 36.0 ft.

18" Oak N.78°W. 45.6 ft.

SEE CORNER NO. 19

Sec. Cor. Secs. 33 & 34, T24S R5W. & Secs. 3 & 4, T25S R5W.

Also noted as S. W. Corner J. Tibbets D.D. Co. No. 41.

Found 1" Iron Pipe.

Rotted Stump Original Bearing Tree.

24" Oak N.30°E. 31.0 lks.

SEE CORNER NO. 61

SEE ALSO F.S. 30 Pg. 31

34

Fred L. Dow
For Ray Davis
March 1954
C.S. File No. 50/30

35

Sec. Cor. to Secs. 5 & 6, T24S R5W & Secs. 31 & 32, T23S R5W.

Found - B. Oak Snag, now 48", N.57°W. 259.4 ft., found faint traces of scribing in rotten wood.

Remnants of rotted Oak Stump N.88 $\frac{3}{4}$ °E. 129.4 ft., found portion of wood with good reverse scribing "BT".

Oak Tree, dead & down, S.82°E. 70.6 ft., no scribing fd.

Stump hole & portion of burned Oak Log, S.60 $\frac{1}{2}$ °W. 178.2 ft., no scribing found, too badly burned.

At Corner Set Iron Pipe with Brass Cap Mkd: County Surveyor's Office, 1959

S 31	S 32
S 6	S 5

 T23S R5W
T24S R5W

Blaze & Scribe following Trees:

8" W. Oak S.63 $\frac{1}{2}$ °E. 45.1 ft. mkd. "T24S R5W S5 CS BT."

10" B. Oak S.87°W. 93.5 ft. mkd. "T24S R5W S6 CS BT."

15" D. Fir N.53 $\frac{1}{2}$ °W. 23.4 ft. mkd. "T23S R5W S31 CS BT."

11" D. Fir N.48°E. 17.6 ft. mkd. "T23S R5W S32 CS BT."

1 $\frac{1}{2}$ " Sq. Iron Bar bears S.47°W. 1.8 ft.

Fence Corner 2 feet N. W.

James W. Byron, Deputy
Milo Godfrey
Clete Putnam
Dec. 14 - 18, 1959
C. S. File No. 49/42

pd. 7/90
1990-0035
FD OK 3/91
FD OK 7/93
M 117-52