

**Douglas County Surveyor's Record of  
Government Corners Renewed**

T 29                      T. S.                      R 2                      R. W. W. M.

KOKE-CHAPMAN CO., EUGENE, ORE. 21801

**107**

Dennis Gaylord  
U.S.F.S. Deputy for  
Doug. Co. Surveyor  
Roland Simshauser  
April 20, 1978  
C.S. 59/46

1/4 Corner for Sec. 1 only, (North).  
Found - 1917 US GLO brass cap on a 1" I.P. 14" above ground and solidly set in place. I Add "T29S R2W" to brass cap below the 1/4 S1.  
A 21" D. Fir bears S.24°15'E., 22.4 ft. (Rec. 21.78 ft.) Has a healed scar.  
A 13" D. Fir bears S.51°30'W., 5.6 ft. (Rec. 5.28 ft.) Has a healed scar.  
Placed County BT signs on both.  
No new monument or accessories.

4/20/78


**108**

Dennis Gaylord  
U.S.F.S. Deputy for  
Douglas Co. Surveyor  
Roland Simshauser  
April 20, 1978  
C.S. 59/46

Section Corner for Secs. 1 and 12 only, East boundary.  
Found - 1917 US GLO brass cap properly stamped on a 1 1/2" I.P. 4" above ground.  
A 24" Fir stump bears N.35°W., 13.86 ft. Open & find scribing & reverse.  
BT location for SW BT falls in Road #2846.  
Placed a county BT sign on the stump  
Corner stone for Sec. Corner for 6 and 7 bears N.1°15'E., 8.1 ft. (Rec. North 7.92 ft.).  
No new monument set.

New Accessories:

- A 5/8" Iron Rod with a 1" Alum. cap marked bears N.34°W., 12.6 ft.
- A 5/8" Iron Rod with a 1" Alum cap marked Bears S.51°30'W., 9.8 ft.

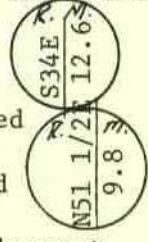

Corner lies 20 ft. North of F.S. Road #2846 in a clearcut.


4/20/78

**109**

Dennis Gaylord, U.S.F.S.  
Deputy, County Surveyors Office  
Randal Lopez  
April 27, 1978  
C.S. 59/46

Section Corner for Secs. 6 and 7 only of T29-1.  
Found - Orig. corner stone set solidly in place & marked with one groove on the north face & five grooves on the south face. Stone measures 15" x 10" x 8".  
A 14" Fir stump bears S.45°30'E., 15.6 ft. (Rec. 15.84'). Open & find scribing & reverse "T29S".  
Pine BT to the NE is gone. Falls in landing.  
The corner for Secs. 1 and 12, T29-2, (Brass cap set by GLO) bears S.1°15'W., 8.1 ft. (Rec. South 7.92').

Set - Moving the orig. corner stone aside, I SET in its place a 2 1/2" brass cap on a 1" I.P. stamped County Surveyors Office 1978

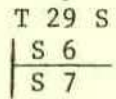

I bury the corner stone along side the iron pipe.

New Accessories:

- A 5/8" Iron rod with a 1 1/2" Alum. cap bears N.48°E., 12.4 ft. stamped
- A 5/8" Iron rod with a 1 1/2" Alum. cap bears S.21°30'E., 28.5 ft. stamped



No trees available for BT's.

Corner is located 40' North of F.S. Road #2846 & in a clearcut.

4/27/78

**110**

1/4 Corner for Secs. 1 and 12.  
Found - 1917 US GLO brass cap on a 1" I.P. set solidly in ground stamped U.S. General Land Office Survey 1/4 S1 S12. I ADD "T29S R2W" to brass cap.

- A 30" now 33" D. Fir bears N.45°E., 11.22 ft. Has a healed scar.
- A 17" White Pine bears S.23°W., 36.6 ft. (Rec. 36.3 ft.) Has a healed scar which has been recently chopped into about 1 inch.

Placed County BT signs on both trees. Corner lies 75 ft. North of F.S. Road No. 2919.

No new monument or accessories set.

4/27/78

1-79