

CORNERS RENEWED IN TWP. 30 S, R 6 W W.M.

Done for Fuller Bros.


by Robert M Thompson, R. E. No 3683

Sec Cor.  $\frac{10}{15} | \frac{11}{14}$  Which is 2791 ft West of  $\frac{1}{2}$  Cor.  $\frac{11}{14}$ , I find three (3) old B.T.s, which do not agree with old calls:

~~Old calls:~~

- 20" B.O., S85°E, 46.2 ft.  
(portion of "4" visible, down & rotted)
- 24" B.O., N50°E, 223.0 ft  
(cut stump, neg. of "BT" visible)
- 32" B.O., N12 $\frac{1}{2}$ °W, 62.0 ft  
(with face)

NOTE - SEE REN. #179,  
T30-6W. MR. BYRON  
RESET THIS CORNER  
1/28/64.

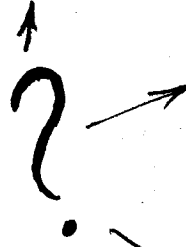

To renew I scribe:

(Cor falls 15ft  
north of E&W  
Fence)

- 18" Y. Pine, N50°30'W, 65.5 ft.
- 4" Madr. , S56°30'W, 32.0 ft.
- 5" Madr. , S 5°30'W, 97.7 ft.
- 5" Madr. , N35°20'W, 10.0 ft.
- Yel Tag on 2" Madr. N86 W, 10.0 ft.

Renewed: June 13, 1958 by R.M. Thompson  
L. Washburn  
B. Deatherage

At  $\frac{1}{2}$  Cor 16 15, I find a 40" Pine snag S80°E, 124 ft. (BT visible); 14" B.O. N85°W, 198 ft. (down); stake in rock mound.

To Renew I scribe: 14" I. Ced., N43°E, 61.6 ft.

Renewed: June 9, 1958 by R.M. Thompson  
L. Washburn  
Ike Fuller