


SPRINGFIELD
SURVEY FILE

PUBLIC LAND CORNERS

WEYERHAEUSER TIMBER COMPANY
 SPRINGFIELD BRANCH

TOWNSHIP 24 S RANGE 3 W
 SECTION 5 CORNER N 1
 COUNTY Douglas OREGON

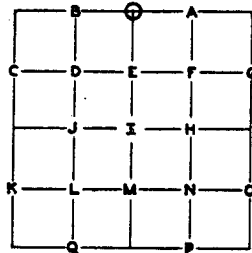

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
52" Fir	N 27° W	30.3		X	X	
48" Fir stump	S 14° E	33.2		X	X	

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: O.G. Timber to North - Partially logged sound trees to south.

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) N 60° E ON MINUS (-) 33 % 70'

NORTH: -13% for 100'

SOUTH: -4% for 100'

EAST: -17% for 100'

WEST: +45% for 60'

FROM CORNER

GLO SURVEY RECORD

DATE: 1950 Dependent Resurvey
 CORNER iron pipe brass cap

PRESENT CONDITION - (DESCRIBE FULLY -
 USE PAGE 2 IF NEEDED FOR EXPLANATION.)

OK

ACCESSORIES:

	BEARING-	LINKS-	FEET-	
42" Fir	N 29° 45' E	27	17.8	OK
34" Fir	S 1° W	131	86.5	OK

WTCO. SURVEY RECORD
 DATE: 1946

PRESENT CONDITION: Location
6' North of Dep. Res. brass cap

WTCO. Plate

Destroyed (see next page for new)

WTCO. Plate

" " " " " "

CORNER SET: GLO. Brass cap

MAG. DECL: 20°

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
N 30° E	15.5	1950 GLO	<u>42"</u> <u>42" fir measured to face</u>
S 1° W	84.9	1950 GLO	<u>34: Fir</u> " " "

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK:

BY: Mervin W. Hale DATE: 11-17-58
 ENGINEER - SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY: W. Dixon - H. E. Case

COPIES SENT TO:

SEAL

PAGE 3

PAGE 1

CS 53/111-11

01