

M 93-34

NARRATIVE
FOR
SURVEY PERFORMED IN
SECTIONS 8 and 17, T21S, R11W, W.M.
DOUGLAS COUNTY, OREGON
BY CHAMPION INTERNATIONAL CORPORATION
NOVEMBER 1982

FILED B.S.
RECEIVED J.H.
DEC 22 1982
COUNTY SURVEYOR
DOUGLAS COUNTY, ORE.

(SUPPLEMENT TO CORRESPONDING PLAT)

All information and notes on the corresponding plat are a true and accurate representation of a survey I performed during the months of July through November, 1982, to establish the property lines for Champion International Corporation in Sections 8 and 17, T21S, R11W, W.M.

Equipment used in this survey include an AGA 76 Geodimeter, a Jena 020A Theodolite, a Mac IE EDM, and a 300' steel chain.

The basis of bearing for this survey was obtained by a sunshot taken in the control traverse.

Section 17 was originally surveyed in 1867. The West line of Section 17 was again surveyed in 1891 to re-establish the 1/4 Corner and the lost NW section Corner. The position of the W 1/4 Corner Section 17 was set 2.40 chains West of the true corner due to an offset survey line. Section 8 was also originally surveyed in 1891.

Four, 1867 Meander Corners and their accessories, set on the banks of the Smith River along the South and East lines of Section 17, were searched for, but no evidence was found. The Meander Corners were not reset.

Corners found and used for control were set, or re-established, by the Douglas County Surveyor's Office, with the following exceptions:

The W 1/4 Corner Section 8 was set by Richard J. Hintz, P.L.S. 497, in 1982, based on original accessories found.

The SW Corner Section 8 was set in an unrecorded survey at the approximate intersection of three, 1891 accessories found (the I.P. found was replaced in this survey with a BCIP in the same location).

The SW Corner Section 17, was set by Harry S. Hugill in 1949, by double proportionate methods.

The W 1/4 Corner Section 17 was set by Harry S. Hugill in 1949, by single proportion.

Original evidence for the S 1/4 Corner Section 17 was searched for, but not found. It was set by single proportion methods, midway between the SW Corner and the SE Corner of Section 17.


The subdivision of Section 8 and Section 17 was performed according to the 1973 BLM Manual of Survey Instructions. Property corners and their accessories were also set according to the 1973 BLM Manual of Survey Instructions. A Witness

M 93-34


Corner was set for the S 1/16 Corner Sections 8 and 9, because it fell within the banks of Joyce Creek. In addition, a Witness Corner was set for the CE 1/16 Corner Section 17, which fell in the Smith River.

All traverses run, were closed loops with minimum acceptable closure of 1 part in 4000.

Property lines were posted to within $\pm 1'$ of true line, using 6' steel fence posts, with attached "Champion" signs, at maximum 250' intervals. A segment of property line between the SW Corner Section 8 and the W 1/16 Corner Sections 8 and 17, was previously posted by Richard J. Hintz, P.L.S. 497, in 1982, using 1/2" x 60" iron rods with attached, aluminum "International Paper" signs. Those iron rods were tied to in a closed traverse, and determined to be on the true property line.

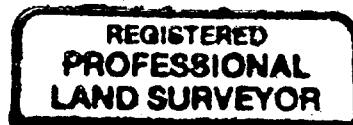

Ronald G. Geisler

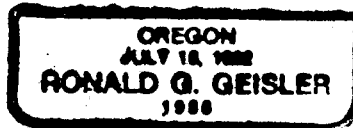

Ronald G. Geisler
P.O. Box 37
Mapleton, Oregon 97453

Page 2 of 2

(Continuation of Narrative for Survey Performed in Section 8 & 17, T21S, R11W, W.M., Douglas County, Oregon by Champion International Corporation, November 1982)

File No. 58/278-1b