

GOVERNMENT CORNER RESTORATION FORM

Township 28 S Range 8 W Sec. 6 County DOUGLAS

State OR Date 4-22-82 No. \_\_\_\_\_

Corner Designation

T28S R8W

$\frac{1}{4}$   $\frac{S6}{S7}$

- \_\_\_\_\_ Condition Report Only
- \_\_\_\_\_ Not Found
- Renewed
- \_\_\_\_\_ Unrecorded
- \_\_\_\_\_ Surveyed In
- \_\_\_\_\_ Referenced Out

Previous Renewals #50 #172

MONUMENT DETAIL

Monument(s) Found: (Condition and Source)

Fd. BRASS CAP PER REN. #50 FIRMLY SET AND PROTRUDING 2" OUT OF GROUND. BRASS CAP IS MARKED AS PER DETAIL ON RE.

COUNTY SURVEYORS OFFICE  
T28S R8W  
 $\frac{1}{4}$   $\frac{S6}{S7}$

1957

Accessories Found:

Fd. ORIG. 32" NOW 40" FIR WHICH HAD FALLEN OVER AND LATER LOGGED. ROOT HOLE BEARS N8°E 21' FT PREVIOUSLY OPENED FACE WAS BURNED OVER AND HAD NO SCRIBING VISIBLE.

Fd. 16" YEW PER REN. #50, NOW 16" SNAG APPROX 30' TALL WITH BURNED OUT DOUBLE BLAZE. SCRIBED "Y4S BT" VISIBLE PER REN. #172. TREE BEARS S49°E 20.2 FT.

Fd. 8" CHINQUAPIN PER REN. #50, NOW 8" ROTTED STUMP WITH THE REMAINDER OF THE TREE LYING ALONGSIDE ALSO ROTTED, WITH SCRIBED "4 S6 CS BT" VISIBLE IN PARTIALLY HEALED DOUBLE BLAZE, BEARS N30°W 9.7 FT. (REC. N27°E)


Fd. 14" CHINQUAPIN PER REN. #172 SCRIBED "Y4S BT" BEARS N 32°15' W 34.2 FT.

#1734



Section 6 Twp 28 S Rge 8 W W M

Date: 3-26-82

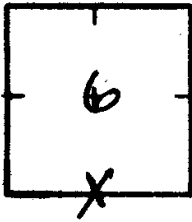

How was corner identified? County BRASS CAP

Condition of corner: FIR TREE is wind thrown and is now a stump  
You had the scribes burned out due to slash fire.

Best route to reach corner: \_\_\_\_\_

Quadrant	NE	NW	SE	SW
Species & Size	<u>1 1/4" Chingucapini</u>		<u>1 1/4" YEW</u>	
Dist. & Bearing	<u>N 32-15 W 34°</u>		<u>S 49° E 20 1/2</u>	
Condition of Scribe	<u>New 1/4 S BT</u>		<u>Re-scribed</u>	
Original or Resurvey			<u>1/4 S BT</u>	
Appearance of H.T.	<u>Fogged &amp; Flipped</u>			
Tags, Marks, etc.			<u>Pointed - Flipped - Tagged</u>	

Other Remarks:  
I re-scribed the  
Yew and scribed  
a chingucapini for add'l  
BT.

Lloyd Waudenblom  
 Signed  
LS 1047  
CSB