

GOVERNMENT CORNER RESTORATION FORM

Township 30S Range 2W Sec. 28 County DOUGLAS

State OR Date 9/26/87 No. _____

Corner Designation

1/4 S28
S33

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals #25, #74, #86, #220, #235

Monument(s) Found: (Condition and Source)

FROM RENEWAL #220A BRASS CAP MONUMENT,
A 2 1/2 INCH DIAMETER BRASS CAP MARKED AS
AT RIGHT) ON A 2 1/4 INCH O. D. IRON PIPE
30 INCHES LONG. MONUMENT IS SET IN
A FIRE TRAIL AND WAS APPARENTLY
DISTURB BY TRACTOR; MONUMENT LEANS
APPROXIMATELY 14 INCHES SOUTHWEST FROM
PLUMB POSITION, FLUSH WITH GROUND.

ORIG. POST N.E.
STONE FIRST NOTED IN REN #25 N.E.
3 IN PIPE PER REN #74 N.E.

MONUMENT DETAIL

T 30S 2W
 1/4 S28
 S33
 P.L.S. 866
 1979
 RESET 1981

Accessories Found:

BEARINGS AND DISTANCES TAKEN TO PLUMB POSITION OR BC/LLP.
48" FIR NOW A STUMP HOLE WITH REMNANT'S NEAR ORIG. RECORD
BEARING AND DISTANCE (ORIG. REC. N36°E, 29.7 FT). ORIG. BT
ORIG. SOUTHWEST BT GONE
24" NOW 2 FT HIGH BROKEN AND BURNT D. FIR STUMP NO BLAZES OR
SCRIBING FOUND, BEARS S76°W, 101.0 FT (REC. S72 3/4°W, 99.5 PER
REN #25; S78°W, 99.5 PER REN #86; S76 1/2°W, 101.0 FT PER REN #220;
S76°W, 101.0 FT PER REN #235) REN #25 BT
NORTHEAST BT PER REN #25 GONE
24" NOW 14" DIA. 20" HIGH BROKEN AND BURNT D. FIR STUMP, WITH
BLAZE AND SCRIBING VISIBLE "S33 BT" BEARS S79°W, 108.5 FT
(REC. S80°W, 108.0 FT PER REN #86; S79 1/4°W, 108.5 FT PER REN #220;
S79°W, 108.5 FT PER REN #235) REN #86 BT.
16" NOW 28" DIA. L. CEDAR WITH A FULLY HEALED SINGLE BLAZE,
BEARS S57°E, 153.9 FT (REC. S56 1/2°E, 153.0 FT PER REN #86; S57°E,
153.9 FT PER REN #220; S57°E, 153.9 FT PER REN #235). REN #86 BT
24" NOW 24" DIA. 4 FT HIGH MADRONE STUMP WITH ILLEGIBLE BARK
SCRIBING, BEARS N45°E, 156.6 FT (REC. N47 1/2°E, 157.7 FT PER REN #86;
N45 3/4°E, 156.6 FT PER REN #220; N45°E, 157.3 FT PER REN #235). REN #86 BT

2

#272 4

#272 ✓

RENEWAL

Monument Set (Procedure and Description)


BC/I.P. PER REN # 220 WAS RETURNED
TO PLUMB POSITION, NOW PROTRUDES
6 IN. ABOVE GROUND.

Monument Detail

New Accessories

9" DIA. D.FIR DOUBLE BLAZED AND SCRIBED "1/4 S 28 CS BT"
BEARS N 35° E, 32.6 FT.

Sketch of Monument, Accessories, and General Area

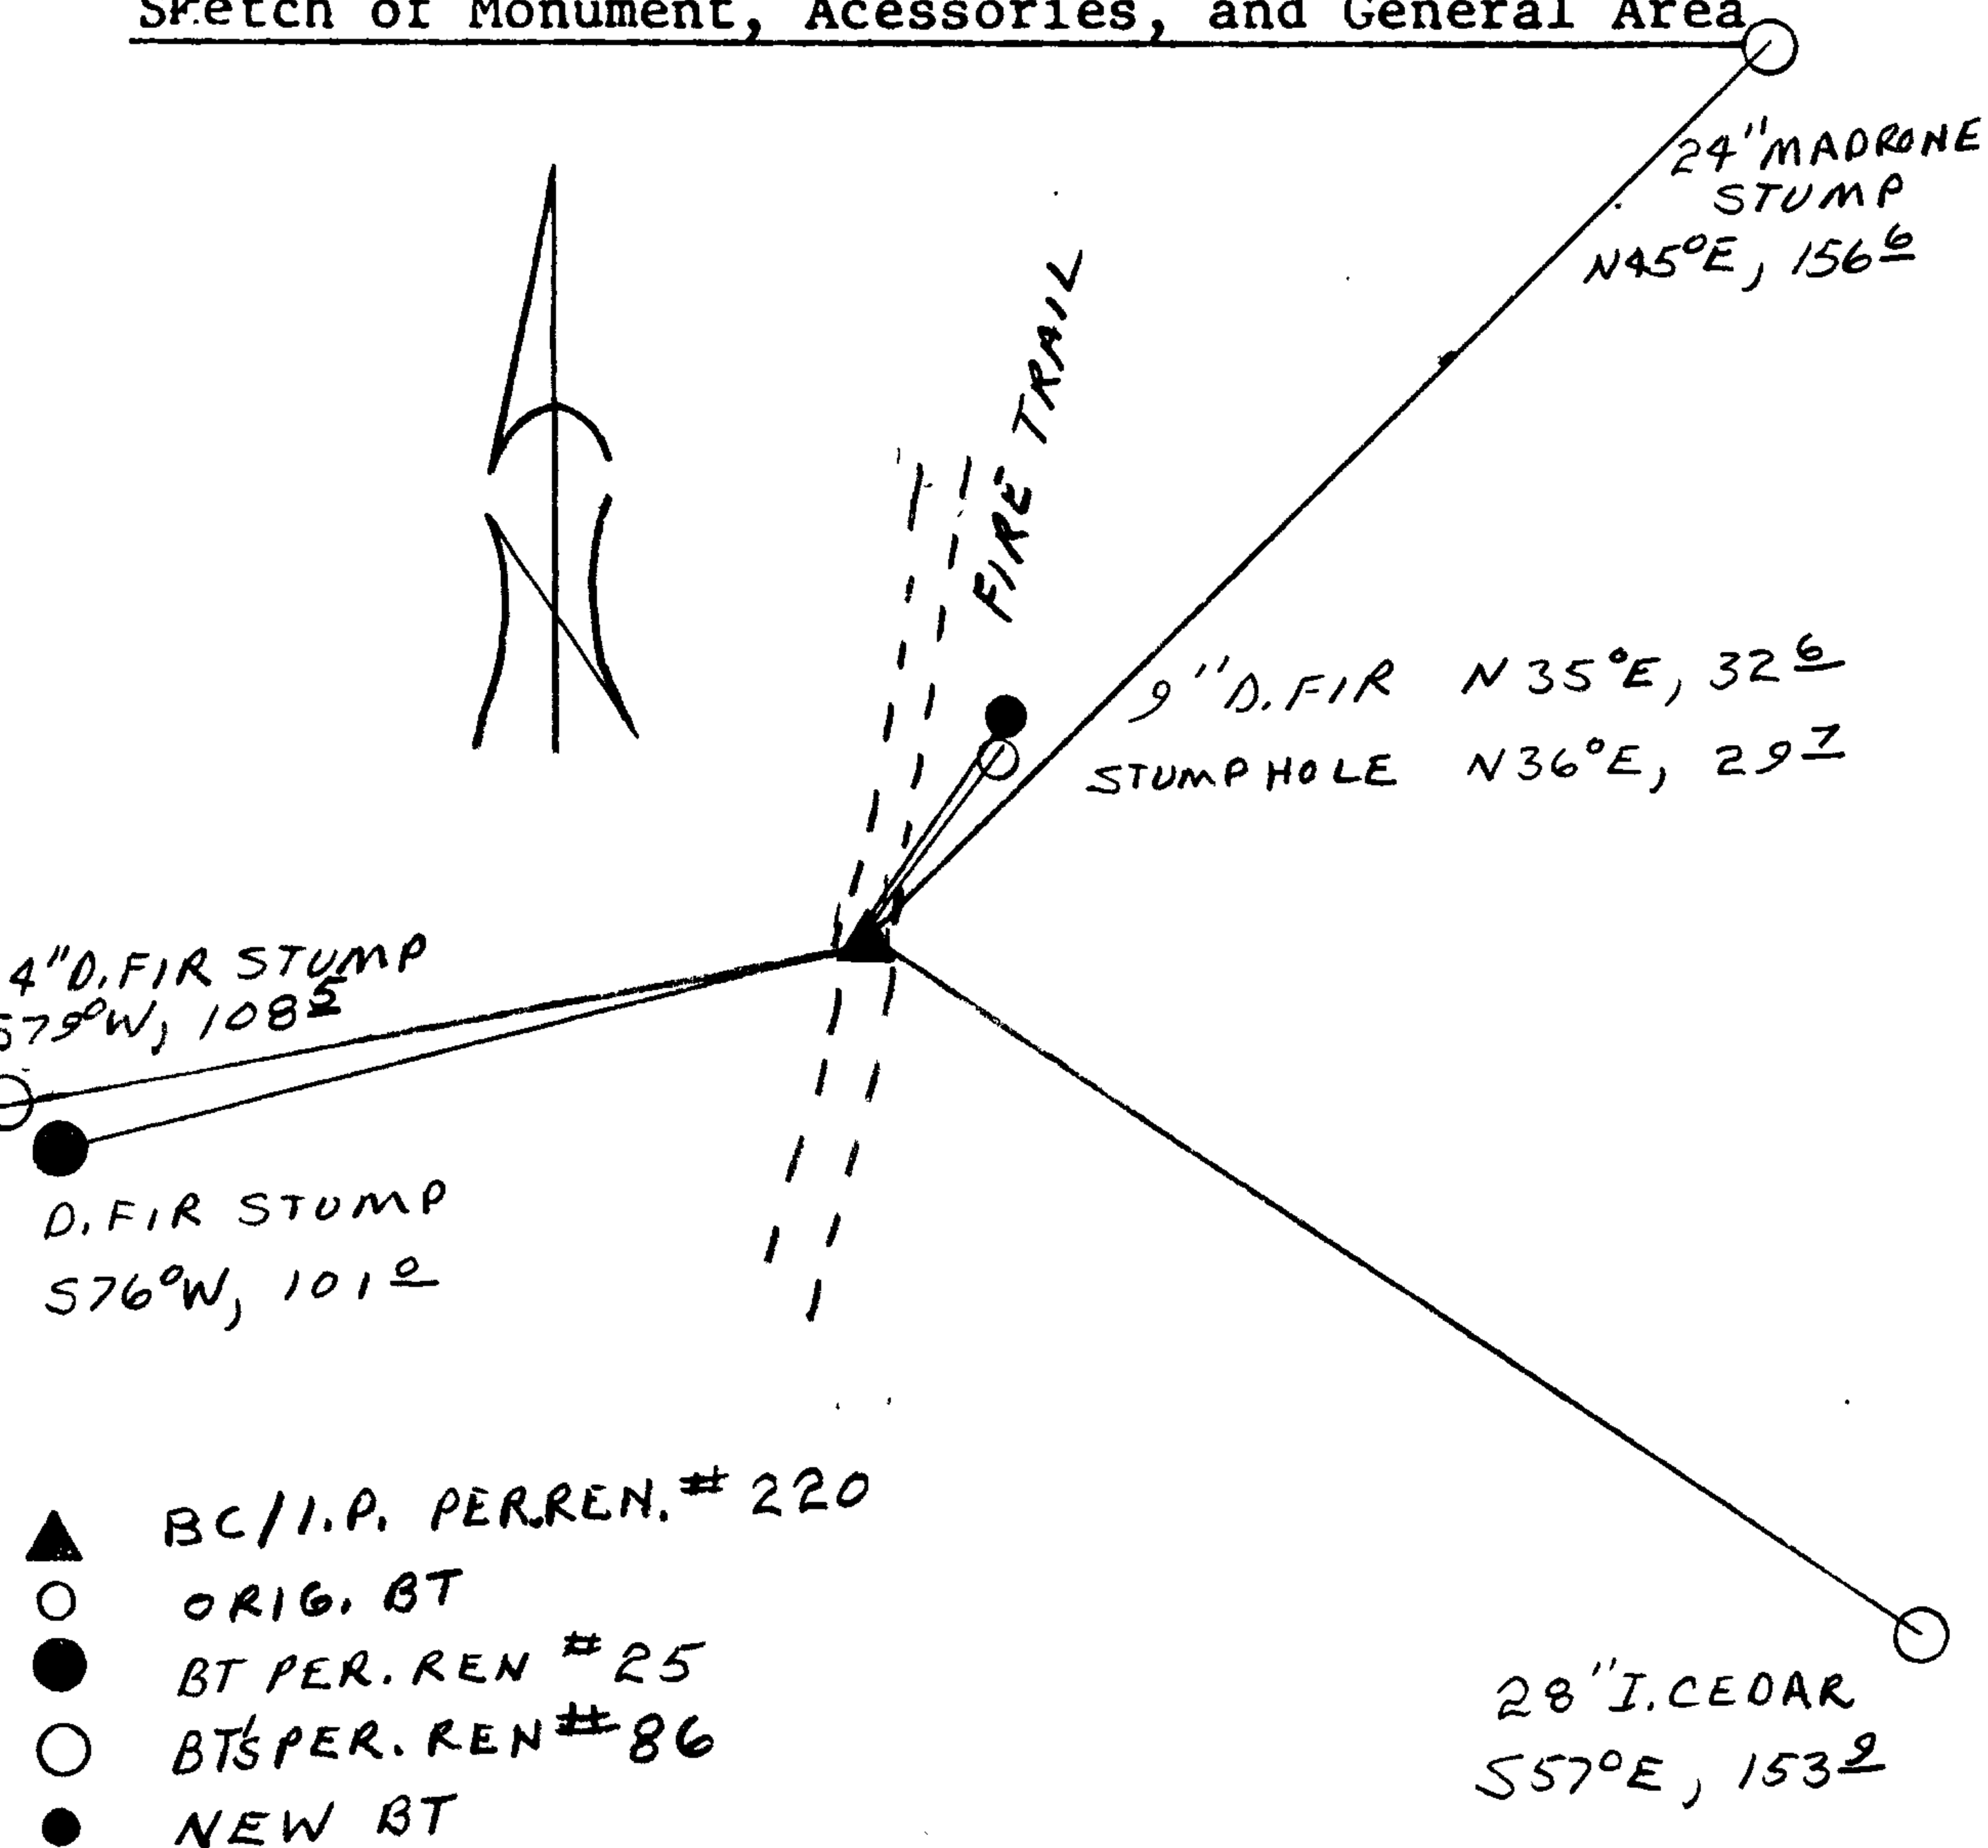

Location & Comments

CORNER LIES IN FIRE
TRAIL ON A STEEP SOUTHERLY
SLOPE.

Comp. Declin. 18 1/2° E
Agency DCSO
Party Chief RANDALL W. SMITH
Notekeeper Randall W. Smith
Witnesses STEPHEN J. FLAUSE

Address

Surveyor's Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Larry E. Monrean

OREGON
JULY 13, 1979
LARRY E. MONREAN
#1830