

M107-26

FILED

JL

JAN 9 1989

OREGON CORNER RESTORATION FORM

Section 34 Township 21 S Range 5 W

County Douglas Date October 13, 1988

COUNTY SURVEYOR  
DOUGLAS COUNTY, ORE.

Corner Designation

South 1/4 Section 34

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals/Surveys, etc. \_\_\_\_\_

Monument(s) & Accessories Found: (Condition and Source)


A rotted 72" Fir stump with numerous ages of axe work marks was found nearby.

No scribing visible. Location is consistent with original field notes and proportioned position.

No evidence of opposing BT was recovered.

Monument Detail

Sketch

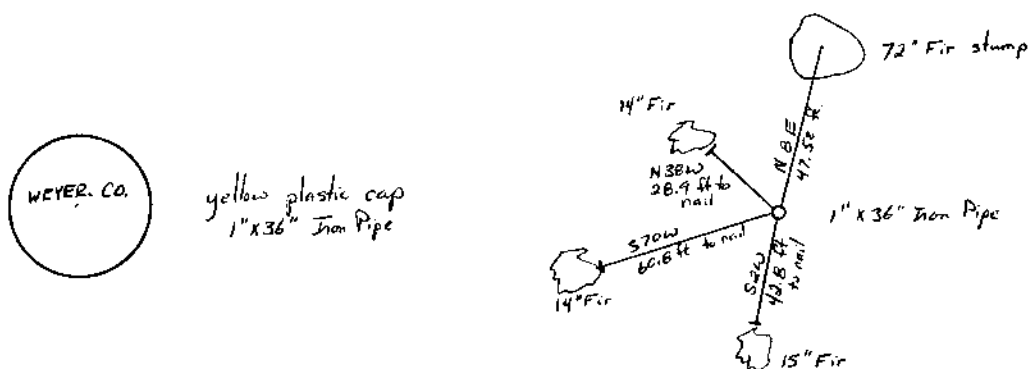

Monument Set (Procedures and Description)

Corner set at S 8W 47.52 feet from found 72" Fir Stump (center measure) being 1" x 36" iron pipe with yellow plastic cap inscribed "Weyer Co."

New Accessories

|         |       |   |
|---------|-------|---|
| 14" Fir | N 38W | 28.9 feet to 'W' nail and tag scribed "1/4 S 34 BT" |
| 15" Fir | S 2W  | 42.8 feet to 'W' nail and tag scribed "1/4 S 3 BT"  |
| 14" Fir | S 70W | 60.8 feet to 'W' nail and tag scribed "1/4 S 3 BT"  |

Location & Comments

Corner lies approximately 48' west of creek Compass Declination 20° E  
Firm/Agency Weyerhaeuser Company

Surveyor's Seal

Address P.O. Box 275  
Springfield, Oregon 97477  
Party Chief Dave Wellman  
Notes \_\_\_\_\_  
Witness Ken Perkins

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*David H. Wellman*

OREGON  
JULY 1985  
DAVID H. WELLMAN  
2163

#165 T21-5 X  
#188 T22-5 X

C.S. File No. 63/85-3C