


GOVERNMENT CORNER RESTORATION FORM

Township 26S Range 3W Sec. 1 County DOUGLAS

State OR Date 8/10/89 No. _____

Corner Designation

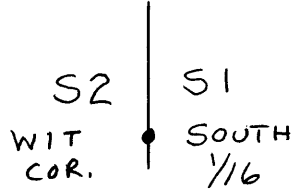

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals #177, 1963 BLM D. RESURVEY

Monument(s) Found: (Condition and Source)

NAIL IN ASPHALT WITH RED PAINT
(SOURCE UNKNOWN) A STRONG METAL
READING IS TAKEN AT POINT OF NAIL.
ASPHALT IS NOT DUG UP TO SEE
3/4" I.R. SET IN REN #177

N/A

TRUE S 1/16 COR., PERPETUATED WITH
A BRASS CAP IRON PIPE MONUMENT IN
BLM'S 1963 D. RESURVEY NOT FOUND.
CORNER FALLS IN RIP RAP BETWEEN
HWY 138 AND THE NORTH UMPQUA RIVER.

Accessories Found:

FROM REN #177 (BO. AND BJ. GO TO WIT, COR.)
NAIL SET SOUTH OF WIT. COR NOT FOUND

CHISELED LINE ON CONCRETE CURB, NOW PART OF FOUNDATION OF
RESTAURANT, FAINT RED PAINT VISIBLE, CAN FEEL LINE IN
CONCRETE UNDER BOTTOM EDGE OF BUILDING. BEARS N 1/4° E, 55 FT
(AGREE'S WELL WITH RECORD).

26" NOW 33" DIA. D. FIR WITH A FULLY HEALED DOUBLE BLAZE,
BEARS N 32° W, 83.0 FT (AGREE'S WITH RECORD).

#249x

