


GOVERNMENT CORNER RESTORATION FORM

FILED APR 27 2009 By: JC

Township 315 Range 9W Sec. 25 State OR Date 4-23-09

County DOUGLAS No. 700200 Narrative: Corner Rpt: C567/28-30

Corner Designation

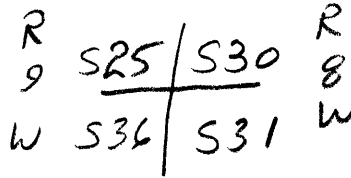

DOUGLAS COUNTY SURVEYOR

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals 1900 GLO, 1960 BLM

Monument(s) Found: (Condition and Source)

FD STAKE BROKEN IN TWO OUT OF GROUND, POSSIBLE 1900 STAKE

1960 BLM BE/1P AND 2" LP THAT BLM FOUND NOW GONE.

N/A

Accessories Found:

16" NOW 24" DIA 2 FT HIGH ROTTEN D. FIR STUMP BEARS N 21° E, 58.6 FT (REC N 21° E 59.4 FT) OBT

24" NOW 50" DIA 6 FT TALL METAL CAP STUMP WITH HEALED BLAZE NO BARK SCRIBING VISIBLE BEARS S 34 1/2° E, 52.8 FT (REC. S 36° E 52.8 FT) OBT

16" NOW 36" DIA. D. FIR BARK SCRIBING VISIBLE "BT" BEARS S 39° W, 11.9 FT REC S 39° W, 8.6 FT OBT

56" NOW 62" DIA 5 FT TALL D. FIR, METAL CAP STUMP WITH ILLEGIBLE BARK SCRIBING BEARS N 13 1/2° W 38.3 FT (REC N 15° W 38.3 FT) OBT

10" NOW 24" DIA. W. FIR WITH A FULLY HEALED SINGLE BLAZE, BEARS N 73° E, 38.3 FT (AGREES WITH REC) 1960

RENEWAL

Monument Set (Procedure and Description)

2 1/2" BRASS CAP ON A 1 1/2" DIA
 BY 32" LONG IRON PIPE IS
 SET AT A POSITION DETERMINED
 BY 1960 BLM BT AND BEST
 FIT OF OBT'S. THIS POSITION
 IS THE MOST LIKELY CORNER
 POSITION FOR AND PREPOTATED
 BY 1960 BLM, 136/1P
 PROTRUDES 7" OUT OF GROUND
 STONES PLACED ALONG NORTH
 EDGE.

Monument Detail

DOUGLAS COUNTY SURVEYORS
 T 3 1 5


R	S 25 / S 30	R
9	S 36 / S 31	0
W		W

2009

New Accessories

N/A

Sketch of Monument, Accessories, and General Area

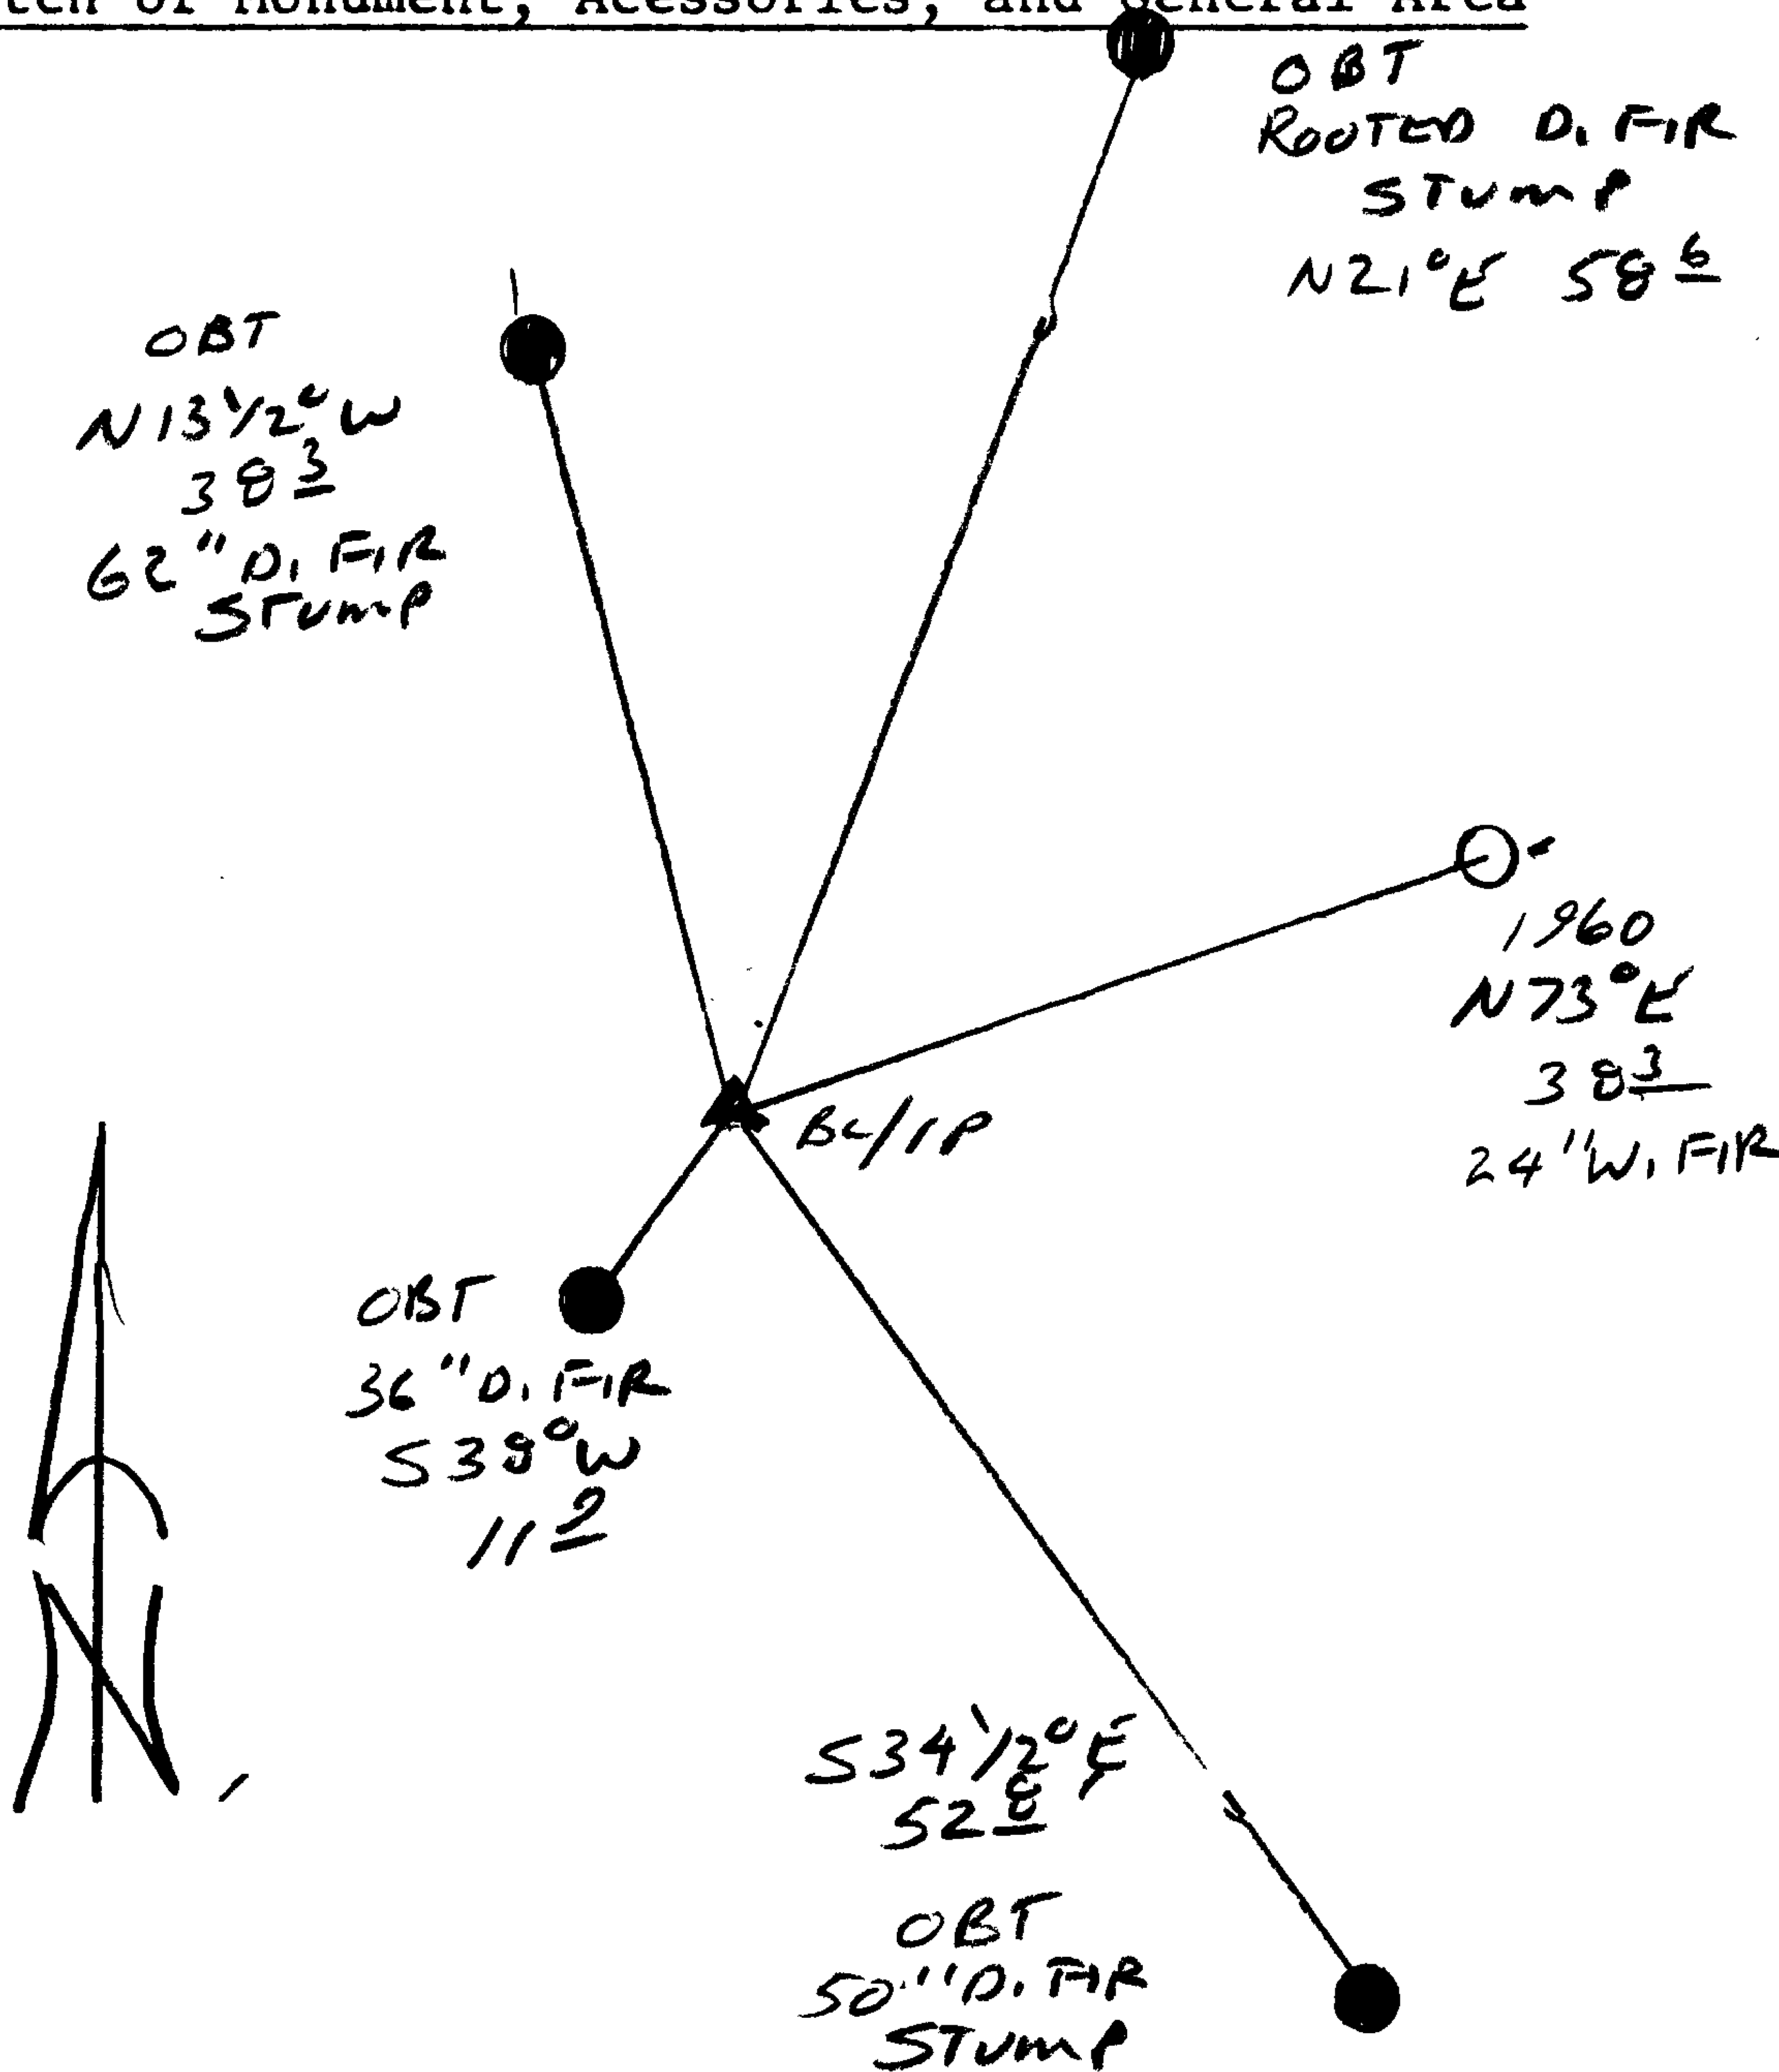

Location & Comments

Comp. Declin. 16 1/2° E
 Agency DCSO
 Party Chief RANDY SMITH
 Notekeeper RANDY SMITH
 Witnesses STEVE FLAUSU

Address

Surveyor's Seal
 REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

OREGON
 JULY 25, 1990
 RANDALL W. SMITH
 2488

RENEWAL G-30-2010