

FILED

Date: 12-9-2010 By: JC

This survey consists of:

Map: _____

Narrative: _____

Corner Rpt: CS 67/31-15


DOUGLAS COUNTY
SURVEYOR

FIRST RE-ESTABLISHMENT

GCDB 200400

Section corner common to Sections 17, 18, 19, and 20 of Township 32 South, Range 1 West, W.M.

Found at the corner position, exposed 12 ins., with steel posts 2 ft. west and 3 ft. east, the 2 ins. diam. galv. iron pipe with a 2½ ins. diam. brass cap set by the BLM in 1955 and marked:

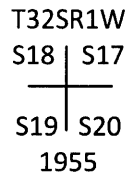

Original bearing trees recorded by Rufus Moore of the GLO in 1883 found and measured to center at base;

- Fir rotted stob with exposed face scribed 'S19' brs. S25°W, 11.1 ft. record ; S28°W, 10.6 ft to face
- D. Fir now 32 ins. diam. with a healed blaze, brs. N75°W, 7.3 ft. record ; 5.9 ft. to face

Bearing trees recorded by the BLM in 1955 found with healed single blazes and measured to center at base;

- D. fir now 34 ins. diam. brs. record N14°E, 19.8 ft.
- D. fir sawed stump brs. record S63½°E, 58.7 ft.
- D. fir now 28 ins. diam. brs. record S54¼°W, 23.1 ft.
- D. fir now 32 ins. diam. brs. record N5°W, 37.0 ft.

Marked a .new bearing tree 'CS''BT' and measured to center at lower blaze;

- Yew 9 ins. diam. brs. S62°E, 9.7 ft.

Corner lies approx. 700 ft. southerly along blocked spur road then approx 100 ft. west.

March 29, 2010

B. Beeman

H. Durkee

Kerry K. Bradshaw
Jackson County Surveyor

P. -67

V. - 18°25'

This corner report was downloaded from the Jackson Co. Surveyors website - corner 15 on Co. Line

C.S. File No 67/31-15