

GOVERNMENT CORNER RESTORATION FORM

FILED

TOWNSHIP 30S RANGE 05W SEC. 3 PLSS # 400640

Date: 3-4-2013 By: JC  
This survey consists of:

DOUGLAS COUNTY OREGON

DATE FEB 11, 2013

Map: \_\_\_\_\_

Narrative: \_\_\_\_\_

Corner Designation

Corner Rpt: CS 67/38-16

DOUGLAS COUNTY  
SURVEYOR

Previous Renewals 1963, 1990-91  
Monument(s) Found: \_\_\_\_\_ (Condition and Source)

- Condition Report
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

A 2 1/2 INCH DIAMETER BRASS CAP (MARKED AS AT RIGHT) ON A 1 INCH I. D. IRON PIPE LEANING APPROX. 12 FEET NORTHWESTERLY FROM PLUMB AND UNDER THE SOUTHERLY END OF A FALLEN AND ROTTED 24 INCH DIAMETER FIR. (ACCESSORIES FOUND ARE CHECKED FOR B. AND D. FROM WHAT WOULD BE THE PLUMB POSITION OF THE FOUND MONUMENT).

MONUMENT DETAIL

COUNTY SURVEYORS OFFICE

T 30S

1/4 S4 | S3

R 5W

1963

Accessories Found

EVIDENCE OF THE TWO O.B.T.S.:  
A FIR 12" DIA. NOW 32 INCH DIAMETER 8 FOOT TALL DOUGLAS FIR SNAG, WITH NO CLEAR BLAZE EVIDENCE VISIBLE; BEARS S45°E, 59 FEET DISTANT (AS PER RECORD).  
A FIR 10" DIA. NOW A ROTTED 14 INCH DIAMETER 2 1/2 FOOT TALL FIR STUMP WITH NO BLAZE OR SCRIBE EVIDENCE REMAINING; BEARS N45°W, 21 8 FEET DISTANT (AS PER RECORD).

EVIDENCE OF THE TWO 1963 RENEWAL B.T.S.  
A 14" R. FIR NOW A 25 INCH DIAMETER, APPROX. 12 FOOT TALL, DOUGLAS FIR SNAG WITH A FULLY HEALED DOUBLE BLAZE; BEARS SOUTH, 230 FEET DISTANT (RECORD SOUTH, 218 T; GROUND IS STEEP, POSSIBLY A BAD SLOPE REDUCTION).  
A 12" MAPLE NOW A POSSIBLE ROOT-HOLE NEAR RECORD BEARING AND DISTANCE.

EVIDENCE OF THE 1990-91 RENEWAL B.T.  
A FIR, 15 INS. DIAM. NOW A 17 INCH DIAMETER, 9 FOOT TALL DOUGLAS FIR SNAG WITH A FULLY HEALED DOUBLE BLAZE; BEARS S64°W, 60 1/2 FEET DISTANT (AS PER RECORD).

WE CLEAR AWAY FALLEN FIR OVER THE MONUMENT. WE RE-PLUMB AND STABILIZE MONUMENT WHICH NOW IS FIRMLY SET PROTRUDING 10 INCHES ABOVE GROUND.



N/A

New Accessories

- WE MARK 4 NEW B.T.s:
- A 10 INCH DIAMETER DOUGLAS FIR SCRIBED "1/4 S3 CS" "BT" ON A DOUBLE BLAZE; BEARS N61 1/2° E, 20' FEET DISTANT.
- A DOUBLE TRUNK MADRONE, THE 9 INCH DIAMETER, SOUTHERLY (AND LARGER) TRUNK OF WHICH IS SCRIBED "1/4 S4 CS" "BT" ON A DOUBLE BLAZE. THE C.R.C. OF THIS MADRONE BEARS S01° W, 15' FEET DISTANT.
- A 10 INCH DIAMETER SUGAR PINE SCRIBED "1/4 S4 CS" "BT" ON A DOUBLE BLAZE; BEARS N71 3/4° W, 21' FEET DISTANT.
- A 4 INCH DIAMETER (VERY PISTOL BUTT) SUGAR PINE SCRIBED "X" "CS BT" ON A HIGH-LOW BLAZE; THE C.R.C. OF WHICH BEARS N21 1/2° W, 3' FEET DISTANT.

Sketch of Monument, Accessories, and General Area

Location & Comments

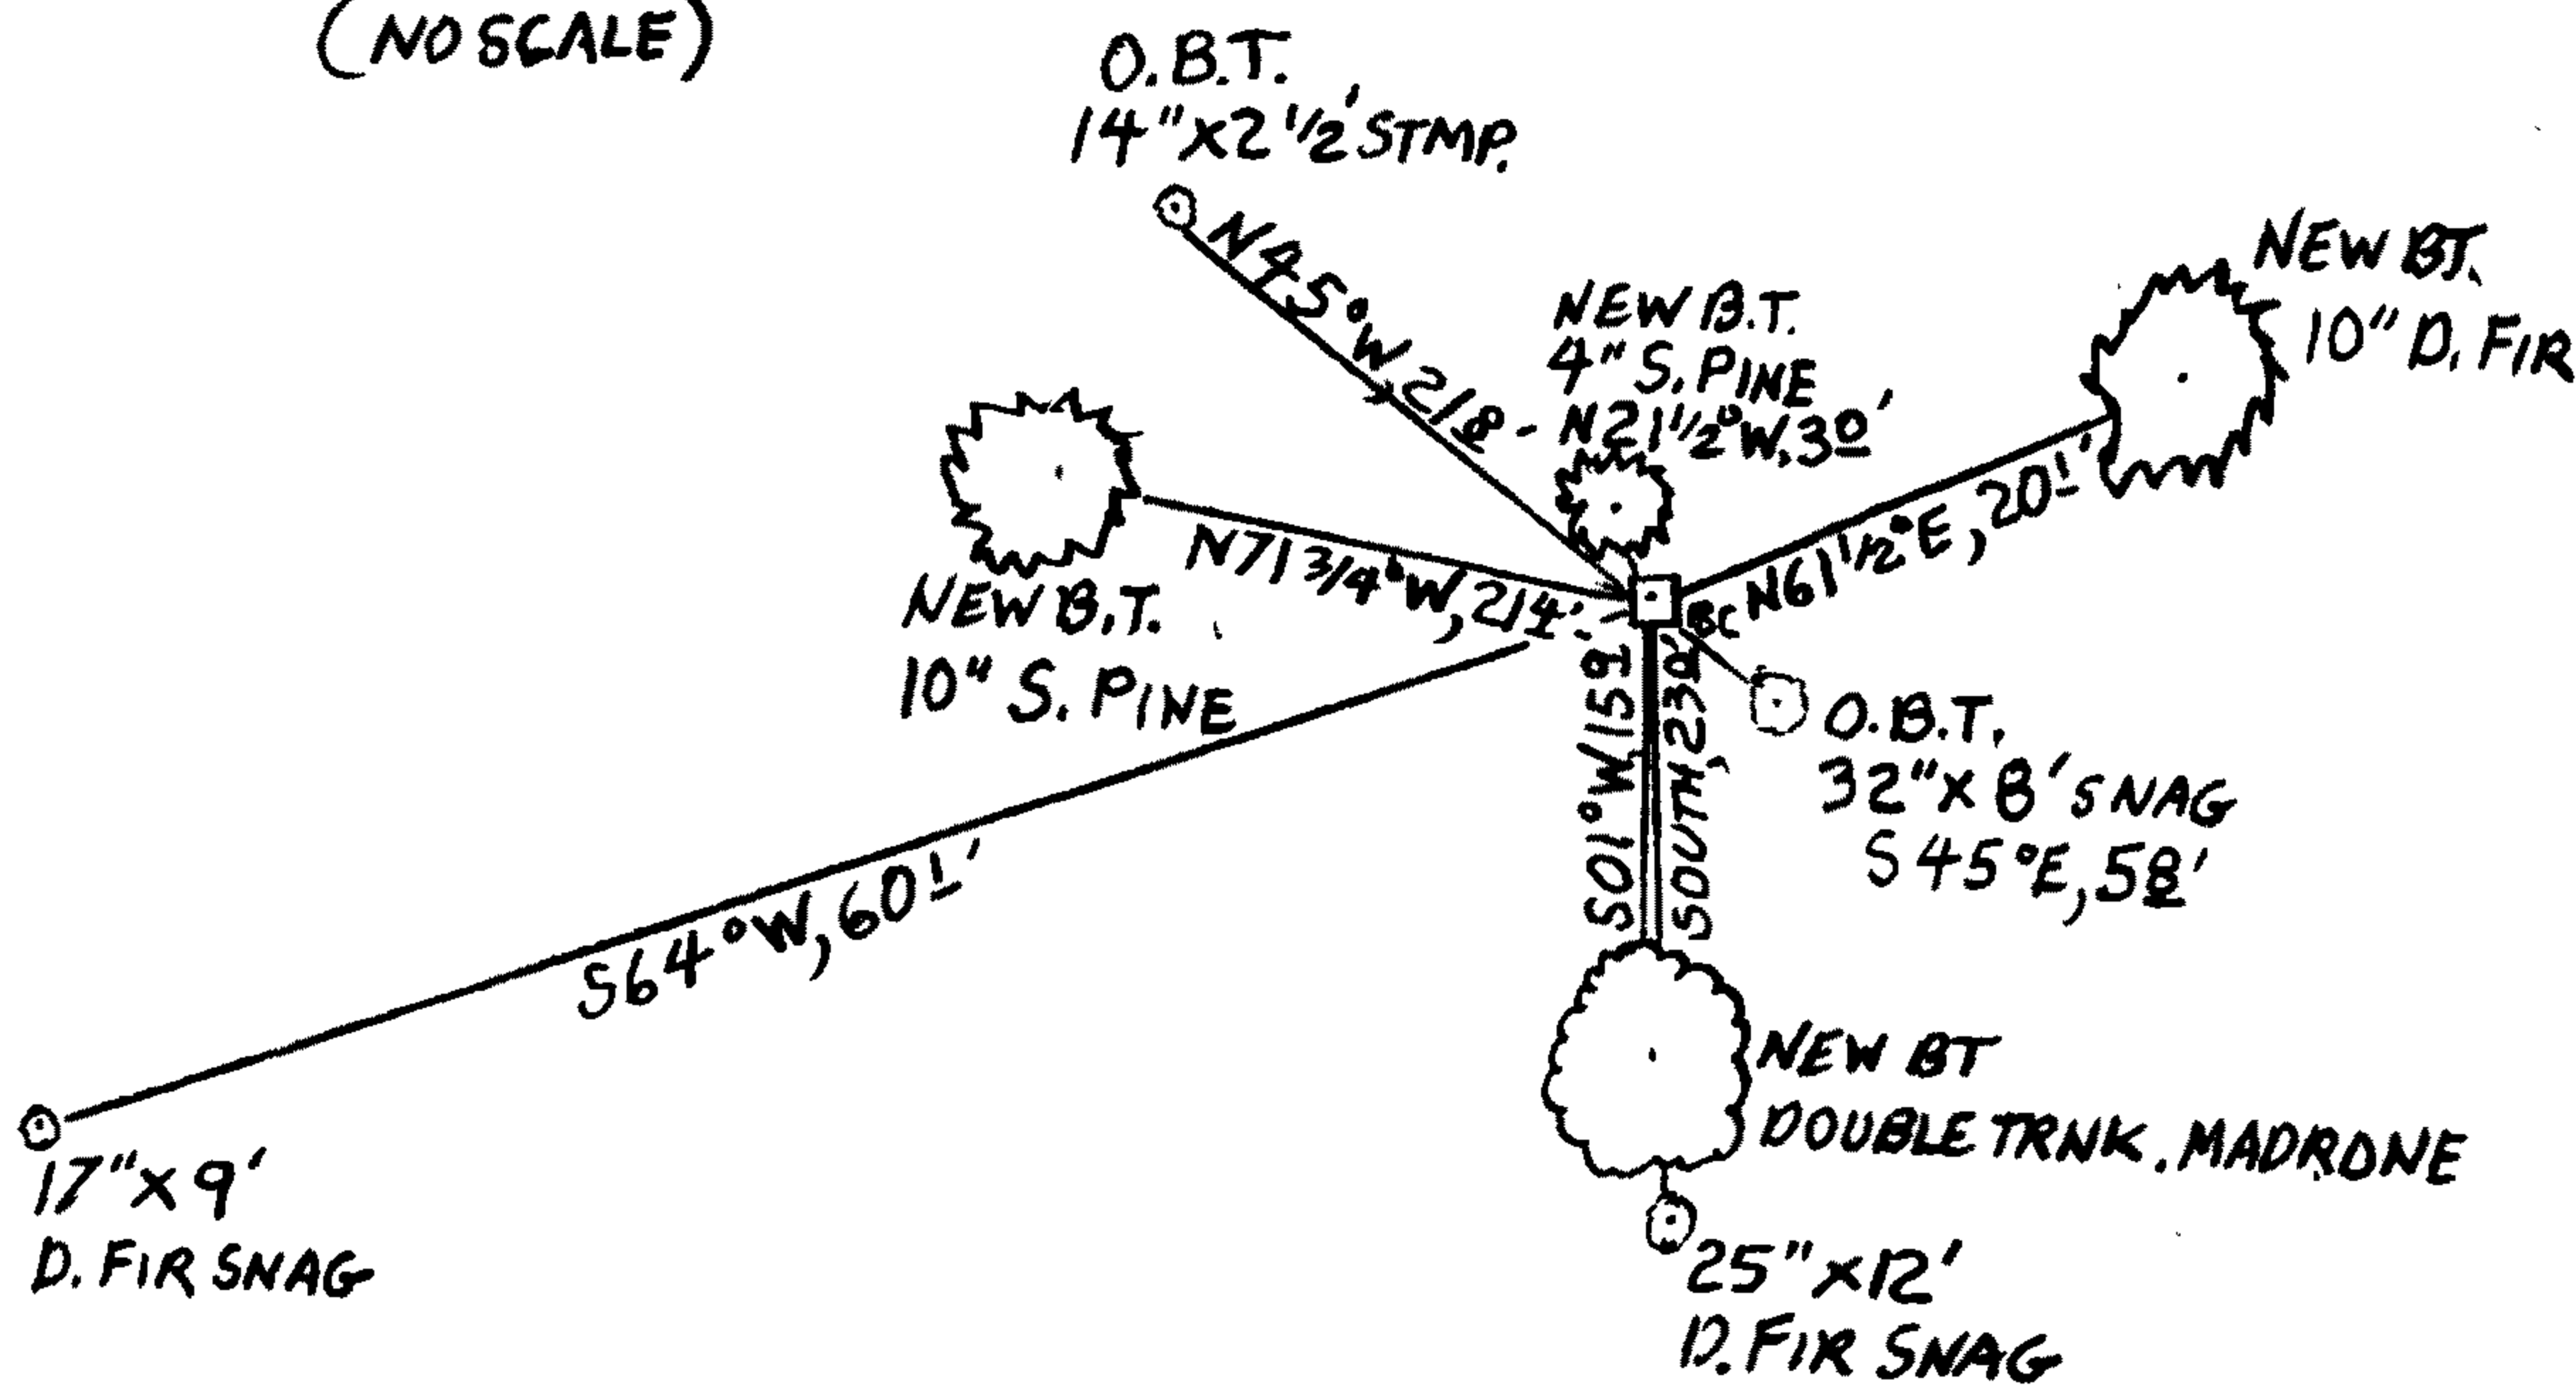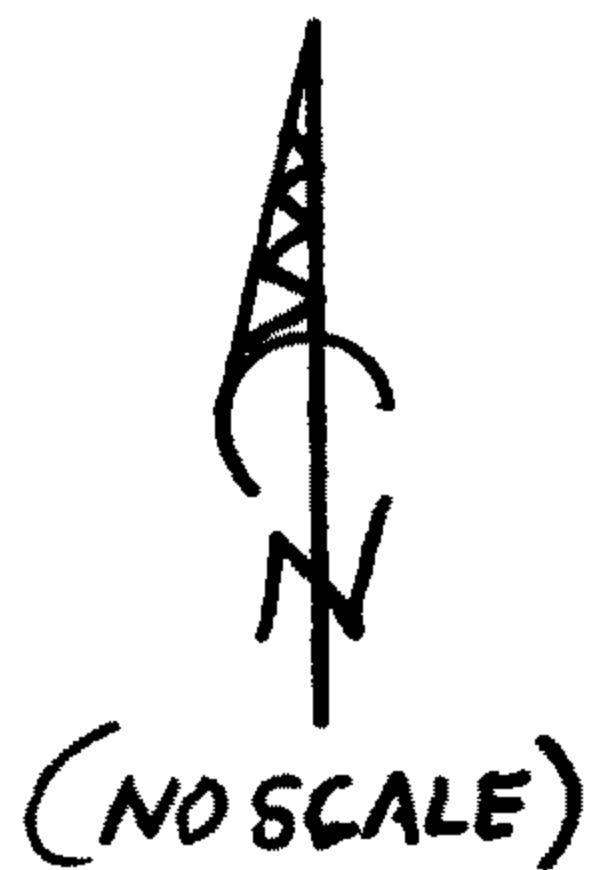

A STEEL CORNER POST OF MOSTLY FALLEN FENCES RUNNING SOUTH AND WEST IS 1 FOOT WEST OF B.C. MONUMENT. CORNER IS ON FAIRLY STEEP NORTH SLOPE IN YOUNG REPROD. FOREST OF MOSTLY DOUGLAS FIR WITH SOME PINE AND MADRONE

Comp. Decline. 15 1/2° E  
 Agency D.C.S.O.  
 Party Chief STEPHEN JOHN FLAISE  
 Note keeper Stephen John Flaiss  
 Witnesses MIKE S. KOCH

Surveyor's Seal

REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

*Handwritten signature of Randall W. Smith*

OREGON  
 JULY 25, 1990  
 RANDALL W. SMITH  
 2400

RENEWAL 6-30-2014