

GOVERNMENT CORNER RESTORATION FORM

FILED

TOWNSHIP 24S RANGE 07W SEC. 16 PLSS # 300400

Date: 9-16-2014 By: X  
This survey consists of:

DOUGLAS COUNTY OREGON

DATE AUG 19, 2014

Map: \_\_\_\_\_

Corner Designation

Narrative: \_\_\_\_\_

Corner Rpt: CS 67/41-55

517 | 516  
520 | 521

DOUGLAS COUNTY  
SURVEYOR

(ALSO MC)

Previous Renewals 1939, 1960, 1976, 1982  
Monument(s) Found: \_\_\_\_\_ (Condition and Source)

- \_\_\_\_\_ Condition Report
- \_\_\_\_\_ Not Found
- Renewed
- \_\_\_\_\_ Unrecorded
- \_\_\_\_\_ Surveyed In
- \_\_\_\_\_ Referenced Out

MONUMENT DETAIL

FROM THE 1982 DCSD RENEWAL, A 2 1/2 INCH  
DIAMETER BRASS CAP (MARKED AS AT UPPER RIGHT) ON A 1 INCH  
I.D. IRON PIPE IS SET PLUMB, 14 INCHES BELOW  
GROUND SURFACE.

DOUGLAS CO. SURVEYOR  
T 24 S

THE 1939 AND 1960 MONUMENTS WHICH WERE SET  
SIDE BY SIDE IN THE 1960 RENEWAL ARE NOT  
SEARCHED FOR. THE TOPS OF THESE MONUMENTS WOULD  
NOW BE APPROXIMATELY 4 FEET BELOW THE SURFACE.

R 517 | 516  
7 520 | 521  
W

ALSO M.C.  
1982

U.S. DEPT. OF THE INTERIOR  
T24S R7W 517  
RM

Accessories Found

1976  
BUR. OF LAND MANAGEMENT

NO EVIDENCE OF THE ORIGINAL BEARING TREES REMAINS.

NO EVIDENCE OF THE THREE 1939 RENEWAL B.T.'S.

EVIDENCE OF THE ONE 1960 RENEWAL B.T.:  
A 26" W. OAK NOW A FALLEN ROTTED AND PARTLY SAWN FOR FIREWOOD 24+ INCH OAK  
WITH NO BLAZE OR SCRIBE REMNANT SEEN; BEARS N05°E, 127± FEET DISTANT (AGREES WITH 1982  
RECORD; ORIGINAL RECORD COULD BE A FACE MEASUREMENT).

FROM THE 1976 B.L.M. RENEWAL THE REFERENCE MONUMENT:  
A 3 1/2 INCH DIAMETER BRASS CAP (MARKED AS ABOVE IN THE LOWER MONUMENT DETAIL) ON A  
2 INCH I.D. IRON PIPE PROTRUDING 3 INCHES ABOVE GROUND. THIS R.M. BEARS N9 1/2°W, 32°  
FEET DISTANT (AS PER RECORD). A METAL WITNESS POST AND SIGN 2 1/2 FEET TALL IS SET 0° FEET SOUTH  
OF THIS B.C.

FROM THE 1982 D.C.S.O. RENEWAL THE TWO NEW B.T.'S:  
AN 11" MYRTLE NOW A 38 INCH DIAM. MYRTLE (FOUR TRUNKS GROWN TOGETHER) WITH A FULLY HEALED  
DOUBLE BLAZE ON THE MOST EASTERLY TRUNK; BEARS N62°W, 31± FEET DISTANT TO 4 TRUNK C.R.C.  
(RECORD N62°W, 31° IS GOOD TO BASE DESCRIBED TRUNK).  
A 9" ASH (SPECIES MISIDENTIFIED) NOW A 12 INCH DIAM. ALDER WITH A PARTIALLY HEALED DOUBLE  
BLAZE SHOWING ROTTED FACES WITH NO SCRIBING VISIBLE. THIS TREE BEARS N73°E, 26± FEET  
DISTANT (AS PER RECORD).

C.S. File 67/41-55

RENEWAL

Monument Set (Procedure and Description)

MONUMENT DETAIL

N/A


THE 1982 MONUMENT IS LEFT AS FOUND 14 INCHES BELOW SURFACE BUT A METAL WITNESS POST AND SIGN IS SET SOUTH, 12 FEET DISTANT PROTRUDING 2 FEET ABOVE GROUND.

New Accessories

A 6 INCH DIAM. DOUGLAS FIR SCRIBED "X" "CSBT" ON A HIGH-LOW BLAZE; BEARS N 32 1/2° E, 215 FEET DISTANT.

Sketch of Monument, Accessories, and General Area (SKETCH SHOWS LIVE B.T.'S AND THE 1976 R.M.)

Location & Comments

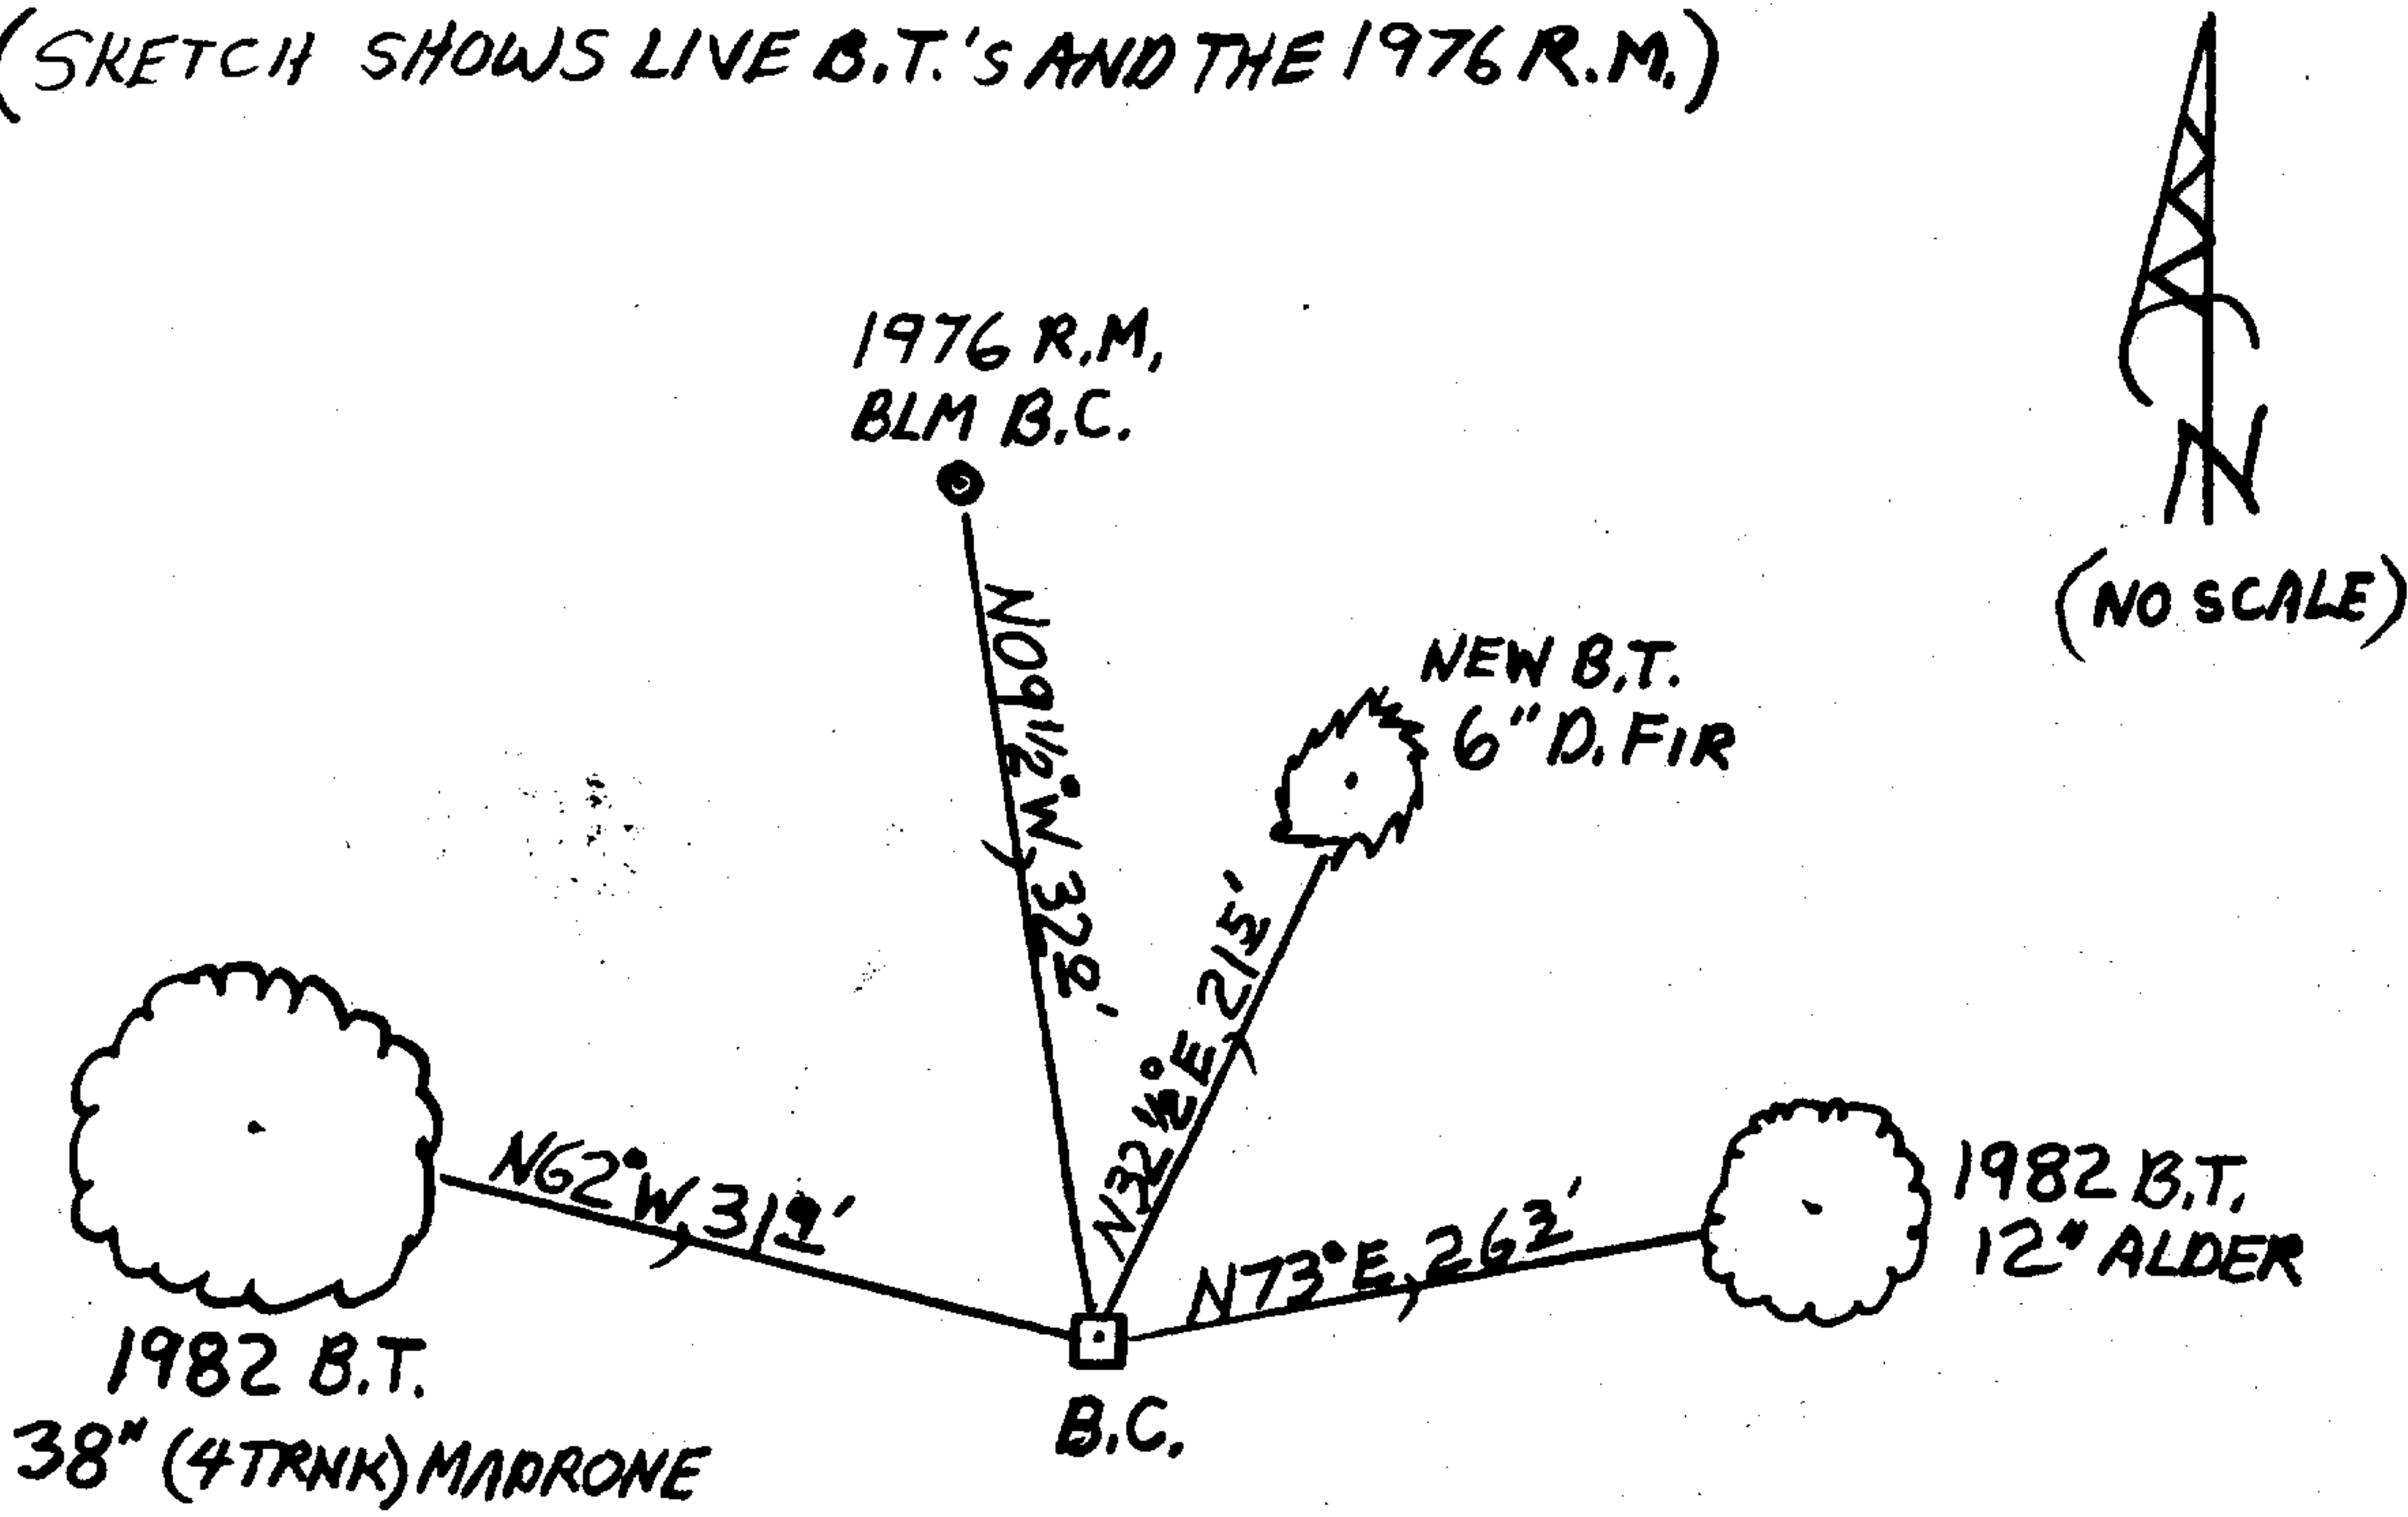

MONUMENT IS NEAR NORTH EDGE OF THE UMPQUA RIVER LEFT BANK FLOODPLAIN IN SILT SAND AND IS SUSCEPTIBLE TO WASHOUT OR BURIAL. AN EAST-WEST FOREST ROAD CENTERLINE IS NORTH APPROX. 45 FEET.

Comp. Decline. 15 1/2° E  
Agency D.C.S.O.  
Party Chief STEPHEN JOHN FLAUSE  
Note keeper Stephen John Flause  
Witnesses MIKE S. KOCH

Surveyor's Seal

REGISTERED PROFESSIONAL LAND SURVEYOR

*Randall W. Smith*

OREGON  
JULY 25, 1990  
RANDALL W. SMITH  
2488

RENEWAL 6-30-2016

