

GOVERNMENT CORNER RESTORATION FORM
DOUGLAS COUNTY SURVEYOR

TOWNSHIP 27½S RANGE 08W SECTION 34

PLSS/GCDB No. 27½-08-440200

CORNER DESIGNATION: N ¼ Section 34 only

CORNER HISTORY, PREVIOUS RENEWALS OR SURVEYS:

- See DCSO Survey & Corner records for PLSS 27-08-446100 North 1/4 Corner was restored by Albert White for BLM in 1961 per DCSO records Vol. 30 pages 12871-72.

MONUMENT FOUND (CONDITION AND SOURCE):

- A 2 1/2" Diam. Iron Pipe with a 3 1/4" BLM brass cap firmly set and projecting 3" , marked as follows:

ACCESSORIES FOUND (CONDITION, SOURCE & RECORD):

Bearing Trees by Albert White (BLM 1961):

- A 24" x 6" D. Fir stump bears S 62° E, 46.86 ft. (Metal Capped)
- A 30" x 5" D. Fir stump bears S 77° W 52.14 ft. (Metal Capped)
- North 1/4 corner Sec. 3, T28S R8W is South 44.22 ft

NEW ACCESSORIES (PROCEDURES AND DESCRIPTION):

All new BT's measured to side center root crown marked with a 2 1/2" PK nail and double blazed:

- A 10" D. Fir bears N 83° W, 10.6 ft. scribed "1/4 S 34", "CSBT"

LOCATION & COMMENTS:

All bearing trees have BT tags attached. All new bearing trees have double blazed faces with bearings measured to the center of the tree at the root crown and distances measured to the side and center of the root crown to a magnetic PK nail. Corner is located on a steep slope approximately 260 ft. North of logging access road.

GEODETIC COORDINATES

LATITUDE:
LONGITUDE:
ELLIPSOID HEIGHT:
DATUM: NAD 83
SOURCE:

COMPASS DECLINATION: 15° E.

AGENCY:DCSO
PARTY CHIEF: S. J. FLAUSE
WITNESSES: J. LORSUNG
NOTES: ATTACHED

FILED
Date: 11/17/2021

By: JC

Corner Form: CS 67/50-4


Field Notes: 3995

DOUGLAS COUNTY SURVEYOR

DATE: November, 7, 2018

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

MONUMENT DETAIL

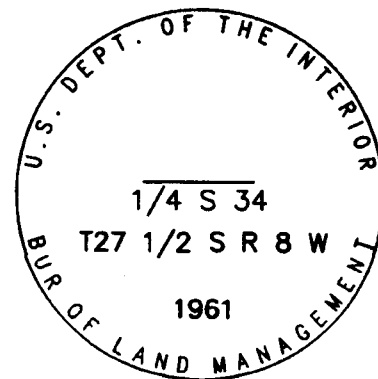

CS 67/50-4

27k

NN only

PLSS 4416106
440200

T275 R8W S34

11/7/18

MONUMENT:

3 1/4" BC (BLM) FIRMLY SET +
PROJECTING 3" MARKED PER RECORD

FOUND:

24" X 6' FIR STUMP, S 62° E, 46 ⁸⁶
30" X 5' FIR STUMP, S 77° W, 52 ¹⁴
BOTH METAL CAPPED

NEW:

10" O. FIR N 83° W, 10', ("1/4 S34",
"CSBT")

440700 IS SOUTH 44 ²²
T28-8-3

CS 67/50-4
2/3

11/07/18

TOWNSHIP 27 RANGE 08 POINT IDENTIFIER # 446100

PRIMARY CORNER DESCRIPTION N. 1/4 Cor. Sec. 34 only, T27-8

Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____

BLM Resurvey by C. Albert White; John M. Jelley; James E. Jelley, Cadastral Surveyors, Under group #466, Surveyed Sept/Oct. 1961 - (DCSO records Vol. 30 Page(s) 12871-72)

Set an iron post 28" long, 2 1/2" dia., 24" in the ground, with brass cap mkd. DEPT. OF THE INTERIOR
 3/4" BC P.M. PROT. 3" 1/4 S 34
 T 27 1/2 S R 8 W

24" x 6 FT TALL METAL CAPPED STAMP

from which BUR. OF LAND MANAGE^{ENT} 62° 48' 86" Fir 26" dia., bears S. 62 1/2° E., 71 lks. dist. mkd. 1/4 S34 FHSB

30" x 5 FT TALL METAL CAPPED STAMP

NO BARK BT. 77° 52' 14" Fir 28" dia., bears S. 77° W., 79 lks. dist. mkd. X only HEALED BLZ SMALL

(From this point the standard 1/4 sec. cor. of sec. 34, T27S R8W bears N. 89° 12' W., 5.81 chs. dist.)

440700 is South, 4422 (NFRACE 441)

NEW BT

10" D. FIR "1/4 S34" "CSBT" ON D.B N 83° W, 106'

COR IS ON MODERATE TO STEEP SOUTH SLOPE 200' ± NORTH OF FOREST ACCESS RD. IN OLDER REPROD. FIR

CS 62/50-4
3/3