





12/02/2008 10:31:03 AM
 PLAT-PAR Cnt=1 Stn=1 RECEIPTCOUNTER
 This is a no fee document

SW Cor. DLC #44, T29S, R7W
 Fd. DCSD Brass Cap &
 Accessories per 044030

BP: 10+00.00
 Ireland Road - 261.54' North
 & 329.07' West from SE Cor., DLC #44
 See Road Vacation Doc. 2003-18913

Benedict Road Sta. 41+00.27 - 136.23' North
 & 142.22' West from SE DLC #44
 See Road Vacation Doc. 2003-18913

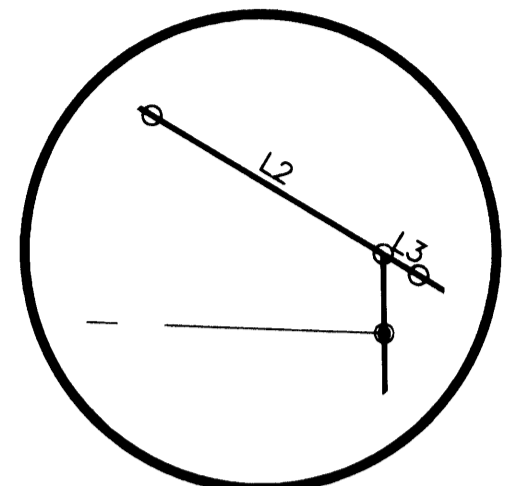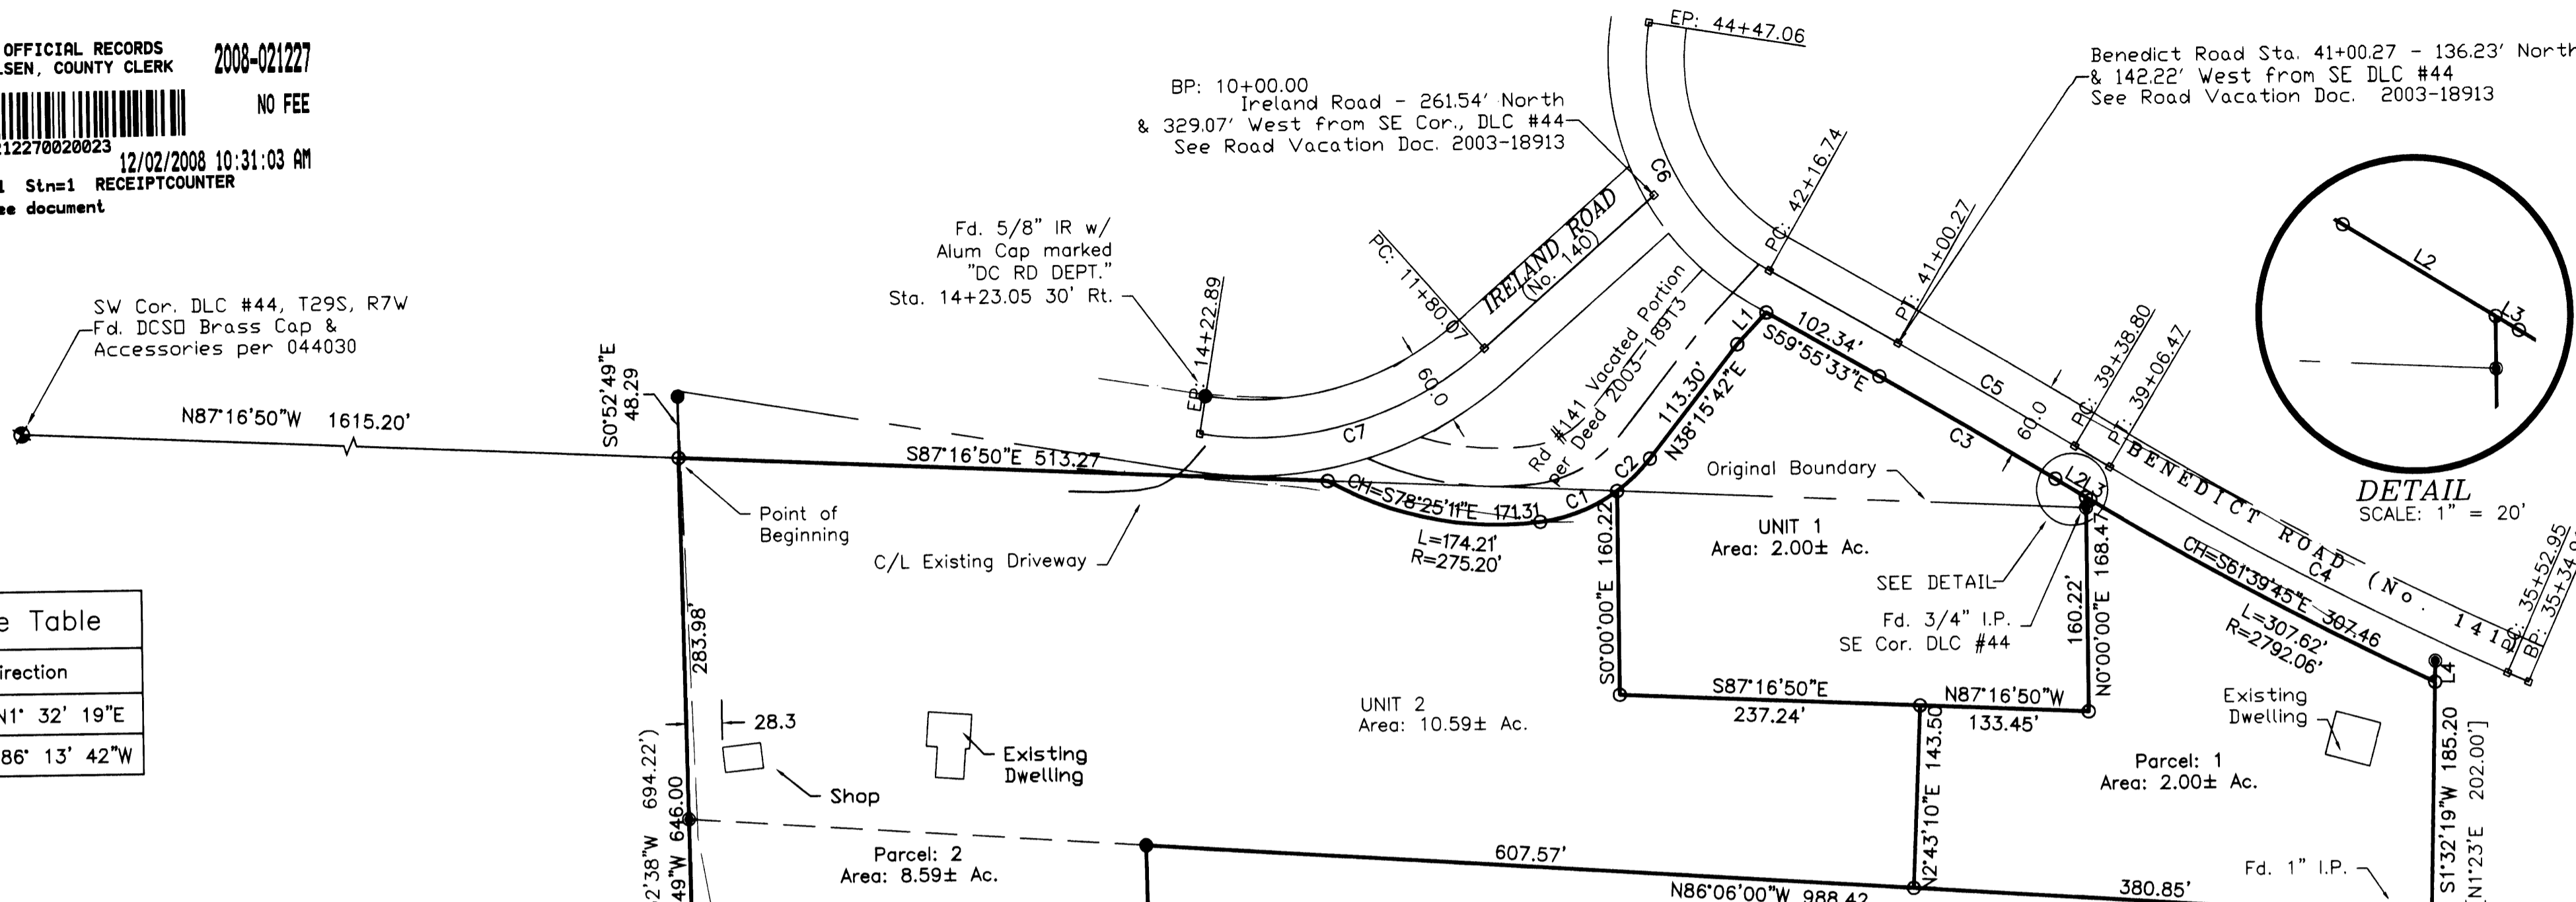

DETAIL
 SCALE: 1" = 20'

Parcel Line Table

| Line # | Length | Direction |
|--------|--------|---------------|
| L4 | 16.56 | N1° 32' 19"E |
| L5 | 29.51 | N86° 13' 42"W |

Curve Table

| Curve # | Length | Radius | Delta | Chord Direction | Chord Length |
|---------|--------|---------|-----------|-----------------|--------------|
| C1 | 66.03 | 130.00 | 29°06'12" | N68° 53' 39"E | 65.33 |
| C3 | 160.73 | 6489.07 | 1°25'09" | S59° 12' 59"E | 160.72 |

Curve Table: C/L Alignments

| Curve # | Radius | Length | Delta | Chord Direction | Chord Length |
|---------|---------|--------|-----------|-----------------|--------------|
| C4 | 2762.51 | 353.53 | 7°19'56" | N62°10'23"W | 353.28 |
| C5 | 6519.07 | 161.47 | 1°25'09" | N59°12'59"W | 161.47 |
| C6 | 190.61 | 230.32 | 69°13'56" | N25°18'35"W | 216.56 |
| C7 | 274.14 | 242.82 | 50°44'59" | S74°07'53"W | 234.96 |

PARTITIONER/OWNERS: Roger and Mary Waechter
 P.O. Box 142
 Tenmile, Oregon 97481

TOTAL NO. OF PARCELS: 3 (Two Parcels & Unit 1)

WATER: Spring

SEWER: Septic

ZONING: FF, FG

COMP. PLAN: FFT, AGG

PLANNING FILE NO.: 07-261


RESTRICTIVE COVENANT RECORD'S NO. 2008-019144

- LEGEND:**
- Found 5/8" Iron Rod unless noted
 - ⊙ Found 3/4" Iron Pipe unless noted.
 - Set 5/8" x 30" Iron Rod w/ Yellow Plastic Cap marked "LANDMARK PLS 2287"
 - Calculated Point
 - Fence Line

RECORD INFORMATION:

() M131-67
 [] M47-77

GRAPHIC SCALE

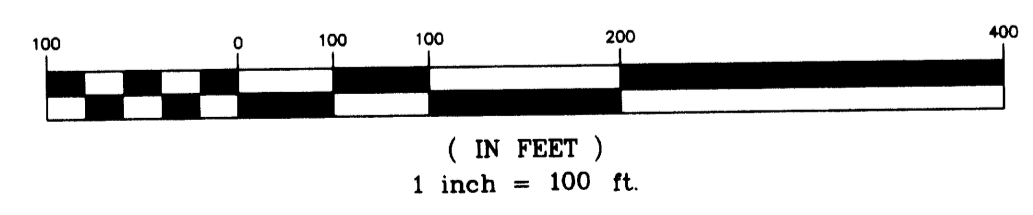

Sheet 1 of 2

PARTITION PLAT
 & BOUNDARY LINE ADJUSTMENT

In the NE 1/4, Sec. 7, Township 29 South, Range 7 West, W.M.
 Douglas County, Oregon
 April 10, 2008

FOR: Roger Waechter
 P.O. Box 142
 Tenmile, Oregon 97481

REGISTERED PROFESSIONAL LAND SURVEYOR
 Mark A. Heimbürger
 OREGON
 JULY 16, 1987
 MARK A. HEIMBURGER
 2287
 RENEWS JUNE 30, 2009

LM LAND MARK SURVEYING, INC.
 3329 N.E. STEPHENS ST.
 ROSEBURG, OREGON 97470
 TEL. (541) 677-9400
 FAX (541) 677-9401

2208-0014

2008-0088 A

2008-0088 A

2008-0088 B

DECLARATION:

KNOW ALL PEOPLE BY THESE PRESENTS, that Roger Waechter and Mary Waechter, the owners of the land represented on the annexed map and more particularly described in the accompanying Surveyor's Certificate, do hereby declare the annexed map to be a correct map of the Partition Plat as shown, of said property. They have caused this partition plat to be prepared and the property to be partitioned into parcels as shown.

Roger D. Waechter 10/21/08
Roger Waechter Date
Mary Waechter 10-21-08
Mary Waechter Date

ACKNOWLEDGMENT:

State of Oregon)
ss
Douglas County)

On the 21ST day of OCTOBER, 2008 before me appeared Roger Waechter and Mary Waechter, being duly sworn, acknowledged to me that they are the owners of said property, and that they executed the foregoing Declaration freely and voluntarily.

In witness whereof I have hereunto set my hand and affixed my seal this 21ST day of OCTOBER, 2008.

Kristia A. Gilbert
Notary Public for Oregon (Printed Name)

Kristia Gilbert
Signature

My Commission Number: 431039

My commission expires: 08-02-2012



APPROVALS:

Keith L. Cubie
Douglas County Planning Director

10/21/08
Date

Randy Smith
Douglas County Surveyor Deputy

10-22-08
Date

I hereby certify that all taxes and special assessments or other charges required by law have been paid.

Sandra K. Conner 12/2/08
Douglas County Tax Collector Date

Filed this 2ND day of DECEMBER 2008.

BARBARA E. NIELSEN, by Ashon Faye
Douglas County Clerk Deputy



NARRATIVE:

The purpose of the survey is to demarcate the boundary of the properties described in Deed References 87-14755, 88-14104, 98-24144, and 2006-8773. The property boundaries were adjusted and the partitioned in accordance with Douglas County Planning Department conditions as outlined in File No. 07-261.

The West and a portion of the South boundaries were controlled holding the monuments and survey information per M131-67. The remainder of the South boundary and the East boundary were controlled by monuments found per M47-77.

A portion of the North boundary is common to the old right of ways of the vacated portion of Ireland Road and the Benedict Road. The alignment of Benedict Road was determined pre Deed Reference No. 2003-18913. Alignment was computed per the deed and rotated holding the SE Corner of DLC #44 and the monument on the North right of way line of Ireland Road at Engineers Station 14+22.89, 30 feet right. The right of way for the vacated portion was established offsetting the existing roadbed centerline. The remainder of the North line is common with the South line of D.L.C. No. 44 which was determined by tying the SW and SE corners.

Exterior corners, adjusted common property lines and partition parcel lines were monumented.

SURVEYOR'S CERTIFICATE

I, Mark A. Heimburger do hereby certify that I have correctly surveyed and monumented with proper monuments, the lands so indicated on the annexed plat and that the boundaries are properly described in Deed Reference Numbers 87-14755, 88-14104, 98-24144, and 2006-8773, Douglas County, Oregon and being more particularly described as follows:

(UNIT 2)

BEGINNING at a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287" on the South boundary of Donation Land Claim No. 44 from which the Southwest Corner of said Claim bears North 87°16'50" West 1615.20 feet; thence along said South boundary South 87° 16' 50" East 513.27 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287" on the southerly right of way line of the Vacated Portion of County Road Number 140 as described in Deed Reference Number 2003-18913 at the beginning of a non-tangential curve; thence along said vacated right of way 174.21 feet along said curve turning to the left through an angle of 36° 16' 08", having a radius of 275.20 feet, and whose long chord bears South 78° 25' 11" East 171.31 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence 66.03 feet along a curve turning to the left through an angle of 45° 11' 03", having a radius of 130.00 feet, and whose long chord bears North 65° 53' 39" East 65.33 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence South 0°00'00" East 160.22 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence North 0°00'00" East 370.69 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence North 0°00'00" East 168.47 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence South 58° 30' 25" East 4.29 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence 307.62 feet along a curve turning to the left through an angle of 06° 18' 45", having a radius of 2792.06 feet, and whose long chord bears South 61° 39' 45" East 307.46 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence leaving said right of way line, South 01° 32' 19" West 185.20 feet to a bent 3/4 inch iron pipe; thence North 86° 13' 42" West 29.51 feet to a 1" iron pipe; thence North 86° 06' 00" West 988.42 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence South 00° 51' 20" East 361.90 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence North 86° 05' 32" West 361.80 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence North 00° 52' 49" West 646.00 feet to the POINT OF BEGINNING; all situated in the Northeast 1/4 of Section 7, Township 29 South, Range 7 West, Willamette Meridian, Douglas County, Oregon, containing 10.59 acres more or less.

DESCRIPTION - UNIT 1

BEGINNING at a 3/4 inch iron at the Southeast Corner of Donation Land Claim No. 44; thence South 00° 00' 00" West 160.22 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence North 87° 16' 50" West 133.45 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence North 87° 16' 50" West 237.24 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence North 00° 00' 00" East 160.22 feet to the beginning of a non-tangential curve, Said curve turning to the left through an angle of 16° 04' 52", having a radius of 130.00 feet, and whose long chord bears North 46° 18' 08" East 36.37 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence North 38° 15' 42" East 113.30 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence North 43° 13' 44" East 33.98 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287" on the Southwesterly Right of Way line of Benedict County Road Number 141; thence along said Right of Way, South 59° 55' 33" East 102.34 feet to the beginning of a tangential curve, Said curve turning to the right through an angle of 01° 25' 09", having a radius of 6489.07 feet, and whose long chord bears South 59° 12' 59" East 160.72 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence South 58° 30' 25" East 28.04 feet to a 5/8 inch iron rod with a plastic cap marked "LANDMARK PLS 2287"; thence South 00° 00' 00" West 8.25 feet to the POINT OF BEGINNING, containing 2.00 acres more or less.

Sheet 2 of 2

PARTITION PLAT
& BOUNDARY LINE ADJUSTMENT

In the NE 1/4, Sec. 7, Township 29 South, Range 7 West, W.M.
Douglas County, Oregon
April 10, 2008

FOR: Roger Waechter
P.O. Box 142
Tennile, Oregon 97481

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Mark A. Heimburger

OREGON
JULY 16, 1987
MARK A. HEIMBURGER
2287

RENEWS JUNE 30, 2009

LM LAND MARK
SURVEYING, INC.

3329 N.E. STEPHENS ST.
ROSEBURG, OREGON 97470
TEL. (541) 677-9400
FAX (541) 677-9401

2208-0014

2008-0088 B