

PRIMARY CORNER DESCRIPTION Sec. cor. for 1 & 12 only (East)

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

GLO survey by Wm. Thiel, Deputy Surveyor, under Contract #567, dated Feb. 16, 1891 (DCSO records Vol. 1 Page(s) 109)

Set a post 4½ ft. long, 4" sq., 24" in the ground, for cor. to secs. 1, 12, 6 and 7, marked T20S S6 on NE.; R10W S7 on SE.; R11W S12 on SW.; S1 on NW. face, with 5 notches on S. and 1 notch on N. edge, from which

- A Maple 8" dia., bears N.45°E., 30 lks. dist. mkd. T20S R10W S6 BT.
- A Maple 24" dia., bears S.89°E., 30 lks. dist. mkd. T20S R10W S7 BT.
- An Alder 4" dia., bears S.64°W., 117 lks. dist. mkd. T20S 11W S12 BT.
- A Fir 4" dia., bears N.21°W., 47 lks. dist. mkd. T20S R11W S1 BT.

GLO survey by Nathaniel Martin, under Contract 599, dated June 20, 1892 - (DCSO records Vol. 1 Page(s) 252)

(found corner described as of record)
"I destroyed all marks relating to R. 10 W."

Survey by James W. Prochnau - For: U.S. Forest Service - May 1971 (Revised Aug. 1971) - C.S. File 55/201-16; M 41-77 (Revised on M 43-56 - Corner #13 on Map)


Found - Orig. Maple BT, in NE quadrant, good face but scribing was destroyed in 1894.

Found Fir BT, now 30" windfall with faint face on bottom.

Corner agrees very well with "canyon" call 0.25 chains North.

In 1894, all markings relating to R10W were destroyed making cor common to secs. 1 & 12 only.

From the original Maple BT in NE quadrant, I placed a 2" x 36" galv. I.P., flanged at bottom and capped with a bronze disk welded on top. Monument projects 6" above ground. I filled in round the pipe monument with stone and packed earth. I stamped the disk:

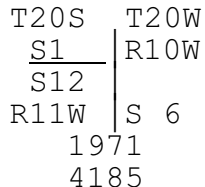

New BTs -A 24" Fir bears N.30°W., 75.29 ft.

An 18" Fir bears S.3°W., 23.93 ft.

(Cont. Next Page)

TOWNSHIP 20 RANGE 11 POINT IDENTIFIER # 700600

PRIMARY CORNER DESCRIPTION Sec. Cor. for 1 & 12 only (East)

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

Fd. OK, Sept. 18, 1984 by DCSO - C.S. File 62/21-3