

PRIMARY CORNER DESCRIPTION Sec. Cor. for 20, 21, 28 and 29

Alias	_____	Description	_____
Alias	_____	Description	_____
Alias	_____	Description	_____
Alias	_____	Description	_____

Original - Robert Elder and Henry Gile, Deputy Surveyors, under Contract #31 dated April 7, 1853 (DCSO records Vol. 6 Page(s) 2368)

-----

Set post, cor. to secs. 20, 21, 28 and 29, from which

- A W.Oak 16" dia., bears S.81½°E., 972 lks.
- A W.Oak 16" dia., bears N.71½°W., 79 lks.
- A W.Oak 26" dia., bears N.76°E., 219 lks.
- A W.Oak 20" dia., bears N.39°W., 182 lks.

Douglas Co. Surveyors Office - Vernon "Ray" Tracy, J. Heritage, V. Perron, crew - Sept. 1969 - C.S. File 54/16-54

-----

We chain North 271.9 ft. from the NW cor. DLC #47:  
 Found - Orig. 16" now 38" W.Oak, alive, S.71½°W., 52.1 ft.  
 (Rec. N.71½°W) Previously opened, no scribe visible. Open higher and find scribe.  
 Approx. 36" decayed Oak stump, N.76°E., 144.5 ft., no scribe.

From the tie to DLC cor. and BTs found, we determine the bearing to the 38" Oak to be SW rather than NW. Do not find any other BTs.

Set Brass cap at cor. mkd: County Surveyors Office

T	23	S	R	5	W
		S20		S21	
		S29		S28	
		1969			

New BTs -9" D.Fir N.59°E., 2.5 ft. mkd. T23S R5W S21 CS BT.  
 13" D.Fir S.19°E., 7.9 ft. mkd. T23S R5W S28 CS BT.  
 14" D.Fir S.49°W., 21.1 ft. mkd. T23S R5W S29 CSBT  
 10" D.Fir N.62°W., 23.8 ft. mkd. T23S R5W S20 CSBT  
 Corner lies on gentle NE slope about 660 ft. N. of hill.

Douglas Co. Surveyors Office - Randall Smith, Stephen Flause, Deputies - Sept. 7, 1984 - C.S. File 62/21-5

-----

Found - 1969 DCSO brass cap, properly mkd., on a I.P. protruding 10" above ground.  
 26" W.Oak now a depression with a down and rotted tree alongside, bears N.76°E., 144.5 ft. (Orig.)  
 16" W.Oak now a 35" dead tree with a previously opened face, no scribe found, bears S.71½°W., 52.1 ft. (Orig.)  
 9" now a 10" D.Fir 2½ ft. high snag with a partially healed single blaze and scribe visible "R5W S21 CS BT" bears N.59°E., 2.5 ft.

(Cont. Next Page)

PRIMARY CORNER DESCRIPTION Sec. Cor. for 20, 21, 28 and 29


Alias \_\_\_\_\_ Description \_\_\_\_\_  
 Alias \_\_\_\_\_ Description \_\_\_\_\_  
 Alias \_\_\_\_\_ Description \_\_\_\_\_  
 Alias \_\_\_\_\_ Description \_\_\_\_\_

13" now a 17" D.Fir with a well healed single blaze bears S.19°E., 7.9 ft.  
 14" now a 20" D.Fir blow down with a well healed single blaze, bears S.49°W. 11.1 ft. (Rec. 21.1')  
 10" now a 13" D.Fir with a well healed single blaze bears N.62°W., 23.4 ft. (Rec. 23.8 ft.)  
 A DCSO disk stamped "T23S R5W NW Cor DLC 47 1984" bears South, 268.1 ft. (Rec. 271.9 ft.) bearing taken with a hand compass (Per orig. DLC notes of the NW cor. DLC 47)  
 New BTs -9" D.Fir double blazed and scribed "T23S R5W S21 CS BT" bears N.65°E., 27.7 ft.  
 9" D.Fir double blazed and scribed "T23S R5W S29 CS BT" bears S.72°W., 28.6 ft.  
 Corner lies on a gentle NE slope.

Found Ok by D. Bentz, 9/96, 1996-0092

BLM dependent resurvey by Wayne Rogers & Bryan Seibold, Cadastral Surveyors, under Group #1832 surveyed July - Oct. 1997 - (DCSO recs. Vol. 53 Pg(s) 20274-5)

-----  
 The cor. of secs. 20, 21, 28 & 29, perpetuated by Tracy, in 1969, and by Smith & Flause, in 1984, monumented with an iron post, 1½" diam., firmly set, projecting 10" above ground, with brass cap mkd. COUNTY SURVEYORS OFFICE

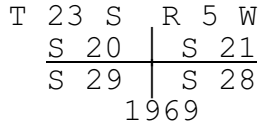

from which the remains of an original bearing tree  
 A root hole, bears S.71½°W., 79 lks., with uprooted oak, 26" diam., alongside, no marks visible on opened blaze. (Record, N.71½°W.)  
 and the remains of bearing trees mkd. by Tracy  
 A decayed fir snag, 11" diam., bears N.59 3/4°E., 4 lks. with fragmentary scribe marks visible on remains of open partially decayed blaze.  
 A sawed fir stump, 16" diam., bears S.17¼°E., 11½ lks., no marks visible.  
 A root hole, bears S.44½°W., 17 lks., no remains of tree found.  
 A fir, 15" diam., bears N.62¼°W., 36 lks., with healed blaze.  
 and the remains of bearing trees mkd. by Smith and Flause  
 A fir snag, 8" diam., bears S.73 3/4°W., 43½ lks., with scribe marks T23S R5W S29 CS BT visible on open double blaze.  
 continued next page

TOWNSHIP 23 RANGE 05 POINT IDENTIFIER # 300300

PRIMARY CORNER DESCRIPTION Sec. Cor. for 20, 21, 28 and 29

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

and new bearing trees

An oak, 37" diam., bears N.71°E., 135 lks., mkd. T23S R5W S21 BT.

An oak, 28" diam., bears S.20¼°E., 172 lks., mkd. T23S R5W S28 BT.

A fir, 20" diam., bears S.51°W., 33½ lks., mkd. T23S R5W S29 BT.

Fd. OK by K. Hoffine, Nov. 2000 - M136-28

Douglas Co. Surveyors Office - Stephen J. Flauser - John Pike  
- 12/7/2006 - C.S. File 67/14-53

-----  
Fd ok, 4 live BTs as per BLM 1997 renewal.