


PRIMARY CORNER DESCRIPTION Sec. Cor. for 12 & 13; 7 & 18, T23-5
 Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____

BLM Corrective Dependent Resurvey by Wayne L. Rogers; Boyd W. Peterson; Philip G. Griffin; Dale T. Bedell; Cadastral Surveyors; and Robert H. Browning, Surveying Technician - under Group #'s 1266, 1637 and 1688, - surveyed June 9, 1986/August 22, 1995 - (DCSO records Vol. 51 Pages 19459-60)

The Sec. cor., monumented with an iron post, 2 ins. diam., firmly set, projecting 8" above ground, with brass cap mkd. T23S

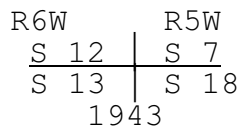

from which the remains of BTs mkd. by Gould, Gawron, & Eggen
 A roothole, bears N. 23½° E., 223 lks. dist., alongside of which is lying a fir, 40 ins. diam., with healed blaze.
 A fir, 26 ins. diam., bears S. 38° W., 106 lks. dist., with healed blaze. (Record, S. 42° W., 109 lks.)
 A sawed fir stump, 23 ins. diam., bears N. 49° W., 50 lks. dist., with healed blaze. (Record, N. 50° W., 61 lks.)
 and new bearing trees
 A fir, 13 ins. diam., bears N. 18° E., 67 lks. dist., mkd. T23S R5W S7 BT.
 A fir, 11 ins. diam., bears S. 10° E., 24 lks. dist., mkd. T23S R5W S18 BT.
 No suitable tree available in sec. 12.

Fd. & used on BLM corrective and dependent resurvey by Wayne L. Rogers, Cadastral Surveyor & Robert H. Browning, Surveying Technician, under Group #1803 surveyed May/Nov.. 1996 - (DCSO records Vol. 52 Page(s) 19963)

Fd. & used on BLM dependent resurvey by Wayne Rogers & Bryan Seibold, Cadastral Surveyors, under Group #1832 surveyed July - Oct. 1997 - (DCSO recs. Vol. 53 Pg(s) 20282)

DCSO-GIS Corner visitation - 3/6/2006 - Typed: 1/20/2011 - C.S. File 67/33-1

Monument - 2½" BC/IP
 Comment - ok; 3 live BTs & 1 stump.

FD. BC by D. Baker, 6/2008 - 2008-0043A&B