


PRIMARY CORNER DESCRIPTION CN 1/16 Sec. 31

Alias	Description

BLM dependent resurvey by Wm. W. Glenn, Cadastral Surveyor, under Group #416, surveyed Sept/Oct 1958 - (DCSO records Vol. 30 Page(s) 12600)

-----  
Point for the center north 1/16 sec. cor. of sec. 31.  
Set an iron post, 28" long, 2½" dia., 26" in the ground, with brass cap marked:

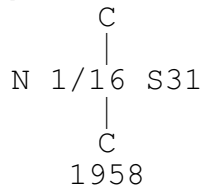

from which

- A fir, 10" dia., bears S.27½°E., 45 lks., mkd: CN 1/16 S31 BT.
- A fir, 30" dia., bears N.29¼°W., 39 lks., mkd: CN 1/16 S31 BT.

Douglas Co. Surveyor's Office - Crew: Stephen Flaue & Mike Koch - 5/10/2016 - C.S. File 67/44-11

-----  
Found - A 2½" dia. Iron post by Wm. Glenn, a 1958 USBLM firmly set, flush with the ground and leaning 6" easterly, with a 3¼" brass cap (properly) mkd.

BTs by Glenn in 1958 -

- A 14" dia. Pistol butted D.Fir bears S.27½°E., 30.6 ft. with a healed single blaze. (Rec. 29.7 ft)
- A large root bears N.29¼°W., 25.7 ft. with no remaining evidence of the original 30" dia fir BT

New - The 1958 USBLM monument is reset in a plumb position to project 2" above the ground.

- A 11" dia. Hemlock bears N.28½°E., 32.3 ft. scribed "CN 1/16 S31 CS BT".

Location & comments - All BTS have BT tags attached. All new BTs have double blazed faces with bearings measured to the center of the tree at the root crown and distances measured to the side and center of the root crown.

Corner falls on a moderate east slope in old growth fir and hemlock timber, see attached notes for vicinity sketch.

Compass declination: 15° E.