



PRIMARY CORNER DESCRIPTION 1/4 Cor. Secs. 13 & 14


Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_  
Alias \_\_\_\_\_ Description \_\_\_\_\_

Glen McChesney, Weyerhaeuser Co. - April 5, 1977 (filed 12/1980) - C.S. File 58/8-35

-----  
Found - Orig. stone not found.  
Orig. 36" now 44" Fir bears N.54°E., 9.2 ft. face overgrown.  
Orig. 14" now 16" down rotted Hemlock bears N.58°W., 11.5 ft. Hosford's 1½" iron pipe. 1957  
24" Hemlock, scribing visible, bears N.28°W., 26.6 ft. 1957  
1962 GLO brass cap alongside I.P.  
1962 11" now 12" Hemlock, bears N.66°W., 23.8 ft. scribing visible. BTs referenced w/Weyerhaeuser nails and plates in 1967.  
New BTs- 40" Fir, bears S.32°E., 15.7 ft.  
58" Fir stump, bears S.10°W., 26.3 ft.

BLM resurvey by A. Bert Skeesick, Cadastral Surveyor under Group #1979, surveyed 2001/2002- (DCSO rec. Vol. 54 Page(s) 20914-5)

-----  
The ¼ sec. cor. of secs. 13 & 14, monumented with an iron post, 2½" dia., firmly set, projecting 1 in. above ground, with brass cap mkd.

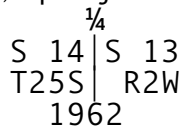

from which the remains of an original bearing tree  
A decayed sawed fir stump, 42" dia., bears N.57¾°E., 9.0 ft., with healed blaze. (Record, N.54°E.)  
and remains of a bearing tree mkd. by Hosford, in 1955, reported by Brooks  
A decayed hemlock stump, 22" dia., bears N.27°W., 26.5 ft., with scribe marks ¼ S14 253 BT visible on partially healed blaze. (Record, N.30½°W.)  
and remains of a bearing tree mkd. by Brooks  
A decayed sawed hemlock stump, 10" dia., bears N.62°W., 23.0 ft., with scribe marks ¼ S14 BT visible on unhealed blaze. (Record, N.66¾°W.)  
and new bearing trees  
A hemlock, 13" dia., bears S.23½°E., 8.5 ft. mkd. ¼ S13 BT  
A hemlock, 13" dia. bears N.87¾°W., 35.3 ft. mkd. ¼ S14 BT  
Each new bearing tree has a 2½"x ¼" magnetic nail (Mag Nail) driven at the base right side-center.