

PRIMARY CORNER DESCRIPTION 1/4 Cor. Secs. 15 and 16

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____


Original - Gordon & Gardner, Contract #52 dated Feb. 1855
(DCSO records, Volume 9 Page 3747)

Set 1/4 sec. post, from which
 A B.Oak 12" dia. bears N.38°E., 248 lks. dist.
 A W.Oak 18" dia. bears S.75°W., 217 lks. dist.
(D. Markum's house bears N.21°W.)

Bureau of Land Management Dependent Resurvey - Zirpel;
Corbin; and Roseberry - Special Instructions dated July 8,
1957 and July 15, 1958 (DCSO records, Volume 29 Page 12294)

The point for the 1/4 sec. cor. of secs. 15 and 16, in field at
proportionate distance; there is no remaining evidence of the
original corner.

Set an iron post, 28" long 2 1/2" dia., 60" in the ground, with
brass cap marked: T25S R4W

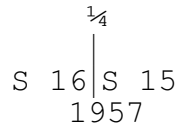

 from which

An Apple 6" dia. located in fence row, bears N.31°40'E.,
56 1/2 lks. dist. mkd. 1/4 S 15 BT.
A W.Oak 11" dia. bears N.84°25'W., 363 1/2 lks. dist.
located in fence row, mkd. 1/4 S 16 BT.

Fd. brass cap, L. Dolan, Sept. 1982, M 93-17

BLM dependent resurvey by Wayne L. Rogers, Bryan S. Seibold,
Cadastral Surveyors & Robert H. Browning, Surveying
Technician, under Group #1755 surveyed June/Oct. 1995 - (DCSO
records Vol. 52 Page(s) 19908) added to report 12/15/2015

The 1/4 sec. cor. of secs. 15 and 16, monumented with an iron
post, 2 1/2" dia., firmly set 24 ins. below ground, with brass
cap (properly) mkd.

from which the remains of BTs by Zirpel, Roseberry, & Corbin
 A triple trunk apple, 14" dia., bears N.30 1/4°E., 56 1/2
 lks., with healed blaze. (Record, N. 31°40'E.)
 A sawed oak stump, 20" dia., bears N.84°25'W., 363 1/2
 lks., with healed blaze.

and new bearing trees
 An oak, 22" dia., bears N.10 1/2°E., 246 lks., mkd 1/4 S15 BT
 An oak, 11" dia., bears S.36 3/4°W., 277 lks., mkd 1/4 S16 BT