

DATE: March 3, 1980

T225 R12W

S11	S12
S14	S13

Condition Report Only
 Not Found
 Renewed
 Unrecorded
 Surveyed In
 Referenced Out

Previous Renewal #'s #40

Monument(s) Found: (Condition and Source) 3/4" by 3/4" I.P.

firmly set and protruding 10" above ground. (from renewal #40)

Accessories Found: (Condition and Source) Original 24" Hemlock

now a badly rotted 14" DBH 10ft tall snag, N 68° E, 28 1/2 ft

(original N 70° E, 28 1/2 ft), no blaze or scribe marks found.

Original 28" Cedar, now 40" down and somewhat

rotted near base, good record bearing and distance to site of uproot, no blaze or scribe marks found.

Original 36" Fir, now a 40" DBH 6ft. tall rotted stump

Page 1 of 1


#198 X

C. S. File No. 6116-6

S68°W, 21³/₄ ft, 19⁸ ft face measurement (record
S68°W 19⁸ ft), evidence of a double blaze, we
open lower blaze and find good BT scribe.

Original 50" Fir, now a 56" PBH 7ft tall stump,
N79°W 40° ft. (record N77°W, 40⁹ ft)

RENEWAL reference out ³/₄" IP and remove
Monument Set: (Procedure and Description) set Standard DCSO
brass cap marked "DOUGLAS COUNTY SURVEYORS OFFICE" in pipe's place
T22S R12W

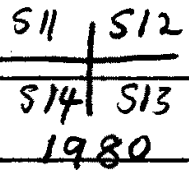

then set 3/4" IP on north side of cap

New Accessories: (Description) The following 4 trees were
marked by Champion International Co. A 14" Spruce
S78°W, 33² ft. scribed T22S R12W S14, BT on a double blaze.
A 38" Hemlock N64°W (Champion tag ^{read} N66°W, we retag to indicate
our measured bearing and distance), 26¹/₂ ft, scribed T22S
R12W S11 on a single blaze. A 24" Alder N18°E, 24¹/₂ ft.
scribed T22S R12W S12 BT on a double blaze. (cont'd below)

Location and Comments: 19° Compass Declination
DCSO Agency
DEP. Myker John Flaws Party Chief **NOTEKEEPER**
DEP. LEMONREAN Notekeeper **WITNESS**
" Witnesses
"
"

OK [Signature]

A 27" Alder S59°E (Champion tag read S54°E we retag),
35¹/₂ ft., scribed T22S R12W S13 BT on a double blaze.
We also tag original BT's except Hemlock with DCSO BT tags

CORNER RESTORATION NOTES for survey of section 13, T.22 S., R.12 W., and section 18, T.22 S., R.11 W., W.M., for Champion International Corporation.

S11	S12
S14	S13

North West Corner of Section 13

Found:

3/4" iron pipe set for corner by Clifford A. Stephens in 1965.

A 50" Fir stump bears N79*00'W, 39.0'

A 40" Fir stump bears S62*30'W, 19.4'

Note; I recommend that the County remonument this corner.

S14	◇	S13
-----	---	-----

West 1/4 of Section 13

Found:

I found a cedar post set by Clifford A. Stephens in 1965

I found one original bearing tree, now a stump

A 40" Fir stump bears N62*00'W, 23.1'

The Hemlock is gone

From the above mentioned bearing tree, I set a 3/4" X 36" galv. iron pipe with brass cap.

A 14" Hemlock bears N35*00'W, 19.4'

A 6" Hemlock bears N50*30'E, 39.6'

I replaced the post set by Stephens with a 4"X4"X6' cedar post. This post bears S72*00'E, 2.2' from my brass cap iron pipe.

S14	S13
S23	S24

South West Section Corner of Section 13

Found:

I found 3/4" copper pipe set as corner by Clifford A. Stephens in 1966

A 14" Alder bears N28*00'E, 22.3'

A 10" Spruce bears N59*00'W, 38.5'

A 18" Alder bears S 5*00'W, 34.2'

C.S. 6116-6

58/139

58/139