

DATE: 5/3/80

T295 RTW

1/4 S18 | S17

Condition Report Only

Not Found

Renewed

Unrecorded

Surveyed In

Referenced Out

Previous Renewal #'s 221

Monument(s) Found: (Condition and Source) 1924 GLO

Brass cap and iron pipe ^{properly marked} ~~as described~~ ^{AS} in 1924
retracement, firmly set and protruding 4 ins
from ground. A 5/8" x 30" iron rod with an
aluminum cap, cap marked "DOUGLAS CO. SURVEYOR"
, firmly set and protruding 3 ins from ground.

Accessories Found: (Condition and Source) Because purpose

of this renewal is to reestablish GLO Brass Cap
at the found position as noted in renewal

221, bearings and distances to accessories are

checked from position of 5/8" iron rod des-
_(same 5/8" iron rod as above)
cribed in renewal 221. Original 30" now 40"

White Oak bears N 81° E, 55 ± ft. (as per renewal 221)

(original record N 77° E, 54 ± ft.) (1924 resurvey record N 81° E 54 ± ft.) Tree is now completely fallen we find no conclusive evidence of original marks. An original 8" non

RENEWAL

Monument Set: (Procedure and Description) _____

New Accessories: (Description) _____

Location and Comments:

19° E
DCSO
M2
JJJ
SM

Compass Declination
Agency
Party Chief
Notekeeper
Witnesses

DATE: 6/3/80

T295 R7W

$\frac{1}{4}$ S 18 / S 17 cont'd

Condition Report Only
 Not Found
 Renewed
 Unrecorded
 Surveyed In
 Referenced Out

Previous Renewal #'s 221

Accessories

Monument(s) Found: (Condition and Source) a 3 1/2" Black Oak

bears S 36 1/2° W, 39 1/2 ft (as per renewal 221)

(original record S 40° W, 37 1/2 ft) (1924 resurvey

record S 66 1/2° W, 37 1/2 ft.) Tree has been opened

but is rotted in center, no original marks found.

1924 Accessories are checked from 5/8" iron rod

(as described above.) A 25" now a 27" Black Oak

bears S 34° E, 44 1/2 ft (as per 1924 record) well

healed blaze no scribing visible. A 5" now a 13"

Accessories Found: (Condition and Source) White Oak bears

S 55° W, 35 1/2 ft (1924 record S 55° W, 36 1/2 ft) partially

healed double blaze from renewal 221 has

scribing "1/4 S 18 CS BT" visible.

1924 GLO Brass cap as described above

bears S 25° E, 4 1/2 ft. (renewal 221 record of

reverse N 23 1/2° W, 4 1/2 ft)

RENEWAL

Monument Set: (Procedure and Description) We reference
out positions of 1924 Brass Cap and renewal
221, 5/8" iron rod, remove monuments and
interchange them. 1924 Brass cap is now firmly
set and protruding 3" from ground at position it was
first found in renewal 221. 5/8" iron rod with aluminum
cap is now firmly set and flush with ground S 25° E


New Accessories: (Description) 4 1/2 ft from position of 1924 Brass Cap,

All bearing trees found above retain same descrip-
tions but bearings and distances refer to

1924 GLO Brass Cap now. New bearing object a 5/8" x 30"
iron rod with an aluminum cap marked "DOUGLAS CO SURVEYOR"
bears N 7 1/2° W, 28 3/4 ft. Iron rod protrudes 6" from ground

Location and Comments:
and is on west
edge of a small
low rock outcrop
measuring approx
24" x 24" x 10"

19° E Compass Declination
PCSO Agency
Deputy Stephen John Fluse Party Chief
Stephen John Fluse Notekeeper
SHAWN MEANS Witnesses

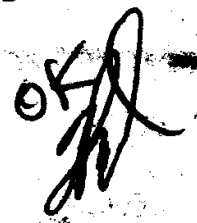

DATE: Sept 29, 1980

T295 R7W

1/4

518 | 517

Condition Report Only
 Not Found
 Renewed
 Unrecorded
 Surveyed In
 Referenced Out

Previous Renewal #'s 221, 263

Monument(s) Found: (Condition and Source) A 5/8" iron rod with aluminum cap and a 1924 GLO Brass cap as described in renewal # 263. The 5/8" iron rod with a P.C.S.O. aluminum cap bears S25°E, 4' Et. from the GLO Brass cap.

Accessories Found: (Condition and Source) Accessories are checked and found to all agree to the record of renewal #263.

NOTE
MADE ON
REN. #263

RENEWAL

Monument Set: (Procedure and Description) We reference
out the position of the 5/8" iron rod with aluminum
cap bearing S25°E, 4 1/2 Ft. from the 1924
GLO Brass cap (as described in renewal #263)
remove and replace it with a 1" x 36" iron pipe
topped by a brass cap. Pipe with B.C. protrudes

~~New Accessories:~~ (Description) 5" from ground and
is firmly set. Cap is marked "DOUGLAS COUNTY SURVEYOR"

T295

1/4

S18 / S17

R7W

1980

Location and Comments:

19°E Compass Declination

DCSO Agency

Deputy Stephen John Flawie Party Chief

Stephen John Flawie Notekeeper

BILL STEWART Witnesses

