


PRIMARY CORNER DESCRIPTION Cor. Secs. 22, 23, 26, & 27

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

BLM Dependent resurvey by Wayne Rogers, Cadastral Surveyor, under Group #1495, surveyed Aug. 1989 - (DCSO records Vol. 50 Page(s) 18913)

The cor. of secs. 22, 23, 26, & 27, monumented with an iron post, 2" diam., firmly set, projecting 4" above ground, with brass cap mkd.

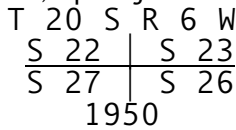

- from which the remains of bearing trees mkd. by Lytle
 - A fir, 38" diam., bears N.60¼°E., 78 lks., with healed blaze.
 - A root hole, bears S.37¼°E., 101 lks., with a down, decayed fir alongside, 30" diam., no marks visible.
 - A fir, 37" diam., bears S.70¼°W., 33 lks., with healed blaze.
 - A fir, 25" diam., bears N.48¾°W., 67 lks., with healed blaze.
 - and a new bearing tree
 - A fir, 6" diam., bears S.32½°E., 30 lks., mkd. X BT.
- The corner is located on top of ridge, bearing N. 30° W. and S.30°E.

BLM dependant resurvey by Daniel Patterson & Craig Wanless, Cadastral Surveyors, Under group #1764 dated Jan. 1995, surveyed Jan./May 1995 - (DCSO records Vol. 52 Pages 19707-8)

The cor. of secs. 22, 23, 26 & 27, monumented with an iron post, 2½" dia., firmly set, projecting 3" above ground, with brass cap (properly) mkd.

- from which the remains of bearing trees mkd. by Lytle
 - A fir, 39" dia., bears N.60¼ E., 78 lks., with healed blaze.
 - A fir, lying on ground, 28" dia., bears S.37¼ E., 101 lks. no marks visible.
 - A fir, 41" dia., bears S.70¼°W., 33 lks., with healed blaze.
 - A fir, 27" dia., bears N.48¾°W., 67 lks., with healed blaze.
- and a new bearing tree
 - A fir, 24" dia., bears S.29¾° E., 56 lks., mkd. T20S R6W S26 BT.

continued next page

TOWNSHIP 20 RANGE 06 POINT IDENTIFIER # 500300

PRIMARY CORNER DESCRIPTION Cor. Secs. 22, 23, 26, & 27

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

Dan Baker - For: Weyerhaeuser Co. - 11/2008 - M158-66

Found - 2½" BLM brass cap "1950"
44" fir, N.61°E., 52.7' - closed face.
26" Fir S.29°E., 36.7' - closed face 1995 BT
44" Fir S.70°W., 21.4' - closed face
27" Fir N.49°W., 43.8' - closed face
5 foot post alongside.

BLM Dependent Resurvey by A Bert Skeesick, Cadastral Surveyor and Robert H Browning, Survey Tech, Under Group No. 2268, Surveyed March/July 2009 - DCSO records Vol. 57 Page 22627

The cor. of secs. 22, 23, 26, and 27, monumented with an iron post, 2" dia., firmly set, projecting 4" above the ground, with brass cap (properly) mkd.

from which the remains of bearing trees mkd. by Lytle
A fir, 44" dia., bears N.60¼°E., 51.5 ft., with a healed blaze.

A roothole bears S.37¼°E., 66.7 ft., alongside of which is a decayed fir trunk, 23" dia., with no marks visible.

A fir, 43" dia., bears S.70¼°W., 21.8 ft., with axe mark visible on the bark.

A fir, 30" dia., bears N.48¾°W., 44.2 ft., with a healed blaze.

and the remains of a bearing tree mkd. by Rogers, not reported by Patterson and Wanless

A roothole bears S.32½°E., 19.8 ft., alongside of which is a fir trunk, 7" dia., with no marks visible.

and a bearing tree mkd. by Patterson and Wanless

A fir, 27" dia., bears S.29¾°E., 37.0 ft., with a healed blaze.

Douglas Co. Surveyors Office - Crew: Stephen Flause & Jeff Lorsung- 3/17/2020 (filed 11/3/2022) - C.S. File 67/54-41

Reported as Fd OK