

PRIMARY CORNER DESCRIPTION Sec. Cor. for 6 & 7; 1 & 12, T21-7

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

GLO survey by Laban H. Wheeler, Under Contract #467 dated April 7, 1883 (DCSO records Vol. 2 Page(s) 552-53)

Set post 6" dia., 4 ft. long, with marked stone, 12" in ground for cor. to secs. 1, 12, 6 and 7, marked T21S S6 on NE.; R6W S7 on SE.; R7W S12 on SW.; S1 on NW. face, with 5 notches on S. and 1 notch on N. edge; from which

A Fir 20" dia., bears N.18°W., 25 lks. dist., mkd. T21S R7W S1 BT.

A Fir 20" dia., bears N.72°E., 46 lks. dist. mkd. T21S R6W S6 BT.

A Fir 20" dia., bears S.43°E., 24 lks. dist. mkd. T21S R6W S7 BT.

A Maple 6" dia., bears S.79°W., 20 lks. dist. mkd. T21S R7W S12 BT.

Wilford N. Haines, #239 - Filed Feb. 17, 1960 - C.S. File 51/67-2

Set 1" x 1" x 36" T. Iron from original BTs.

BLM Resurvey by Dale T. Bedell, Cadastral Surveyor, under Group #1658, Surveyed Aug/Sept. 1992 - (DCSO records Vol. 51 Page(s) 19271)

The cor. of secs. 1, 6, 7 and 12, on the E. bdy. of the Tp., perpetuated and recorded by Haines, Registered Land Surveyor No. 239, in 1960 monumented with a "T" shaped iron rod, 30 ins. long, 1 in. diam., firmly set, extending 12 ins. above the ground, with a brass disk mkd. WILFORD N. HAINES LS 239 DRAIN OREGON, from which the remains of the original bearing trees:

A root hole, bears N. 72° E., 46 lks. dist., with a rotted fir, 28 ins. diam., lying alongside, no remaining marks.

A fir snag, 26 ins. diam., bears S. 43° E., 24 lks. dist., with axe marks on a rotted blaze.

A maple clump, 35 ins. diam., bears S. 79° W., 25 lks. dist. (Record, 20 lks.)

A rotted fir stump, size indeterminate, bears N. 18° W., 25 lks. dist., no remaining marks.

and a bearing tree mkd. by person(s) unknown

A fir, 62 ins. diam., bears S. 75° E., 63 lks. dist., with scribe marks BT visible on the bark.


At the corner point

Set a stainless steel post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

TOWNSHIP 21 RANGE 06 POINT IDENTIFIER # 100600

PRIMARY CORNER DESCRIPTION Sec. Cor. for 6 & 7; 1 & 12, T21-7

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

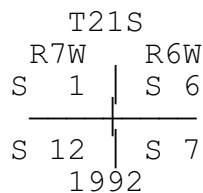

from which new bearing trees

A hemlock, 6 ins. diam., bears N. 55 1/4° E., 67 lks. dist., mkd. T21S R6W S6 BT.

A cedar, 24 ins. diam., bears S. 45 1/2° W., 60 lks. dist., mkd. T21S R7W S12 BT.

A cedar, 17 ins. diam., bears N. 36 1/2° W., 64 lks. dist., mkd. T21S R7W S1 BT.

Deposit the iron rod alongside and white "DEEP-1" magnetic marker at the base of the stainless steel post.

The corner is located on a S. slope, 1 ch. N. of a dry creekbed, 10 lks. wide, draining W.

Kent Inman - For: Seneca Jones Timber Co. 10/2009 - M160-12

Found - BLM Brass cap (properly mkd)

21" Cedar with a partially open face. scribing visible and BLM BT tags. bears N.36 1/2°W., 42.8'

8" Hemlock with a mostly healed face and BLM BT tags bears N.55 1/4°E., 44.3'

62" D.Fir with ax work visible on bark BLM BT tags bears S.85°E. (S.75°E.) 41.4'

The remains of an original bearing tree now a decaying D.Fir snag. size indeterminate, with no visible marks. has a BLM BT tag. bears S.43°E., 15.2' to the side center of the remains of what was a 26" snag in 1992. No nail was set at the side center, see notes.

24" Cedar with a partially open face, scribing visible and BLM BT tags bears S.45 1/2°W., 39.4'

Metal U fence post was placed 1' north of the monument.