

PRIMARY CORNER DESCRIPTION Sec. Cor. for 7 & 18; 12 & 13, T23-6

Alias	_____	Description	_____
Alias	_____	Description	_____
Alias	_____	Description	_____
Alias	_____	Description	_____

Original - Robert Elder and Henry Gile, Deputy Surveyors, under Contract #31 dated April 7, 1853 (DCSO records Vol. 6 Page(s) 2340)

-----

Set post, cor. to secs. 7, 18, 12 and 13, from which

- A Fir 30" dia., bears S.61°E., 37 lks.
- A Fir 15" dia., bears N.33°E., 37 lks.
- A Fir 24" dia., bears N.50°W., 45 lks.
- A Fir 14" dia., bears S.52½°W., 28 lks.

Fd. and used in GLO survey by John McQuinn, Contract #466, dated April 1883 (DCSO records, Vol. 6 Page 2404)

BLM resurvey by Otis Gould, Joseph Gawron, and Orville Eggen, Cadastral Surveyors, under Group #244, surveyed June 1943/October 1957 (DCSO records Vol. 30 Page(s) 12639)

-----

Point for the cor. of secs. 7, 12, 13 and 18, at proportionate distance; there is no remaining evidence of the original corner.

Set an Iron post 3 ft. long, 2" dia., 27" in the ground, with brass cap mkd.

T23S	
R6W	R5W
<u>S12</u>	<u>S 7</u>
S13	S18
1943	

from which

- A Fir 36" dia. bears N.23½°E. 223 lks. mkd. T23S R5W S7 BT
- A Fir 30" dia. bears S.80°E., 25 lks. mkd. T23S R5W S18 BT
- A Fir 12" dia. bears S.42°W., 109 lks. mkd. T23S R6W S13 BT
- A Fir 10" dia. bears N.50°W., 61 lks. mkd. T23S R6W S12 BT

Fd. OK, July 1990, C.S. File 63/104-53  
Fd. OK, Dec. 1993, D. Baker, M 118-43

Daniel Baker - for Weyerhaeuser - 11/28/94 - M 119- 51

-----

Found - 2" I.P. with GLO brass cap dated 1943

- 30" fir, S.37½°W. 70.4 ft. - closed face (rec: S.42°W. 109 lks.) - 1943 GLO
- 24" fir stump, N.46°W. 33.2 ft. - closed face (rec: N.50°W. 61 lks.) - 1943 GLO
- 10" fir, N.18°E. 43.5 ft. - scribing visible (rec: N.18°E. 67 lks.) - 1994 BLM
- 12" fir, S.10°E. 15.2 ft. - scribing visible (rec: S.10°E. 24 lks.) - 1994 BLM
- 6 ft. metal fence post 1 ft. north.


cont next pg

PRIMARY CORNER DESCRIPTION Sec. Cor. for 7 & 18; 12 & 13, T23-6

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

BLM Corrective Dependent Resurvey by Wayne L. Rogers; Boyd W. Peterson; Philip G. Griffin; Dale T. Bedell; Cadastral Surveyors; and Robert H. Browning, Surveying Technician - under Group #'s 1266, 1637 and 1688, - surveyed June 9, 1986/August 22, 1995 - (DCSO records Vol. 51 Pages 19459-60)

The Sec. cor., monumented with an iron post, 2 ins. diam., firmly set, projecting 8" above ground, with brass cap mkd.

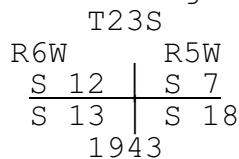

from which the remains of BTs mkd. by Gould, Gawron, & Eggen  
 A roothole, bears N. 23½° E., 223 lks. dist., alongside of which is lying a fir, 40 ins. diam., with healed blaze.  
 A fir, 26 ins. diam., bears S. 38° W., 106 lks. dist., with healed blaze. (Record, S. 42° W., 109 lks.)  
 A sawed fir stump, 23 ins. diam., bears N. 49° W., 50 lks. dist., with healed blaze. (Record, N. 50° W., 61 lks.)  
 and new bearing trees  
 A fir, 13 ins. diam., bears N. 18° E., 67 lks. dist., mkd. T23S R5W S7 BT.  
 A fir, 11 ins. diam., bears S. 10° E., 24 lks. dist., mkd. T23S R5W S18 BT.  
 No suitable tree available in sec. 12.

Fd. & used on BLM corrective and dependent resurvey by Wayne L. Rogers, Cadastral Surveyor & Robert H. Browning, Surveying Technician, under Group #1803 surveyed May/Nov.. 1996 - (DCSO records Vol. 52 Page(s) 19963)

Fd. & used on BLM dependent resurvey by Wayne Rogers & Bryan Seibold, Cadastral Surveyors, under Group #1832 surveyed July - Oct. 1997 - (DCSO recs. Vol. 53 Pg(s) 20282)

DCSO-GIS Corner visitation - 3/6/2006 - Typed: 1/20/2011 - C.S. File 67/33-1

Monument - 2½" BC/IP  
 Comment - ok; 3 live BTs & 1 stump.

FD. BC by D. Baker, 6/2008 - 2008-0043A&B