

PRIMARY CORNER DESCRIPTION Sec Cor for 24 & 25; 19 & 30, T23-4

Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____

GLO survey by - James E. Freeman Deputy Surveyor, under Contract #1, dated May 28, 1851 (DCSO records Vol 6 Pg 2331)


 Set post, cor. secs.19, 24, 25 and 30, from which
 A Fir 12" dia., bears S.23°W., 21 lks. dist.
 A Fir 8" dia., bears N.44½°W., 63 lks. dist.
 A Fir 24" dia., bears S.15°E., 12 lks. dist.
 A Yew 8" dia., bears N.26½°E., 39 lks. dist.

BLM resurvey by C. Albert White and Donald R. Beck, Cadastral Surveyors, under Group #'s 243 and 350 - surveyed April/June 1963 (DCSO records Vol. 32 Page(s) 13270)

 The Sec. cor., determined at record bearing and distance from the remains of the original bearing trees:
 A Yew 12" dia., down and rotted, bears N.26½°E., 39 lks. dist., mkd. with a rotted blaze and old axe marks.
 A Fir stump hole, bears S.15°E., 12 lks. dist.
 A rotted Fir stump 20" dia., bears S.23°W., 21 lks. dist., with no marks remaining.
 A rotted Fir stump 24" dia., bears N.44½°W., 63 lks. dist., mkd. with a rotted blaze.

and an original line tree:
 A Fir 55" dia., bears North, 30 lks. dist., mkd. with two hacks each on N. and S. sides.

At the corner point
 Set an iron post 28" long, 2½" dia., 21" in the ground, with brass cap marked:

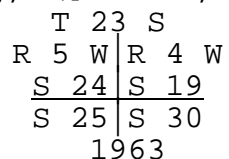

from which new bearing trees:
 A Yew 8" dia., bears N.43¼°E., 54 lks. dist., mkd. T23S R4W S19 BT.
 A Fir 10" dia., bears S.22½°E., 146 lks. dist., mkd. T23S R4W S30 BT.
 A Yew 15" dia., bears S.68°W., 25 lks. dist., mkd. T23S R5W S25 BT.
 A Fir 15" dia., bears S.53°W., 44 lks. dist., mkd. T23S R5W S24 BT.

BLM resurvey by James E. Jelley, under Group #895, surveyed 1976 (DCSO records Vol. 41 Page(s) 16164)

 (Cont. Next Page)

PRIMARY CORNER DESCRIPTION Sec Cor for 24 & 25; 19 & 30, T23-4

Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____
 Alias _____ Description _____

The Sec. Cor., monumented with an iron post, 2½" dia., firmly set, projecting 4" above ground, with 1963 GLO brass cap. from which the remains of the original bearing trees

A root hole bears N.26½°E., 39 lks. dist., with a down Yew alongside, 12" dia., no marks visible on decayed blaze.

A Fir stump 24" dia., bears N.44½°W., 63 lks. dist., no marks visible on decayed blaze.

and the remains of an original line tree

A Fir snag 55" dia., bears North 30 lks. dist., with 2 notches on N. and S. sides.

and bearing trees by White and Beck in 1963

A Yew 9" dia., bears N.43¼°E., 54 lks. with fragmentary scribe marks visible on open blaze.

A G.Fir 12" dia. bears S.22½°E. 146 lks. with healed blaze

A Yew 16" dia., bears S.68°W., 25 lks., with scribe marks T23S R5W S25 BT visible on open blaze.

A G.Fir 18" dia., bears N.53°W., 44 lks. with healed blaze and new bearing trees


A Fir 8" dia. bears N.89°E., 12½ lks. mkd. T23S R4W S19 BT

A Fir 11" dia. bears S.21¼°E., 9 lks. mkd. T23S R4W S30 BT

Found OK by M. Smalley, Nov. 2002 - M137-55

BLM resurvey by A. Bert Skeesick Cadastral Surveyor & Robert H. Browning, Surveying Tech. under Group #2147, surveyed Aug/Nov. 2006 - (DCSO rec. Vol. 55 Page(s) 21406-7)

The cor. of secs. 19, 24, 25, and 30, monumented with an iron post, 2½" dia, firmly set, projecting 9" above the ground, with brass cap mkd.

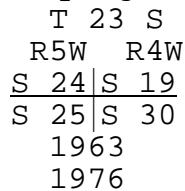

from which the remains of original bearing trees

A roothole bears N.26½°E., 25.7 ft., with fallen yew trunk, 12" dia, lying alongside, with no marks visible.

A decayed fir stump, size indeterminate, bears N.44½°W., 41.6 ft., with no marks visible.

and the remains of an original line tree reported by White and Beck, not utilized as an Angle Point

A decayed fir stump, 55" dia, bears North, 19.8 ft., with no marks visible.

and the remains of bearing trees mkd. by White and Beck

A yew, 11" dia, bears N.43¼°E., 35.6 ft., with fragmentary scribe marks visible on a partially healed blaze. cont.

PRIMARY CORNER DESCRIPTION Sec Cor for 24 & 25; 19 & 30 T23-4

Alias	Description

A yew snag, 16" dia, bears S.68°W., 16.5 ft., with a healed blaze.
and the remains of bearing trees mkd. by White and Beck, reported by Jelley in 1976

A sawed fir stump, 31" dia, bears N.53°W., 29.0 ft., with a healed blaze.
and bearing trees mkd. by Jelley in 1976

A fir, 20" dia, bears N.89°E., 8.3 ft. with a healed blaze

A fir, 22" dia, bears S.21¼°E., 5.9 ft with a healed blaze
and new accessories

An iron rod, 5/8" dia., 30" long, driven 29" in the ground for a reference monument, bears S.43°11'31"W., 10.00 ft., with aluminum cap mkd. RM T23S R5W 10.0 FT TO COR S25 2006, and an arrow pointing to the corner.

An iron rod, 5/8" dia., 30" long, driven 29" in the ground for a reference monument, bears N.44°22'35"W., 7.90 ft. with aluminum cap mkd. RM T23S R5W 7.9 FT TO COR S24 2006, and an arrow pointing to the corner.

The geographic position (NAD 1983 (CORS 96)) of the following corners were determined by a direct tie to a temporary point for which a position had been determined, to an accuracy level of less than 0.050 meters or better, 95% confidence level, relative to the National Spatial Reference System stations "DCSO CORS ARP" and "OBEC CONS COOP CORS ARP", is as follows:

The corner of sections 19, 24, 25, and 30 on the west boundary of the township.

Latitude: 43°32'52.81"N. Longitude: 123°13'38.31"W.