

PRIMARY CORNER DESCRIPTION NW Cor. Section 6 (NW Tsp. Cor)

Alias_____	Description_____
Alias_____	Description_____
Alias_____	Description_____
Alias_____	Description_____

GLO survey by John A. McQuinn, Deputy Surveyor, under Contract #466, dated April 5, 1883 (DCSO records Vol. 7 Page(s) 2878 (and duplicate on pg. 2766)

Set a Cedar post 4 ft. long, 4" sq., 24" in the ground for cor. to Tps. 23 and 24 S., Ranges 1 and 2 W. marked T23S S31 on NE.; R1W S6 on SE.; R2W S1 on SW.; and R2W S36 on NW. faces, with 6 notches on each edge, from which

- A Hemlock 6" dia., bears N.41°E., 9 lks. dist. mkd. T23S R1W S31 BT.
- A Red Fir 36" dia., bears S.58°E., 32 lks. dist. mkd. T24S R1W S6 BT.
- A Hemlock 30" dia., S.38°W., 30 lks. mkd. T24S R2W S1 BT.
- A W.Fir 30" dia., N.68°W., 33 lks. mkd. T23S R2W S36 BT.

GLO Survey by Henry L. Chandler, U.S. Deputy Surveyor, under Contract #619, dated June 5, 1893 - (DCSO records Vol. 5 Page(s) 2129)


Found old post decayed, Set new post 4 ft. long, 4" sq., 24" in the ground, (mkd. same as above and used same BTs)

BLM Resurvey by William W. Glenn and Harvey E. Wofford, Cadastral Surveyors, under Group #345, Surveyed Sept. 1964/July 1966 - (DCSO records Vol. 35 Page(s) 14304-05)

The Tps. corner, determined at record distance from the faces of the remaining original bearing trees:

- A Fir 50" dia., bears S.48°E., 35 lks. dist., with healed blaze. (Rec. S.58°E., and dist. to face, 32 lks.)
- A Hemlock 44" dia., bears S.38°W., 33 lks. dist. with scribe marks 2 B visible on partially healed blaze. (Rec. and dist. to face, 30 lks.)
- A W.Fir 38" dia., bears N.68°W., 36 lks. dist., with scribe marks S30 T23 R2 BT visible on open blaze. (Rec. and dist. to face, 33 lks.)

At the corner point
Set an iron post, 28" long, 2 1/2" dia., 23" in the ground, with brass cap mkd:

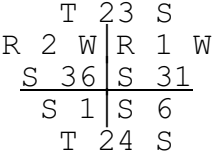

from which
1964
A W.Fir 17" dia., bears N.33½°E., 46 lks. dist. mkd. T23S R1W S31 BT.

(Cont. Next Page)

TOWNSHIP 24 RANGE 01 POINT IDENTIFIER # 100700

PRIMARY CORNER DESCRIPTION NW. Cor. Section 6 (NW. Tsp. Cor)

Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____
Alias _____ Description _____

Fd. OK, March 1973 by Nick Juliano - C.S. File 58/24

Glen McChesney - For: Weyerhaeuser Co. - March 10, 1978 -
C.S. File 58/8-5 (filed Dec. 1980)

Found - 1964 GLO brass cap, not disturbed by adjacent timber
felling.

Orig. 50" Fir stump, S.48°E., 22.0 ft. to face, 24.0
ft. center measurement; no scribing found.

36" Hemlock S.38°W., 18.0 ft. to face, 19.3 ft. to
center.

32" W.Fir snag, N.66°W., 20.8 ft. to face, 21.9 ft.
center measurement; scribing extremely fine, on
round surface of tree, not on a flat face.

18" W.Fir N.34°E., 30.7 ft. center measurement;
scribing visible.

Accessories added:

64" Fir N.8°W., 61.3 ft.

48" Fir stump S.48°E., 21.1 ft. (Orig. BT)

Brgs. & dists. are to "W" nails driven into base of reference
trees; Weyerhaeuser plates on trees.