


Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

Original - Addison R. Flint, Contract #56 dated March, 1855 (DCSO Records, Volume 9 Page 3663)

-
- Set post cor. to secs. 3, 4, 33 and 34, from which
- A Red Fir 12" dia., bears N.85°W., 15 lks. dist.
 - A Red Fir 18" dia., bears S.28°W., 6 lks. dist.
 - A Maple 5" dia., bears S.5°E., 18 lks. dist.
 - A Maple 6" dia., bears N.45°E., 15 lks. dist.

GLO Dependent Resurvey by Norman D. Price, Under Special Instructions dated April 5, 1940 (DCSO records, Volume 27 Pages 11504-05)

The original corner of secs. 3, 4, 33, and 34, a badly decayed yew stake, 3½ ft. long, 4" square, on which only ax marks remain. At point for corner:
Set an iron post, 3 ft. long 2" dia., 28" in the ground, with the remains of decayed stake deposited at the base, for cor. of secs. 3, 4, 33, and 34, with brass cap marked:

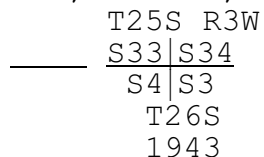

- from which
- A Maple, 12" dia., bears N.57°E., 18 lks. dist. with old blaze decayed. (Old BT)
 - A badly decayed Fir stump, 28" dia., bears S.18°W., 6 lks. dist., on which no marks were found. (Old BT)
 - A Fir stub 32" dia., bears N.20°W., 15 lks. dist., on which only ax marks remain. (Old BT)
 - A Fir 42" dia., bears N.30½°E., 105 lks. dist., mkd. T25S R3W S34 BT. (New BT)
 - A Red Cedar 12" dia., bears S.56½°E., 87 lks. dist., mkd. T26S R3W S3 BT. (New BT)
 - A Red Cedar 14" dia., bears S.14¾°W., 90 lks. dist., mkd. T26S R3W S4 BT. (New BT)
 - A Red Cedar 20" dia., bears N.74°W., 60 lks. dist., mkd. T25S R3W S33 BT. (New BT)

Douglas Co. Surveyors Office - Vernon Tracy; M.D & J.B. May, 14, 1965 - C.S. File 54/7-36

Found - 1943 GLO brass cap.
20" now 28" R.Cedar N.74½°W., 39.6 ft. shows scribe.
This BT down.
continued next page

TOWNSHIP 25 RANGE 03 POINT IDENTIFIER # 400100

PRIMARY CORNER DESCRIPTION Sec. Cor. 33 & 34; & 4 & 3 of T.26-3

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

<p>12" now 13" R.Cedar S.56½°E., 57.4 ft. down & shows scribe. Other BTs are stumps cut off below scribe. New BTs- 16" R.Cedar S.86°W., 64.9 ft. mkd. T26SR3WS4 CS BT. 25" R.Cedar N.4°W., 95.5 ft. mkd. T25SR3WS33 CS BT. 13" R.Cedar S.6°E., 77.4 ft. mkd. T26S R3W S3 CS BT. 11" R.Cedar N.34°E., 38.7 ft. mkd. T25SR3WS34 CS BT.</p>
<p>Fd. Ok. - Herman Pieske - Jan. 21, 1994 - M118-33</p>
<p>Douglas Co. Surveyors Office - Stephen J. Flause - John Pike - 11/7/2007 - C.S. File 67/24-45 ----- Found ok, 4 live BTs Note: Fence corner with fences extending South & West bears N.87°W., 10.5 ft.</p>
<p>BLM Dependent resurvey by A. Bert Skeesick & Kenneth W. Saveland, Cadastral Surveyors and Robert H. Browning, Survey Tech, under Group No. 2212 surveyed July/Oct. 2008 - (DCSO records Vol. 57 Page(s) 22416) ----- The cor. of secs. 3, 4, 33, and 34, on the S. bdy. of the Tp., perpetuated by the Douglas County Surveyor's Office in 1965, monumented with an iron post, 2" dia., firmly set, projecting 6" above ground, with brass cap (properly) mkd. from which the remains of bearing trees mkd. by Price A sawed, decayed fir stump, 38" dia., bears N.28°E., 73.6 ft., with no marks visible. (Record, N.30½°E., 69.3 ft) A roothole bears S.56½°E., 57.4 ft., alongside of which is a down, decayed, cedar snag, 14" dia., with no marks visible. A decayed cedar stump, 15" dia., bears S.14¾°W., 59.4 ft., with no marks visible. A roothole bears N.74½°W., 39.6 ft., alongside of which is an uprooted, sawed, decayed cedar stump, 36" dia., with scribe marks S R3W S33 BT visible on an open blaze. and BTs mkd. by the Douglas County Surveyor's Office A cedar, 31" dia. bears N.34¾°E. 38.8 ft with healed blaze A cedar, 19" dia. bears S.65½°E. 77.0 ft with healed blaze A cedar, 27" dia. bears S.85½°W. 64.5 ft with healed blaze A cedar, 33" dia. bears N.4½°W., 97.1 ft with healed blaze Corner is located on an E. slope, E., approximately 10 ft. from the cor. of woven and barbed-wire fence lines extending S. and W.</p>
<p style="text-align: right;">2</p>