

PRIMARY CORNER DESCRIPTION Eastern terminus point, Sec. 34

Alias _____	Description <u>Also, Sec. Cor. 2 & 3, T28-8</u>
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

GLO survey by Dennis Hathorn, Deputy Surveyor under Contract #57, dated April 12, 1855 - (DCSO records Vol. 14 Page(s) 5783)


 Set post cor. secs. 2 and 3, from which
 A Hemlock 12" dia., bears S.80°E., 20 lks.
 A Hemlock 8" dia., bears S.45°W., 23 lks.

BLM Resurvey by C. Albert White; John M. Jelley; James E. Jelley, Cadastral Surveyors, Under group #466, Surveyed Sept/Oct. 1961 - (DCSO records Vol. 30 Page(s) 12859)

 The standard corner of secs. 2 and 3, determined at record bearing and distance from the remaining original bearing tree:

A Hemlock 20" dia., fallen and rotted, bears S.45°W., 23 lks. dist., mkd. with a reversed B, on opened blaze. This corner now becomes also the eastern terminus and corner of sec. 34, T27½S R8W.

At the corner point
 Set an iron post, 28" long, 2 1/2" dia., 24" in the ground, with brass cap mkd: A P

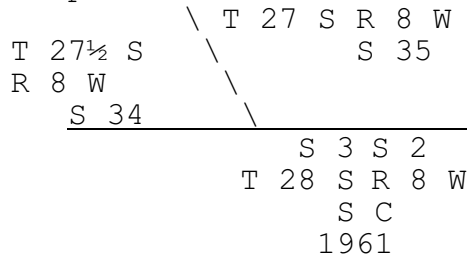

from which new bearing trees:

A Cedar 28" dia., bears S.15°E., 75 lks. dist. mkd. T28S R8W S2 SC BT.

A Fir 25" dia., bears S.84¼°W., 23 lks. dist., mkd. T28S R8W S3 SC BT and cruiser marks in the bark.

A Hemlock 10" dia., bears N.88°W., 114 lks. dist., mkd. T27½S R8W S34 BT.

A Hemlock 10" dia., bears N.11¼°W., 26 lks. dist., mkd. T27S R8W S35 AP BT.

The corner is located 55 lks. N. of a creek, 5 lks. wide, course S.85°E.