

PRIMARY CORNER DESCRIPTION Sec. Cor. for 34 & 35; 2 & 3, T30-6

Alias	_____	Description	_____
Alias	_____	Description	_____
Alias	_____	Description	_____
Alias	_____	Description	_____

Original - Nathaniel Ford, under Contract #44 dated May 30, 1854 (DCSO records, Vol. 15 Page 6458)

Set a post, at proper dist., cor. of secs. 2, 3, 34 and 35, from which

- A Laurel 10" dia., bears S.25°W., 30 lks.
- A Laurel 12" dia., bears S.35°E., 10 lks.
- A laurel 13" dia., bears N.43°E., 65 lks.
- A Laurel 15" dia., bears N.75°W., 70 lks.

Doug. County Surveyors Office - James Byron, Deputy - For: Dale Weekly - May 15, 1956 - C.S. File 47/93

Location of corner determined by facing old BTs found but not of record.

Set an I.P. with brass cap mkd: County Surveyors Office Sec. Cor $\frac{34|35}{3|2}$ T29S R6W 1956 T30S

From which;

- 30" R.Fir bears S.10°E., 33 ft. bark scribed "T30S R6W S2 CS BT".
- 6" R.Fir bears N.32°E., 56 ft. scribed "T29S R6W S35 CS BT".

BLM resurvey by Thielsen and White, under Group #'s 348 & 350. Surveyed July 1958/Aug. 1959 (DCSO records, Vol. 30 Page 12841)

The sec. cor. has been perpetuated with an I.P. 1" dia., 12" above ground, firmly set, with DCSO brass cap. Records show that this cor. was monumented by James Byron in 1956, from old bearing trees not of record. The monument is accepted as the best available evidence of the original corner position.
At the Corner Point

Set an iron post, 28 ins. long, 2½ ins. diam., 20 ins. in the ground, with brass cap mkd:

T 29 S R 6 W
S 34 | S 35
S 3 | S 2
T 30 S R 6 W

from which trees marked by Byron in 1956:

- A Fir 6" dia. bears N.32¼°E., 84 lks. dist., mkd. T29S R6W S35 CS BT.
- A Fir 30" dia., bears S.10 3/4°E., 52 lks. dist., mkd. T30S R6W S2 CS BT.

and new bearing trees:

(Cont. Next Page)

PRIMARY CORNER DESCRIPTION Sec. Cor. for 34 & 35; & 2 & 3, T30-6

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

A Cedar 36" dia., bears S 25 3/4°W., 53 lks. dist., mkd.
T30S R6W S3 BT.

A Fir 33" dia., bears N.60½°W., 72 lks. dist., mkd. T29S
R6W S34 BT.


Bury the County Surveyor's monument alongside the iron post.

Text from correspondance from Howard Johnstone, Feb. 22, 1978
C.S. File 47/93

"The corner renewal records show that Jim Byron, Deputy County Surveyor, set I.P.B.C. at (this corner) from old bearing trees, not of record, in 1956, and that the cadastral surveyor set their brass cap alongside the county brass cap, also referring to the old bearing trees, not of record, in 958. We have also found these old fir bearing trees at (section corner) opened up the faces and found excellent scribe marks. We also counted the growth rings since the trees were scribe(sic) and determined that the trees were scribe(sic) about 120 years ago which would be about 1855. This was the year that the cadastral surveyor, Nathaniel Ford, surveyed these section lines. Based on this evidence, it is my opinion that these bearing trees are the original bearing trees for the section corner, even though the records for (corner) indicate different bearings, distances, and species. I feel that the original corner record data was transposed with some other corners when it was copied into the official notes of record and that the brass cap monument currently set (is) as close to the location of the original corner post as can possibly be determined by the intersection of lines projected out from the faces of these original bearing trees."

BLM Resurvey by Dale T. Bedell, Cadastral Surveyor, under Group #1551, Surveyed Aug/ 1990/July 1991 - (DCSO records Vol. 50 Page(s) 19209)

The cor. of secs. 2, 3, 34, and 35 on the N. bdy. of the Tp., monumented with an iron post, 2½ ins. diam., firmly set, projecting 6 ins. above ground, with brass cap mkd.

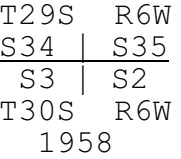

from which the remains of bearing trees mkd. by James W. Byron, in 1956
(Cont. Next Page)

TOWNSHIP 29 RANGE 06 POINT IDENTIFIER # 500100

PRIMARY CORNER DESCRIPTION Sec. Cor. for 34 & 35; & 2, 3, T30-6

Alias	Description
_____	_____
Alias	Description
_____	_____
Alias	Description
_____	_____
Alias	Description
_____	_____

A fir stump, 10 ins. diam., bears N. 32° E., 85 lks. dist., no visible marks. (Record, N. 32¼° E., 84 lks.)
A fir, 34 ins. diam., bears S. 10½° E., 42 lks. dist., with healed blaze. (Record, S. 10 3/4° E., 52 lks.)
and the remains of bearing trees mkd. by Thielsen and White
A root hole, bears S. 25 3/4° W., 53 lks. dist., with a down cedar alongside, 27 ins. diam., no visible marks.
A fir stump, 37 ins. diam., bears N. 60½° W., 72 lks. dist., with healed blaze.
and new bearing trees
A fir, 10 ins. diam., bears N. 54° E., 85 lks. dist., mkd. T29S R6W S35 BT.
A fir, 12 ins. diam., bears S. 79½° W., 33 lks. dist., mkd. T30S R6W S3 BT.
A fir, 15 ins. diam., bears N. 80° W., 39 lks. dist., mkd. T29S R6W S34 BT.

Found OK by K. DeGroot, June 2003 - M142-44

DCSO-GIS Corner visitation - 3/3/2004 - Typed: 2/9/2011 - C.S. File 67/33-1

Monument - 1.25" IP/BC
Comment - GLO cap not vis