

PRIMARY CORNER DESCRIPTION Sec. Cor. for 19 & 30; 24 & 25, T31-9

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

GLO survey by W.H. Byars, Deputy Surveyor under contract # 456 dated July 28, 1882 (DCSO records Vol. 19 Page(s) 8105)

Set a stone 12x10x10 ins., marked with 2 notches on the S. and 4 notches on the N. angles of same, for the cor. to secs. 19, 24, 25 and 30, from which

- A Live Oak 6" dia., bears N.66°E., 51 lks. dist. mkd. T31S R8W S19 BT.
- A Laurel 10" dia., bears S.62°E., 47 lks. dist. mkd. T31S R8W S30 BT.
- A Fir 22" dia., bears S.32°W., 51 lks. dist. mkd. T31S R9W S25 BT.
- A Live Oak 6" dia., bears N.14°W., 23 lks. dist. mkd. T31S R9W S24 BT.

GLO survey by Wm. H. Byars, Deputy Surveyor, under Contract #727, dated Dec. 20, 1900 - (DCSO records Vol. 19 Page(s) 8240)


Corner destroyed. Witness trees standing. Set a stone 14x12x8 ins. at the established point for the same, as taken from the witness trees. Marked the stone with 2 notches on S. and 4 notches on N. and set 10" in the ground.

BLM Resurvey by C. Albert White, Harold D. Corbing Cadastral Surveyor and Donald R. Beck, Surveying Technician, Under Group #446, Surveyed Nov. 1960/Sept. 1962 - (DCSO records Vol. 31 Page(s) 13183)

The Sec. Cor., perpetuated with an iron pipe 1½" dia., protruding 6" above the ground, firmly set, from which the remaining original bearing trees:

- A Live Oak 6" dia., bears N.66°E., 46 lks. dist., 51 lks. dist. on slope, no marks visible on opened blaze. (Rec. dist. 51 lks.)
- A Fir 42" dia., bears S.28½°W., 48 lks. dist., 51 lks. dist. on slope, mkd. with cruiser marks, no other marks visible. Remarkd T31S R9W S25 BT. (Rec. S.32°W., 51 lks.)

At the corner point
Set an iron post, 28" long, 2 1/2" dia., 22" in the ground, with brass cap mkd:

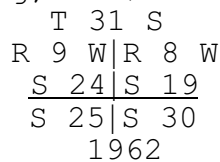

from which new bearing trees:
(Cont. Next Page)

TOWNSHIP 31 RANGE 08 POINT IDENTIFIER # 100300

PRIMARY CORNER DESCRIPTION Sec. Cor. for 19 & 30; 24 & 25, T31-9

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

A Fir 30" dia., bears N.53°E., 82 lks. dist. mkd. T31S R8W
S19 BT.

A Fir 35" dia., bears S.55°E., 83 lks. dist. mkd. T31S R8W
S30 BT.

A Fir 12" dia., bears N.71½°W., 75 lks. dist. mkd. T31S
R9W S24 BT.

Deposit iron pipe alongside iron post.

Fd. OK by D. Edwards, April 2004 - M144-32