

PRIMARY CORNER DESCRIPTION Sec. Cor. for 8, 9, 16 and 17

Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____
Alias _____	Description _____

GLO survey by W.H. Byars, under contract # 431 survey dated March 29, 1882 (DCSO records Vol. 21 Page(s) 9014)

-----  
Set a Fir post, 4 ft. long, 4" sq., 20" in the ground, marked T33S R6W S9 on NE. face; S16 on SE. face; S17 on SW. face; and S8 on NW. face, for the cor. to secs. 8, 9, 16 and 17, from which


- An Oak 24" dia., bears N.50°E., 124 lks. dist. marked T33S R6W S9 BT.
- An Oak 15" dia., bears S.43°E., 97 lks. dist. marked T33S R6W S16 BT.
- A Fir 50" dia., bears S.60°W., 110 lks. dist. marked T33S R6W S17 BT.
- A Fir 40" dia., bears N.15°W., 26 lks. dist. marked T33S R6W S8 BT.

Douglas Co. Surveyors Office - John M. Powell, Frank Jones, Joe Brady, crew - Sept/Oct. 1967 - C.S. File 54/53-29

- 
- Found - Orig. 15" W.Oak now rotten stump, down, S.43°E., 64.0 ft., reverse scribe found "S 3" and other marks.
- Orig. 50" D.Fir, now down burnt, S.60°W., 72.6 ft., scribe found "BT"
  - Orig. 24" W.Oak, burnt out, N.55°E., 81.8 ft. (Rec. N.50°E.), no scribing.
  - Orig. 40" Fir, now hole, N.15°W., 17.2 ft.

It seems all dists. are sloped and by using 3 bearings and 4 slope distances:

Set Brass cap at cor. mkd: County Surveyors Office

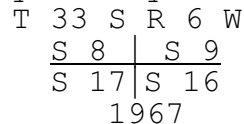

- New BTs -11" D.Fir N.30°E., 16.1 ft. mkd. T33S R6W S9 CS BT
- 16" D.Fir S.3°E., 32.8 ft. mkd. T33S R6W S16 CS BT.
- 19" D.Fir S.23°W., 17.6 ft. mkd. T33S R6W S17 CS BT.
- 10" Laurel N.60°W., 15.0 ft. mkd. T33S R6W S8 CS BT.