

# County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey, Portion of Bdrs. of  
Donation Land Claim No. 39, T. 21 S., R 12 W.,  
Willamette Meridian, Oregon


17212

**CHAINS**

A decayed spruce stump, 15 ins. diam., bears  
N. 59° E., 54 lks. dist., no marks visible.

At the corner point

Set an aluminum post, 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, directly over the iron rod, with aluminum cap mkd.

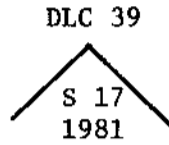

from which new bearing trees

A spruce, 16 ins. diam., bears N. 3° E., 53 1/2 lks.  
dist., mkd. DLC 39 BT.

A spruce, 30 ins. diam., bears S. 5 1/4° W., 31 lks.  
dist., mkd. S17 DLC 39 BT.

S. 67° 45' W., beginning new measurement.

Ascend slightly over N. slope, through heavy timber and light undergrowth.

- 1.20      Spur ridge, slopes N.; desc. 105 ft. over broken W. slope, changing to SW. slope.
- 10.25     Draw, drains N. 30° W.; asc. 15 ft. over NE. slope.
- 11.40     Top of ascent, slopes NW.; desc. 45 ft. over SW. slope.
- 13.20     Creek, 1 lk. wide, course N. 30° W.; asc. 35 ft. over NE. slope.
- 14.55     Top of ascent, slopes NW.; desc. 40 ft. over W. slope.
- 16.25     Creek, 1 lk. wide, course N. 25° E.; asc. 45 ft. over E. slope.
- 18.525    Intersect the E. and W. center line of sec. 17.
- Point for the crossing closing cor. on the E. and W. center line of sec. 17, with the S. bdy. of Donation Land Claim No. 39, hereinafter described.
- From this point, the center W 1/16 sec. cor. of sec. 17, bears S. 89° 17' E., 8.075 chs. dist., hereinafter described.
- Ascend 100 ft. over E. slope.
- 23.70     Top of ascent, slopes N.; desc. 130 ft. over broken NW. slope.
- 29.35     Bottom of descent, slopes N. 10° W.; asc. 55 ft. over broken N. slope.
- 32.285    Intersect the line bet. secs. 17 and 18.
- The crossing closing cor. on the S. bdy. of Donation Land Claim No. 39, with the line bet. secs. 17 and 18, hereinbefore described.