

County Surveyor's Record, Douglas County, Oregon

14909

Dependent Resurvey, Portion of Bdys., Claim No. 38,
T. 22 S., R. 9 W., Willamette Meridian, Oregon

CHAINS

An alder, 8 ins. diam., bears N. 52 1/2° W., 20 lks. dist., mkd. T22S R9W S18 BT.


From this point, the NE. cor. of Donation Land Claim No. 37 bears N. 70° 29' E., 22.68 chs. distant, perpetuated by persons unknown monumented with a steel bar, 1/2 in. diam., firmly set, with the top 8 ins. below surface of the ground, with an iron pipe, 3/4 in. diam., firmly set, projecting 6 ins. above ground, alongside. This position has long been recognized by owners of the adjacent lands as the cor., and is accepted as the best available evidence of the original corner position.

from which a bearing tree mkd. by persons unknown

A decayed myrtle stump, size indeterminate, bears S. 9 3/4° W., 13 lks. dist., with fragmentary scribe marks visible on decayed blaze.

At the corner point

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd.

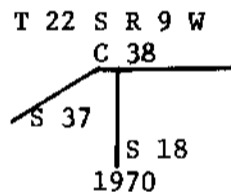

from which a new bearing tree

A myrtle, 22 ins. diam., bears N. 13° W., 41 lks. dist., mkd. C 38 BT.

Deposit broken green glass at base of and reset steel bar and iron pipe inside the iron post.


From the same point, the NW. cor. of Claim N. 37 bears S. 70° 29' W., 60.74 chs. distant, perpetuated and recorded by the County Surveyor, in 1936, monumented with a steel bar, 1/2 in. diam., firmly set, projecting 12 ins. above ground, from which bearing trees mkd. by the County Surveyor:

A maple, 25 ins. diam., bears S. 76° E., 40 lks. dist., with partial scribe marks visible on open healed blaze.

A root hole, bears N. 81° W., 54 lks. dist., with a down myrtle alongside, 36 ins. diam., with no marks visible.

At the corner point

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd.

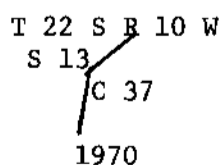

from which a new bearing tree