

County Surveyor's Record, Douglas County, Oregon

Resurvey of East Bdy., T. 32 S., R. 9 W.

CHAINS

A Cedar, 18 ins. diam., bears N.5*E., 58 lks. dist., marked T 32 S R 8 W S 6 B T (Old B T)
A Fir, 10 ins. diam., bears S.69*E., 47 lks. dist., marked T 32 S R 8 W S 7 B T (Old B T)


Thence

N.0*09'W., continuing my measurements

64.70 Creek, 3 lks. wide, course W., ascend.

76.00 Ravine, course W., continue ascent.

80.00 Set an iron post, 3 ft. long, 2 ins. diam., 24 ins. in the ground for cor. of Secs. 1 and 12, with brass cap marked

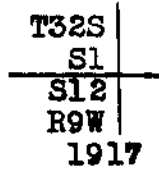

from which

A Fir, 60 ins. diam., bears S.50*W., 56 lks. dist., marked T 32 S R 9 W S 12 B T.

A Sugar Pine, 48 ins. diam., bears N.87*W., 94 lks. dist., marked T 32 S R 9 W S 1 B T.

Land, mountainous.

Soil, rocky, 4th rate.

Timber, Fir, Sugar Pine and Cedar.

Undergrowth, Tan Oak, Live Oak, Hazel and Chinquapin.

N.0*09'W., resurveying E.bdy. of Sec. 1.

Ascend SW slope, through heavy timber and dense undergrowth.

2.00 Top of spur, slopes W., descend.

19.50 Creek, 3 lks. wide, course NW.

23.46 Intersect the old 1/4 sec. cor., which is a basalt stone, 14x12x10 ins. loosely set, marked and witnessed as described by the surveyor general, with the exception, that the NE bearing tree is a Tan Oak instead of a Live Oak. I change this cor. to refer to Sec. 6 only,