

County Surveyor's Record, Douglas County, Oregon

Township 27 South, Range 3 East.

Subdivision.

CHAINS

Timber, fir, pine, hemlock and larch.
Undergrowth, rhodendron, vine maple, hazel, small fir, pine, and hemlock.


N.0°01'W., bet. secs. 25 and 26.

Descend 170 ft. over NE. slope, through heavy timber and medium undergrowth.

22.70 Trail, bears NE. and SW. and spur, bears NE., descend 360 ft. over NW. slope to $\frac{1}{4}$ sec. cor.

30.00 Enter dense undergrowth.

40.00 Set an iron post, 3 ft. long 1 in. in dia., 12 ins. in the ground, to bed rock, and build a mound of stone, 40 ins. base, 15 ins. high, around the post, for $\frac{1}{4}$ sec. cor., with brass cap marked.

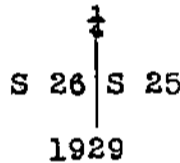


from which,

A fir, 11 ins. in dia., bears S.89°E., 10 lks. dist., marked $\frac{1}{4}$ S 25 B T

A pine, 8 ins. in dia., bears N.77°W., 3 lks. dist., marked $\frac{1}{4}$ S 26 B T

Descend 960 ft. over NW. slope to

80.00 Set an iron post, 3 ft. long, 2 ins. in dia., 26 ins. in the ground, for cor. of secs. 23, 24, 25 and 26, with brass cap marked.

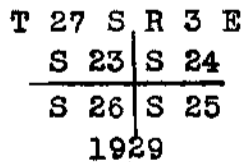

from which,

A fir, 8 ins. in dia., bears N.10°E., 52 lks. dist., marked T 27 S R 3 E S 24 B T