

County Surveyor's Record, Douglas County, Oregon

Township 30 South, Range 3 East.
East Boundary.


CHAINS

North, bet. secs. 13 and 18.

Over rolling land, through 2nd growth timber and medium undergrowth.

6.06 Diamond Lake Road; bears NE. and SW.

40.00 Set an iron post, 3 ft. long, 1 in. dia., 28 ins. in the ground, for $\frac{1}{4}$ sec. cor., with brass cap mkd.

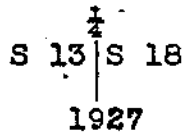


from which

A larch, 6 ins. dia., bears N.58*E., 36 lks. dist., mkd. $\frac{1}{4}$ S 18 B T.

A white fir, 8 ins. dia., bears N.48*W., 21 lks. dist., mkd. $\frac{1}{4}$ S 13 B T.

Desc. 70 ft. over rolling NW. slope to

80.00 Set an iron post, 3 ft. long, 2 ins. dia., 30 ins. in the ground, for cor. of secs. 7, 12, 13, and 18, with brass cap mkd.

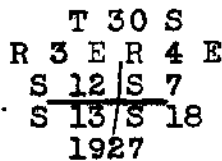

from which

A hemlock, 20 ins. dia., bears N.60*E., 31 lks. dist., mkd. T 30 S R 4 E S 7 B T.

A hemlock, 16 ins. dia., bears S.11*E., 67 lks. dist., mkd. T 30 S R 4 E S 18 B T.

A fir, 48 ins. dia., bears S.40*W., 26 lks. dist., mkd. T 30 S R 3 E S 13 B T.

A hemlock, 11 ins dia., bears N.72*W., 16 lks. dist., mkd. T 30 S R 3 E S 12 B T.

Land, rolling.

Soil, sandy and gravelly, 2nd rate.

Timber, pine, fir, hemlock, and larch.

Undergrowth, snow brush, hazel, small pine and fir.