

Dependent Resurvey of the Sub. of T. 25 S., R. 3 W.

CHAINS

Soil, sandy loam and rocky clay; 1st, 2d and 3d rate.  
 Timber, madrona, fir, hemlock, pine, cedar, yew, alder,  
 maple, chinquapin, dogwood, and oak.  
 Undergrowth, vinemaple, salal, rhododendron, bracken,  
 willow, arrowwood, salmonberry, hazel, syringa, lilac,  
 manzanita, slickleaf, poison oak, and huckleberry.

N. 19° 39' W., bet. secs. 25 and 26.


Desc. 2 ft. over broken NE. slope, through heavy timber  
 and dense undergrowth.

7.80 A branch, 10 lks. wide, course E.; asc. 232 ft. over SE.  
 slope, changing to E. slope.

33.46 Point for original  $\frac{1}{4}$  sec. cor., determined by reference to  
 the record measurements from both old bearing trees.

At point for corner,

Set an iron post, 3 ft. long, 1 in. diam., 28 ins. in the  
 ground, for  $\frac{1}{4}$  sec. cor., with brass cap mkd.

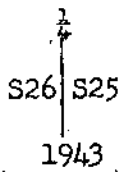

from which

A red cedar, 20 ins. diam., bears N. 37  $\frac{3}{4}$ ° E., 60 lks.  
 dist., on which I uncovered the scribe marks  $\frac{1}{4}$  S B T  
 beneath 60 years overgrowth. (Old B.T.)

A fir, 30 ins. diam., bears N. 75° W., 9 lks. dist.,  
 with blaze healed. (Old B.T.)

A fir, 14 ins. diam., bears N. 42° E., 50 lks.  
 dist., mkd.  $\frac{1}{4}$  S 25 B T. (New B.T.)

Thence

N. 1° 23' E., with new measurement.

Desc. 35 ft. over E. slope, changing to NE. slope.

4.40 A branch, 4 lks. wide, course SE.; asc. 273 ft. over SW.  
 slope, changing to SE. slope.

29.70 A spur, slopes E.; desc. 86 ft. over NE. slope.

33.10 A branch, 6 lks. wide, course E.; asc. 61 ft. over SE.  
 slope.

38.70 A spur, slopes SE.; desc. 12 ft. over NE. slope.

39.85 A branch, 1 lk. wide, course SE.; asc. 27 ft. over SE.  
 slope.

43.10 A flat topped spur, slopes S. 60° E.; desc. 5 ft. over  
 NE. slope.

45.10 The original cor. of secs. 23, 24, 25, and 26, the badly  
 decayed point of a squared wooden stake on which no  
 marks remain.