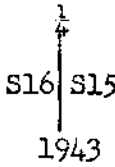


11570 County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of the Sub. of T. 25 S., R. 3 W.

CHAINS	
31.70	A branch, 3 lks. wide, course N.; asc. 71 ft. over NE. slope.
41.50	Top of ascent on N. slope; desc. 9 ft. over NW. slope.
43.52	The cor. of secs. 15, 16, 21, and 22.
	Land, mountainous. Soil, sandy loam and rocky clay; 2d and 3d rate. Timber, fir, hemlock, cedar, alder, maple, chinquapin, yew, dogwood, and pine. Undergrowth, vinemaple, salal, bracken, willow, hazel, arrowwood, manzanita, slickleaf, and salmonberry.
	N. 8° 12' E., bet. secs. 15 and 16.
	Desc. 398 ft. over broken NW. slope, through heavy timber and dense undergrowth.
7.40	A spring branch, 4 lks. wide, course NW.
17.40	A branch, 2 lks. wide, course NW.
22.90	A branch, 2 lks. wide, course NW.; asc. 16 ft. over SW. slope.
29.00	Top of ascent on W. slope; desc. 91 ft. over NW. slope, changing to N. slope.
38.07	Point for original $\frac{1}{4}$ sec. cor., determined by reference to the record measurements from both original bearing trees.
	AT point for corner, Set an iron post, 3 ft. long, 1 in. diam., 28 ins. in the ground, for $\frac{1}{4}$ sec. cor., with brass cap mkd.
	
	from which
	A sawed fir stump, 40 ins. diam., bears N.56°E., 16 lks. dist., on which no marks remain. (Old B.T.)
	A hemlock stub, 5 ins. diam., bears N.59°W., 9 lks. dist., mkd. $\frac{1}{4}$ S B T. (Old B.T.)
	A fir, 30 ins. diam., bears N.60°E., 48 lks. dist., mkd. $\frac{1}{4}$ S 15 B T. (New B.T.)
	A red cedar, 28 ins. diam., bears N.25 $\frac{1}{4}$ °W., 67 lks. dist., mkd. $\frac{1}{4}$ S 16 B T. (New B.T.)
	Thence
	N. 0° 18' W., with new measurement.
	Desc. 160 ft. over N. slope, changing to NE. slope.
15.30	A branch, 4 lks. wide, course NW.; thence over W. slope.
23.50	A spur, slopes W.; desc. 162 ft. over broken NW. slope.
29.50	A graded and graveled logging road, bears NE. and SW.
39.10	A spring branch, 1 lk. wide, course NW.