

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of Portion of the Subdivisional Lines of T. 29 S., R. 7 W.

CHAINS

From the cor. of secs. 14, 15, 22 and 23, monumented with an iron post, 2 ins. diam., 10 ins. above ground, firmly set, marked and witnessed as described in the official record.

N. 0° 17' E., bet. secs. 14 and 15.

Ascend 200 ft. over SW. slope through heavy timber and dense undergrowth.

7.20 Spur, slopes SE.; descend 15 ft. along broken E. slope.


19.65 Branch, 5 lks. wide, course SE.; asc. 310 ft. over broken SW. slope.

32.70 Graded road, 20 lks. wide, bears NW. and SE.

36.98 Woven wire fence, bears E. and W.

39.08 Point for the 1/4 sec. cor. of secs. 14 and 15, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 28 ins. in the ground, with brass cap marked

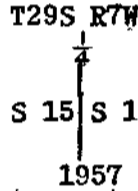

from which

A fir, 28 ins. diam., bears (bearing and distance not recorded) marked 1/4 S15 BT.

No other bearing objects or bearing trees available.

Ascend 105 ft. over SW. slope.

47.25 Ridge, bears E. and W.; descend 370 ft. over broken NW. slope.

60.90 Head of ravine, drains NW.; ascend 40 ft. along W. slope.


67.40 Spur, slopes NW.; descend 240 ft. over broken NW. slope.

78.16 The cor. of secs. 10, 11, 14 and 15, determined at record bearing and distance from the only remaining original bearing tree:

An uprooted madrona, 18 ins. diam., with faint scribe marks visible on decayed blaze, the stump hole of which bears S. 18° W., 50 lks. dist.

At the corner point

Set an iron post, 3 ft. long, 2 ins. diam., 28 ins. in the ground, with brass cap marked

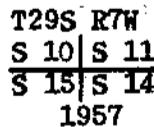

from which new bearing trees,

A fir, 12 ins. diam., bears N. 77 1/2° E., 44 lks. dist., marked T29S R7W S11 BT.

A fir, 13 ins. diam., bears S. 70 1/2° E., 30 lks. dist., marked T29S R7W S14 BT.

A fir, 7 ins. diam., bears S. 51 1/2° W., 79 lks. dist., marked T29S R7W S15 BT.