


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivisional Lines, T. 28 S., R. 4 W.

CHAINS

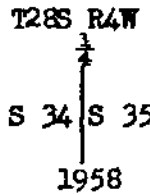

from which

A fir, 15 ins. diam., bears N. $11\frac{1}{2}^\circ$ W., 222 lks. dist., marked $\frac{1}{4}$ S34 BT.

Reset county surveyors cor. material alongside iron post.

N. $0^\circ 04'$ E., beginning new measurement.

Ascend 349 ft. over S. slope changing to SW. slope, through scattering timber and undergrowth along the E. edge of logged area.

- 11.37 Enter heavy timber, edge bears NW. and SE.
- 18.50 Top of ascent, slopes W.; descend 19 ft. along W. slope.
- 23.48 Ravine, drains SW.; ascend 376 ft. over SW. slope changing to S. slope
- 38.84 The cor. of secs. 27, 26, 34 and 35, determined at record bearing and distance from the remains of the original SW. bearing tree and substantiated by the rotted stumps of two other bearing trees, as follows:


A rotted madrone stump, bears S. 65° W., 58 lks. dist., with scribe marks BT visible in old blaze.

A rotted madrone stump, bears N. 40° E., 56 lks. dist., with rotted blaze.

A rotted madrone stump, bears N. 15° W., 36 lks. dist., no scribe marks visible.

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap marked

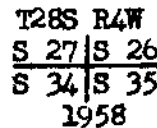

from which

A fir, 10 ins. diam., bears N. $43^\circ 45'$ E., 85 lks. dist., marked T28S R4W S26 BT.

A fir, 18 ins. diam., bears S. $21\frac{1}{4}^\circ$ E., 40 lks. dist., marked T28S R4W S35 BT.

A cedar, 13 ins. diam., bears S. 30° W., 67 lks. dist., marked T28S R4W 34 BT.

A fir, 13 ins. diam., bears N. $72\frac{1}{4}^\circ$ W., 62 lks. dist., marked T28S R4W S27 BT.

Land, mountainous. Soil, clay and rocky clay. Timber, fir, cedar, madrone and alder; undergrowth, hazel, arrowwood, poison oak, blackberry, Oregon grape and reproduction of fir, cedar and alder.

From the cor. of secs. 23, 24, 25 and 26.

N. $88^\circ 21'$ W., bet. secs. 23 and 26.