

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of Portion of Sundivisional Lines, T. 25 S., R. 4 W.

CHAINS

from which

An alder, 6 ins. diam., bears N. 52° 45' E., 55 lks. dist., marked $\frac{1}{4}$ S13 BT.

A cedar, 20 ins. diam., bears S. 13 $\frac{1}{2}$ ° W., 104 lks. dist., marked $\frac{1}{4}$ S24 BT.

The corner falls on the right bank of Cassy Creek, 10 lks. wide, course N.

Ascend 15 ft. over NE. slope.

38.78 Branch, 5 lks. wide, course NE.; ascend 184 ft. over NE. slope.

40.13 Abandoned skid road, 20 lks. wide, bears NE. and SW.

46.70 Spur, slopes N.; descend 16 ft. over NW. slope.

48.70 Ravine, course N.; ascend 131 ft. over E. slope.

49.65 Main access road, 30 lks. wide, bears NE. and SW.

55.20 Skid road, 20 lks. wide, bears N. and S.

56.45 Spur, slopes NE.; descend 108 ft. over W. slope.

62.82 Ravine, course W.; ascend 155 ft. over E. slope.

65.63 Abandoned skid road, 20 lks. wide, bears NW. and SE.

67.22 Spur, slopes NE.; descend 47 ft. over N. slope.

73.72 The cor. of secs. 13, 14, 23 and 24.

Land, mountainous. Soil, stony clay and loam. Timber, fir, cedar, hemlock, maple, chinquapin and dogwood; undergrowth, salal, vine-maple, hazel, poison oak and ocean spray.

N. 2° 04' W., bet. secs. 13 and 14.

Descend 180 ft. over NW. slope.; through heavy timber and dense undergrowth.

4.35 Spring branch, 2 lks. wide, course E.; ascend 185 ft. over SE. slope changing to E. slope.

22.65 Spur, slopes NE.; descend 435 ft. over N. slope changing to NW. slope

31.57 Skid road, 20 lks. wide, bears NW. and SE.


37.24 Same skid road, bears E. and W.

39.10 Skid road, bears N. 75° W. and S. 75° E., 20 lks. wide.

41.325 Point for the $\frac{1}{4}$ sec. cor. of secs. 13 and 14, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 28 ins. long, 2 $\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap marked

T25S R4W

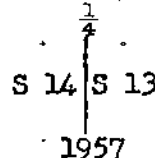

from which

A fir, 12 ins. diam., bears S. 31° E., 35 lks. dist., marked