


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of Portion of Subdivisional Lines, T. 25 S., R. 4 W.

CHAINS

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap marked

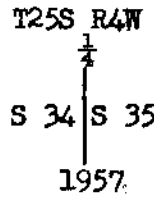

from which

A fir, 14 ins. diam., bears S. $74\frac{1}{4}^\circ$ E., 104 lks. dist., marked $\frac{1}{4}$ S35 BT.

Deposit county surveyor's corner post alongside iron post.

N. $1^\circ 05'$ W., beginning new measurement.

Ascend 239 ft. over SE. slope, changing to S. slope.

15.42 Spur, slopes W.; descend 267 ft. over NW. slope.


20.91 Leave timber, enter burned area with scattered fir snags and dense undergrowth, edge bears E. and W.

27.40 Creek, 2 lks. wide, course W.; ascend 283 ft. over SE. slope.

36.10 Spur, slopes SW.; descend 42 ft. along broken W. slope.

39.42 The corner of secs. 26, 27, 34 and 35, restored by the county surveyor by double proportionate measurement in 1955 and monumented with an iron post, 1 in. diam., 12 ins. above ground, firmly set, with brass cap marked

COUNTY SURVEYORS

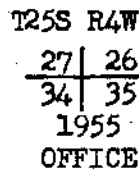

from which county surveyor's bearing trees:


A cedar, 60 ins. diam., bears N. $32\frac{1}{4}^\circ$ E., 401 lks. dist., marked T25S R4W S26 CS BT on a partially healed blaze.

A madrone, 6 ins. diam., bears N. $56\frac{1}{4}^\circ$ E., 94 lks. dist., marked S26 CS BT on a partially healed blaze.

A madrone, 5 ins. diam., bears S. $29\frac{1}{4}^\circ$ E., 27 lks. dist., marked S35 CS BT on a partially healed blaze.

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap marked

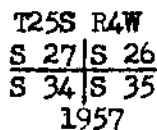

from which

A cedar, 20 ins. diam., bears N. $60\frac{1}{2}^\circ$ E., 365 lks. dist., marked T25S R4W S26 BT.