

County Surveyor's Record, ²⁵ Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivisional Lines of T. 20 S., R. 8 W.

CHAINS

Land, mountainous. Soil, rocky clay. Timber, fir, hemlock, maple, cedar, alder, chinquapin, dogwood, madrona, and cascara. Undergrowth, vine maple, hazel, huckleberry, slickleaf, arrowwood, and salal.

N. 0° 10' E., bet. secs. 14 and 15.

Ascend 220 ft. over SE. slope, through heavy timber and dense undergrowth.

10.75 Spur, slopes S. 30° E.; desc. 62 ft. along E. slope.


17.40 Branch, 2 lks. wide, course S. 55° E.; asc. 321 ft. over SW. slope.

25.60 Spur, slopes SE.; desc. 330 ft. over NE. slope.

34.50 Branch, 3 lks. wide, course S. 60° E.; asc. 74 ft. over S. slope, changing to SE. slope.

38.05 Point for the $\frac{1}{4}$ sec. cor. of secs. 14 and 15, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 3 ft. long, 1 in. diam., 28 ins. in the ground, with brass cap marked

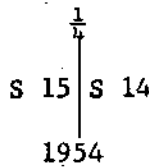

from which

A maple, 18 ins. diam., bears S. 41° E., 40 lks. dist., marked $\frac{1}{4}$ S14 BT.

An alder, 14 ins. diam., bears S. 56 $\frac{1}{2}$ ° W., 43 lks. dist., marked $\frac{1}{4}$ S15 BT.

Ascend 490 ft. over SE. slope.

51.20 Ridge, bears N. 80° W. and S. 80° E.; desc. 71 ft. over NE. slope.


55.30 Ravine, drains SE.; asc. 119 ft. over SE. slope.

60.60 Ridge, bears E. and W.; desc. 379 ft. over NE. slope.

68.30 Ravine, drains NW.; asc. 94 ft. over SW. slope.

76.10 Point for the cor. of secs. 10, 11, 14, and 15, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 3 ft. long, 2 ins. diam., 28 ins. in the ground, with brass cap marked

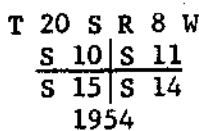

from which

An alder, 9 ins. diam., bears N. 5 $\frac{1}{2}$ ° E., 12 lks. dist., marked T20S R8W S11 BT.

A fir, 24 ins. diam., bears S. 31 $\frac{3}{4}$ ° E., 7 lks. dist., marked T20S R8W S14 BT.