

County Surveyor's Record, <sup>27</sup>Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivisional Lines of T. 20 S., R. 8 W.

CHAINS


- 61.55 Spur, slopes N. 15° W.; desc. 236 ft. over W. slope.
- 65.59 Ravine, drains N. 15° W.; asc. 199 ft. over NE. slope.
- 70.41 Spur, slopes N.; desc. 82 ft. over NW. slope.
- 73.45 Ravine, drains N. 10° E.; asc. 172 ft. over NE. slope.
- 77.42 Spur, slopes NW.; desc. 85 ft. over SW. slope.
- 79.29 The cor. of secs. 10, 11, 14, and 15.

Land, mountainous. Soil, rocky clay. Timber, fir, hemlock, maple, cedar, alder, chinquapin, dogwood, madrona, and cascara. Undergrowth, vine maple, hazel, huckleberry, slickleaf, arrowwood, and salal.

N. 0° 15' E., bet. secs. 10 and 11.

Ascend 55 ft. over SW. slope, through heavy timber and dense undergrowth.

- 6.25 Spur, slopes N. 60° W.; desc. 458 ft. over NW. slope.
- 15.70 North Sister Creek, 12 lks. wide, in 65 lks. wide rock bed, course W.; asc. 202 ft. over S. slope, changing to W. slope.
- 38.05 Point for the  $\frac{1}{4}$  sec. cor. of secs. 10 and 11, at proportionate distance; there is no remaining evidence of the original corner.  
Set an iron post, 3 ft. long, 1 in. diam., 28 ins. in the ground, with brass cap marked

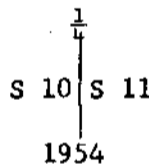


from which

An alder, 10 ins. diam., bears N.  $41\frac{1}{4}$ ° E., 23 lks. dist., marked  $\frac{1}{4}$  S11 BT.

A fir, 28 ins. diam., bears S. 36° W., 54 lks. dist., marked  $\frac{1}{4}$  S10 BT.

Descend 14 ft. along W. slope.

- 38.20 Branch, 5 lks. wide, course W.; asc. 476 ft. over broken SW. slope.
- 65.10 Spur, slopes W.; desc. 53 ft. over NW. slope.
- 67.05 Ravine, drains W.; asc. 155 ft. over SW. slope, changing to W. slope.
- 76.10 Point for the cor. of secs. 2, 3, 10, and 11, at proportionate distance; there is no remaining evidence of the original corner.  
Set an iron post, 3 ft. long, 2 ins. diam., 28 ins. in the ground, with brass cap marked

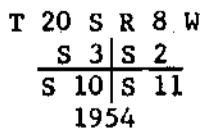

from which