


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivisional Lines, T. 25 S., R. 7 W.

CHAINS

T25S R7W

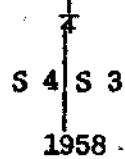

from which

A cedar, 15 ins. diam., bears N. 29° E., 51 lks. dist., mkd. $\frac{1}{4}$ S3 BT.

A fir, 22 ins. diam., bears N. 45° W., 71 lks. dist., mkd. $\frac{1}{4}$ S4 BT.

Corner falls on a spur, sloping S.

Ascend 690 ft. over S. slope.

57.80 Ridge, bears N. 80° E. and S. 80° W.; desc. 86 ft. over N. slope.

63.34 Ravine, course NW.; desc. 22 ft. along W. slope.

67.40 Abandoned dirt access road, 15 lks. wide, bears N. 30° E., curving to N. and S. 30° W., curving to W.

81.04 The cor. of secs. 3 and 4 only, on the N. bdy. of the Tp., determined at record bearing and distance from the three original bearing trees, as follows:


A dead and burned off fir snag, 25 ins. diam., bears N. 43° E., 22 lks. dist., opened a healed blaze and found portions of scribe marks.

A fallen and burned off fir, 20 ins. diam., bears S. 66° E., 19 lks. dist., no marks visible.

The root crown of a down and burned cedar, bears S. 65° W., 19 lks. dist., no marks visible.

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap mkd.

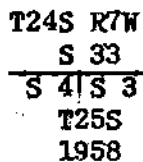

from which

A cedar, 28 ins. diam., bears S. 31° W., $32\frac{1}{2}$ lks. dist., mkd. T25S R7W S4 BT.

Raised a mound of stone, 3 ft. base, 2 ft. high, S. of the cor.

From this point the original closing cor. of secs. 33 and 34, of T24 S., R. 7 W., bears S. 89° 30' E., 314 lks. dist., which has been perpetuated with an iron bar, $\frac{1}{2}$ in. diam., firmly set, 8 ins. above ground, at record bearing and distance from 2 original bearing trees, as follows:

A sawed fir stump, 32 ins. diam., bears N. 61° E., 64 lks. dist., with a healed blaze.

A fir, 17 ins. diam., the southeasterly of a double fir, bears N. 20° W., 37 lks. dist., with healed blaze.

Land, mountainous.

Soil, rocky clay with scattering boulders and rock outcroppings.